

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 4, Township 142, Range 28, 5th P.M.

STATE OF MINNESOTA, County of CASS


At the corner location shown on the sketch:

On 8/25/82 found a GLO brass cap monument as set in 1928.
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

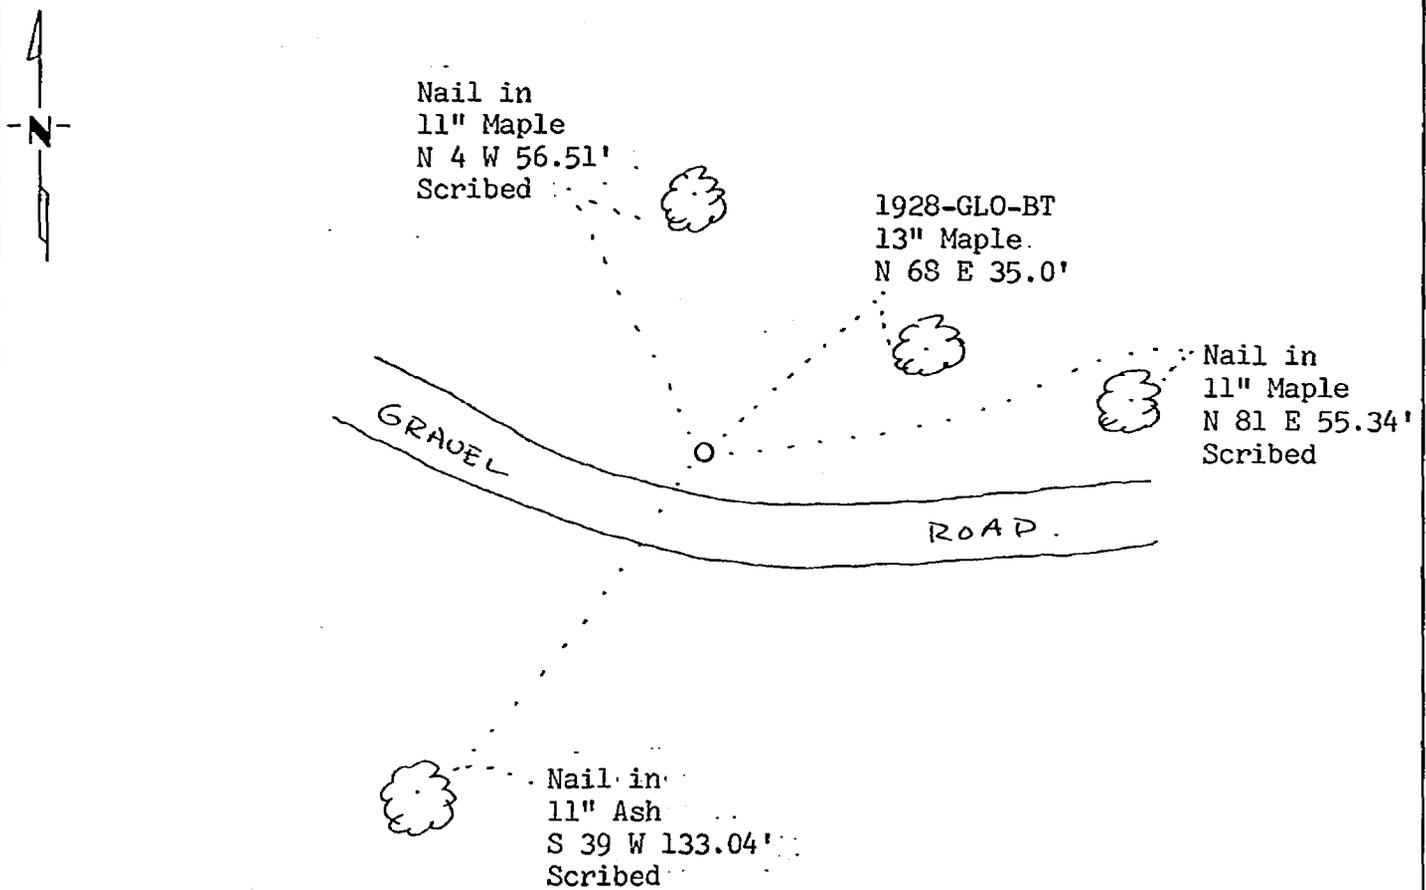

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Nancy A. Stevenson 9-13-82
SIGNATURE DATE

Registration No. 12684

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

264926
OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:15 A. .M. on the 14 day of Sept. A.D., 1982

County Recorder Deborah Hendricks
By MS, Deputy

DOCUMENT NO. 264926

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 12" W. Oak S 30 E 14 links and 4" ironwood N 15 W 13 links.
- 1928 U.S. General Land Office dependent resurvey reestablished this corner from evidence of original bearing trees: 16" Oak stump S 20 E 14 links with scribe marks and 24" W. Oak Stump S 75 W 15 links with scribe marks plain. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 7" Maple N 66-15 E 53 links and 8" Maple S 4-15 W 32 links.
- 1982 U.S. Forest Service technician C. Krause found the corner monumented with a brass cap monument bent west. Straightened and reset monument flush with the ground. The following bearing trees were found: 13" Maple N 68 E 35.0' with scar. Three new bearing trees were marked and are shown on this certificate. Steel sign posts were set 3.4' north and 3.9' south of the corner. Chained distance west from the NE corner of Sec. 4 which checked good with 1928 GLO distance. No evidence found of the original Oak stumps as area has been dozed over by road construction and Power line. No evidence found of the other 1928 bearing tree which now falls in road. Large rocks were placed around the monument. Corner falls 20'± north of gravel road.
- 1982 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1982 On Sept. 10 I visited the corner and found items as per the 1982 USFS reports. I accepted monument as marking the perpetuated position of the original corner based on the 1928 GLO bearing tree.