

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 3, Township 142, Range 28, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 8/31/82 found a 2" x 46" galvanized iron pipe set by County  
DATE  
 Surveyor in 1916.
  - left monument as found,  lowered monument,  removed monument (explain)
- On 8/31/82 placed a 2" x 36" galvanized iron pipe with a 3" marked  
DATE  
 brass cap.

### SKETCH OF REFERENCE TIES

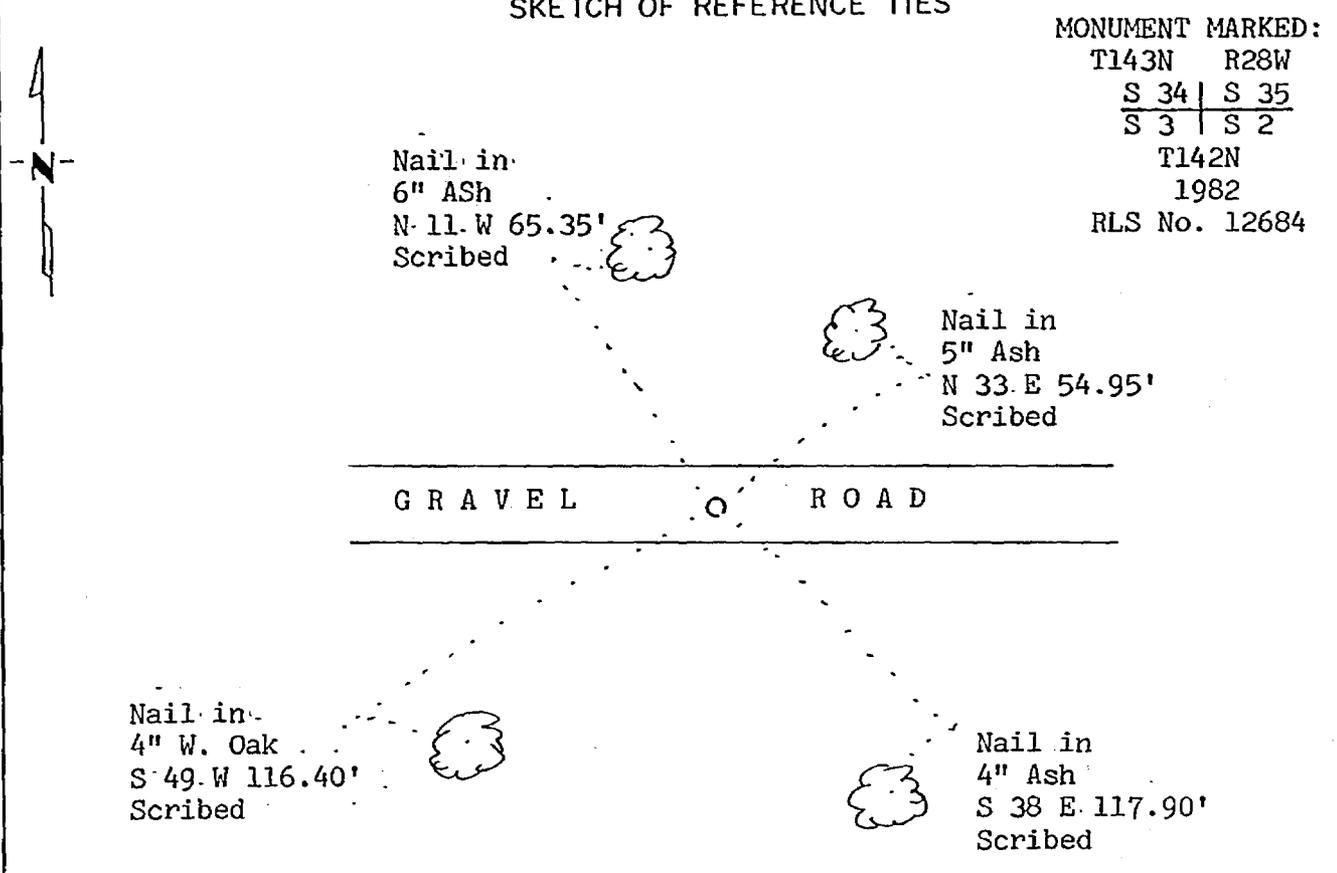

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stevenson 9-13-82  
SIGNATURE DATE

Registration No. 12684

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

264929  
 OFFICE OF THE COUNTY RECORDER  
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:18 A.M. on the 14 day of Sept. A.D., 1982

County Recorder Dorothy Herdreich

By MS, Deputy

DOCUMENT NO. 264929

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 12" Ash N 20 E 8 links, 6" Ironwood N 45 W 20 links, 8" Ash S 75 E 18 links, and 5" Spruce S 35 W 20 links.
- 1916 County Surveyor's Record Book B pages 220 to 242 show survey by Baldwin. The notes show old original bearing tree found: 8" Ash stump S 75 E 18 links. Set 2½" county iron pipe for the corner. New ties: 24" Elm S 50 W 42.60' and 10" Basswood N 11 E 39.30'.
- 1928 U.S. General Land Office dependent resurvey found the corner marked by a brass cap iron pipe monument set in 1920 by Harrington from evidence of original BT. Harrington's notes were lost. Also found county iron alongside. No new bearing trees were taken.
- 1982 U.S. Forest Service technician C. Krause found 2" x 46" galvanized iron pipe bent under road. The base was in place. It was replaced with a 2" x 36" galvanized iron pipe with a marked brass cap. The old Iron was straightened and reset alongside. No evidence was found of the GLO monument set in 1928. Four new bearing trees were marked and are shown on this certificate. Chained distance west to the North ¼ corner of Sec. 3 which checks good with the 1928 GLO distance. The monument is down 12" below road surface. A 4" x 4" x 7' Cedar post was set 22.3' north of the corner.
- 1982 On Sept. 6 I visited the corner and found items as per the 1982 USFS reports. I accepted the found pipe as the one set in 1916 and thus marking the perpetuated position of the original corner. I found no evidence of the 1916 bearing trees. The Elm position fell under a power line and the area had been dozed over by the road construction.