

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 26, Township 143, Range 28, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 8/30/82 found a 2" capped galvanized iron pipe as set by County  
DATE  
Surveyor in 1916.
- left monument as found,  lowered monument,  removed monument (explain)
- On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

### SKETCH OF REFERENCE TIES

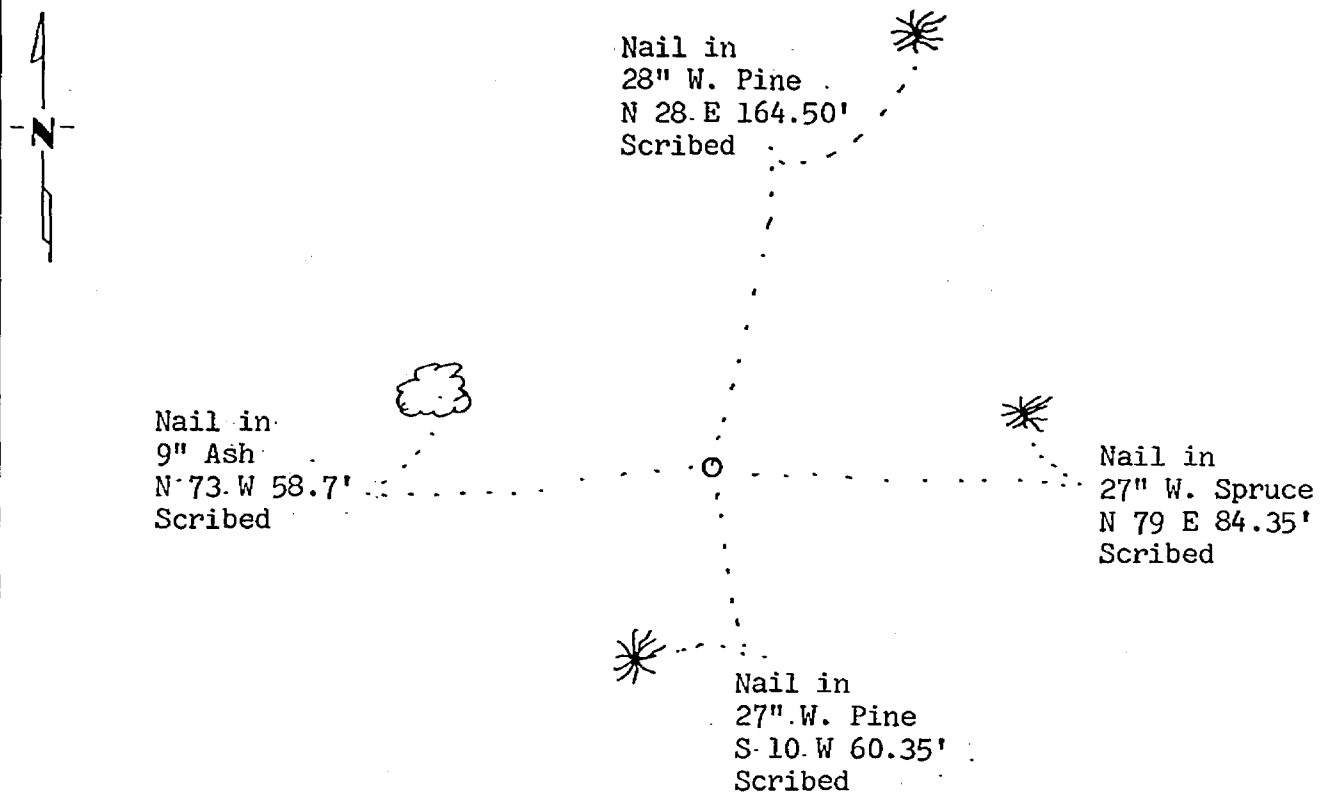

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stevenson 9-13-82  
SIGNATURE DATE

Registration No. 12684

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

264935  
 OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:40 A.M. on the 14 day of Sept. A.D., 1982

County Recorder Deulah Herdinko

By MS, Deputy

DOCUMENT NO. 264935

## Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 10" Fir S 49. E 28 links, 14" Cedar S. 40 W 38 links, 10" Fir N 68. W 33 links, 10" Birch N 20 E 5 links.
- 1916 County Surveyor's Record Book B pages 220 to 242 show survey by Baldwin. The notes show that no evidence of the corner was found. The area had been badly burned. The corner was reestablished on line and midway between the East  $\frac{1}{4}$  corner of Sec. 26 and the East  $\frac{1}{4}$  corner of Sec. 23. Distance shown of 2627.28' between the  $\frac{1}{4}$  corners and the section corner. Symbol on map shows 2 $\frac{1}{2}$ " iron pipe with cap set for corner.
- 1928 U.S. General Land Office dependent resurvey found the corner marked by a 2 $\frac{1}{2}$ " iron pipe with unmarked cap up 12". No evidence was found of the original bearing trees. They accepted the pipe as marking the corner. No new bearing trees were taken. They give a distance of 2634.7' south to the East  $\frac{1}{4}$  corner of Sec. 26.
- 1982 U.S. Forest Service technician C. Krause found a 2 $\frac{1}{2}$ " galvanized iron pipe up 16". No evidence of bearing trees was found. Measured 2634.12' to iron from the East  $\frac{1}{4}$  corner of Sec. 26. Pipe was left in place and four new bearing trees were marked and are shown on this certificate. A steel sign post was set 4.0 east and a 4" x 4" x 7' cedar post was set N 87 W 95.0'. Corner is approximately 130' east of C.S.A.H. No. 8. Large rocks were placed around the pipe.
- 1982 On Sept. 10 I visited the corner and found items as per the 1982 USFS reports. It is evident that Baldwin did not use the proper method of reestablishing this corner in 1916. He should have used double proportion instead of a single proportion. However, since the GLO resurvey accepted the position in 1928 and the monument has marked the undisputed position for over 60 years, I feel it should be accepted as the corner.