


CERTIFICATE OF LOCATION OF GOVERNMENT CORNERNORTH QUARTER Corner of Section 18, Township 145 N, Range 29 W, 5th P.M.STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

 On 11/20/81 found a 2" x 5' IRON PIPE WITH BRASS CAP
DATE left monument as found, lowered monument, removed monument (explain) On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

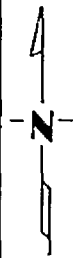


Monument marked:

T145N, R29W

1/4 $\frac{S7}{S18}$

1958

R.L.S. 3628

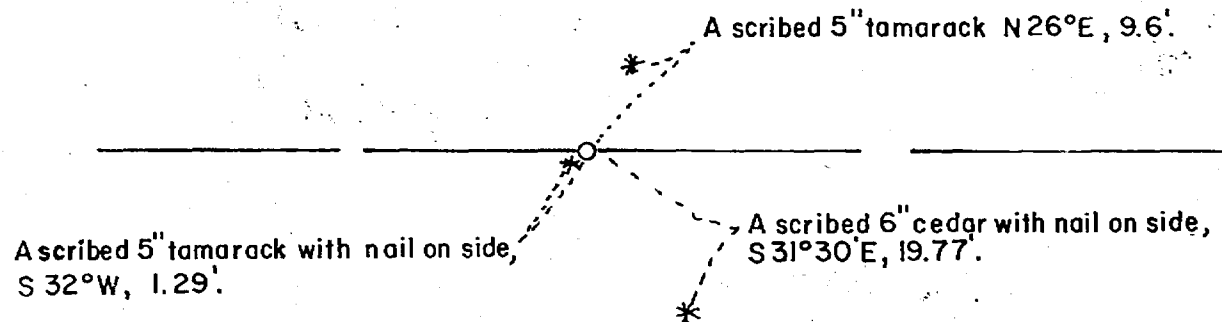

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Anthony C. Keick 11/30/81
SIGNATURE DATERegistration No. 12266 Land Surveyor, Professional Engineer County Surveyor, County Engineer265246
OFFICE OF THE COUNTY RECORDERCounty of CassI hereby certify that this document was filed in the Co. Recorders office at 9:15 A. .M. on the 29 day of Sept. A.D., 1982County Recorder Burdah HardinBy MS County Recorder, DeputyDOCUMENT NO. 265246

Statement of Evidence:

NORTH QUARTER CORNER OF SECTION 18, TOWNSHIP 145 NORTH,
RANGE 29 WEST OF THE 5th PRINCIPAL MERIDIAN.

The original Public Land Survey was run in 1874 by Bonger. He placed a wood post to mark the corner and recorded two bearing trees as accessories: an 8 inch Tamarack North 5 degrees 7 links, a 5 inch Tamarack South 37 degrees East 17 links.

In 1958, Peter J. Meyer, Registration No. 3628, found the corner marked by partly decayed 3 inch by 3 inch scribed Cedar post and the remains of two original bearing trees: a 10 inch windfall with scribe visible North 5 degrees East 7 links, a 9 inch windfall with scribe "5" visible South 37 degrees East 17 links.

He set a marked brass cap on a 5 foot long, 2 inch diameter, iron post and recorded the following bearing trees as accessories: a 5 inch Tamarack North 46 degrees West 21.2 feet, a 4 inch Tamarack South 24 degrees East 8.9 feet, a 4 inch Tamarack North 26 degrees East 9.6 feet.

In 1981 A. Kerick, Registration No. 12266, did not find any evidence of the two original bearing trees, but did find the marked brass cap on an iron post and the following bearing trees recorded by P. Meyer in 1958: a 6 inch Tamarack windfall, scribing visible, North 46 degrees West 21.2 feet, a 5 inch Tamarack, living, North 26 degrees East 9.6 feet. Two new bearing trees were marked as accessories and appear on this certificate.

An analysis of the above data indicates that the location of this Public Land Survey corner has been perpetuated by the brass capped iron post as recorded by P. Meyer in 1958 and the accessories as recorded by A. Kerick in 1981.