

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 10, Township 142, Range 26, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 2/2/87 placed a 2" x 48" galv. iron pipe with 3" marked brass cap.
DATE

SKETCH OF REFERENCE TIES

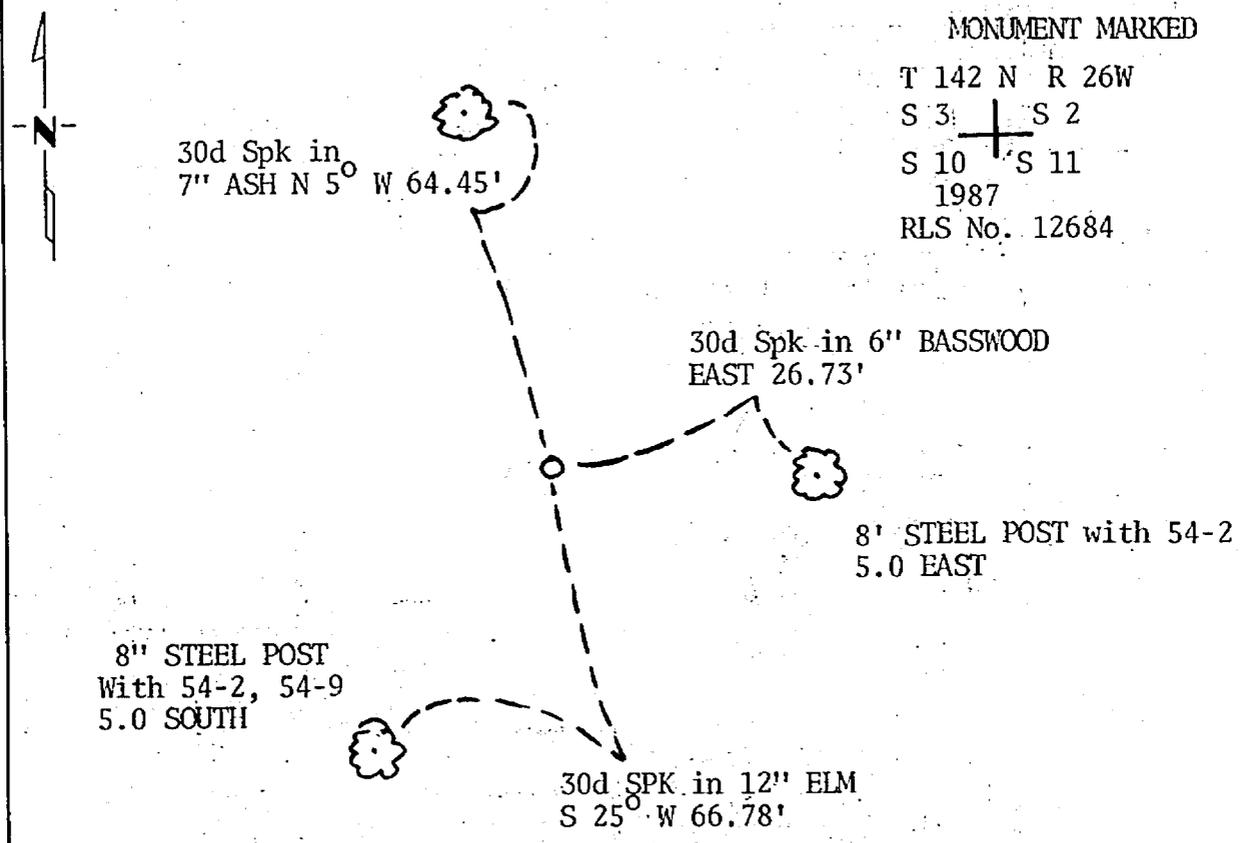

MONUMENT MARKED
 T 142 N R 26W
 S 3 S 2
 S 10 S 11
 1987
 RLS No. 12684

ALL TREES ARE DOUBLE BLAZED, SCRIBED & PAINTED RED WITH 54-3 TAGS
 BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page. 295278

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.
Mary H. Steiner 2/21/87
 SIGNATURE DATE
 Registration No. 12684
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
 County of Cass
 I hereby certify that this document was filed in the Co. Recorders office at 2:30 P.M. on the 25 day of February A.D., 1987
 County Recorder Clondine Koyler
 By ms, Deputy
 DOCUMENT NO. 295278

Statement of Evidence:

- 1872 - U.S. General Land Office survey (set Wood post) for this corner and marked the following bearing trees: 18" W. Pine N 50° E 24 links, 8" Sugar N 15° W 26 links, 4" Sugar S 32° W 14 links, and 4" Maple S 37° E 6 links,
- 1963 -
1979 - U.S. Forest Service technicians searched for this corner, but found no evidence.
- 1986 - County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1986 -
1987 - After traversing around Sec. 3, we computed several positions for this corner based on lost and physical calls. No evidence of the corner was found. The area contained many large burned out pine stumps, but no positive evidence could be found that would identify any of them as the original bearing tree. No evidence was found of maple trees or stumps that would fit as bearing trees. After analyzing all possibilities, I determined the corner was lost and set it by double proportion method between the NE corner of Sec. 3 and the East ¼ corner of Sec. 10 for north-south position and between the North ¼ corner of Sec. 10 and Meander Corner No. 22 on the north line of Sec. 11. Distance from E¼ corner of Sec. 10 to NE corner of Sec. 3 was 8,141.20 feet which agreed reasonably well with the GLO distance of 122.50 chains (8085.00 feet). The north-south position was then determined 2658.35 feet north of the East ¼ corner of Sec. 10. Distance from North ¼ corner of Sec. 10 to M.C. No. 22 was 5750.49 feet which does not agree with the GLO distance of 90.50 chains (5973.00 feet). The east-west position was then determined 2541.65 feet east of the North ¼ corner of Sec. 10. The double proportion position was determined by intersecting right lines from the north-south and east-west positions. As a final check the positions of meander corners No.'s 25 and 26 to the north and No.'s 21, 23, and 24 to the east were computed lost and these field positions checked. The positions of 25 and 26 fit the lakeshore very well. No evidence was found of the corners or bearing trees. The call of a tamarack swamp near the S1/16 corner of Sections 2 and 3 also fit reasonably well. The computed position of MC No. 21 fell somewhat near the west shore of Lower Milton Lake. However, the positions computed for MC's No. 23 and 24 fell in the lake, completely missing the point of land. The section line did cross the point as shown on the original survey, but the distances did not agree.

On 2/2/87 we set a USFS monument, a 2" x 48" galvanized iron pipe with a 3" marked brass cap at the lost position. Ties were taken as shown on this Certificate and steel sign posts set 5.0' East and 5.0' South.