


# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 36, Township 141N, Range 28W, 5th P.M.  
 STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch: Latitude: 46° 59' 51.722"  
 Longitude: 94° 09' 44.206"

- On 6-20-88 found a Concrete monument with brass tablet (USFS)  
DATE
- left monument as found,  lowered monument,  removed monument (explain)
- On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES All distances are horizontal to nail in side of tree.  
 Not to Scale

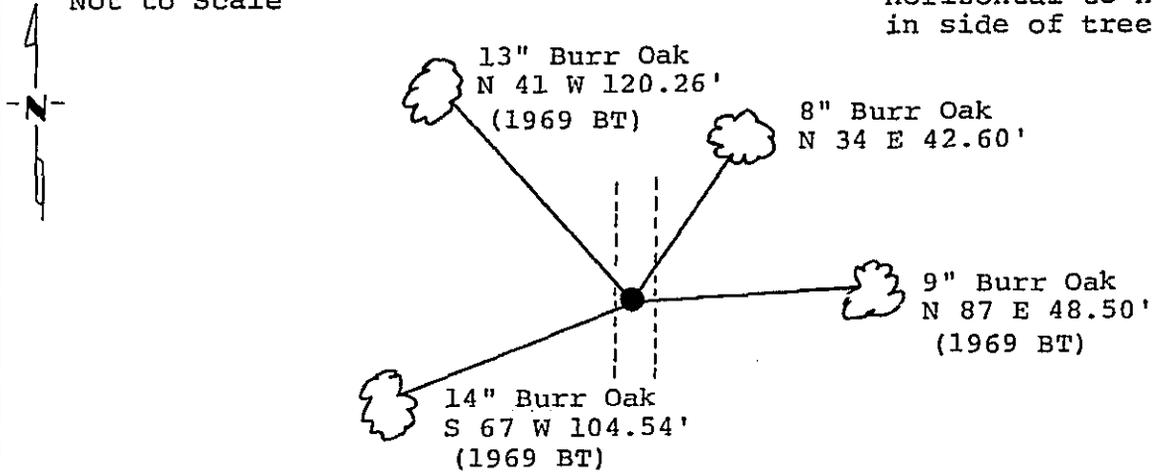

Monument is located in township road 18" under surface of gravel set 3/8"x12" Rerod over monument with Cap #17008 8' sign post East 20.0'

Monument Stamped

T 141 N  
 R 28 W R 27 W  
 S 25 S 30  
 S 36 S 31  
 1969  
 R.L.S. NO. 6807

All trees are painted with red enamel and marked with a 54-3 (Bearing Tree) tag.

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker  
 David S. Landecker 17008  
 Date 3/31/89 Registration No. \_\_\_\_\_

311165  
 OFFICE OF THE COUNTY RECORDER  
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 11:35A .M. on the 3rd day of April A.D., 1989

County Recorder Claudene Kaylor  
 By Byk, Deputy  
 DOCUMENT NO. 311165

Statement of Evidence:

Northeast Corner Section 36, Township 141  
North, Range 28 West, Cass County, Minnesota

V-25 141-28  
Bk.7 Pg.10

1874 P. H. Conger, U.S. Deputy Surveyor, originally established this corner position while running the East township line of Township 141 North, Range 28 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 4 inch Poplar South 87 degrees East a distance of 7 links; an 8 inch White pine South 47 degrees East a distance of 17 links; a 10 inch Poplar South 8 degrees West a distance of 25 links; and a 10 inch Maple North 80 degrees West a distance of 25 links.

1913 County Surveyor's Record Book A pages 564-567 show survey by John Curo. He set a 3 inch by 3 inch by 36 inch Tamarack stake and marked four stumps for ties.

1915 County Surveyor's Record Book B page 572 show survey by N.D. Gorman. He found stumps of the Southwest and Southeast original bearing trees, set spike.

1919 U.S. General Land Office dependant resurvey found the corner marked by a 2 inch galvanized iron pipe, set by County surveyor and original bearing tree remains: Southeast Pine stub and Poplar stump. A 2 inch by 36 inch iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: a 24 inch White Oak North 22 degrees 30 minutes East a distance of 203 links; a 12 inch Poplar South 16 degrees 45 minutes East a distance of 146 links; a 14 inch White Oak South 4 degree 30 minutes East a distance of 137 links; and a 28 inch Red Oak North 1 degree 30 minutes West a distance of 115 links.

1969 U.S. Forest Service records show the following: found a 16 inch piece of broken off 1919 General Land Office post in place, down 24 inches in road. Set a 6 inch by 24 inch concrete cylinder with bronze tablet and marked the following bearing trees: a 7 inch White Oak North 87 degrees East a distance of 48.65 feet; a 5 inch Elm South 42 degrees West a distance of 84.33 feet; an 11 inch White Oak South 67 degrees West a distance of 104.70 feet; and an 11 inch White Oak North 41 degrees West a distance of 120.43 feet.

1971 U.S. Forest Service Surveyor, Bill Okerman, Registered Land Surveyor Number 6807, filed corner certificate on February 19, with the Cass County Recorder as certificate number 619, using the 1969 information.

1988 a Landecker-Stevenson & Associates crew visited the corner and found the following evidence: spike set over 2 inch by 18 inch iron pipe over a capped iron pipe set on south side of concrete cylinder. Three of the 1969 bearing trees are in good condition as shown on front of this certificate. A new bearing tree was marked as shown and a steel sign post was set as noted on front of this certificate.