

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast \_\_\_\_\_ Corner of Section 34, Township 143, Range 25, 5th P.M.


STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On 10/26/90 found a 2½ inch aluminum capped monument 5 inches  
DATE  
above water.
- left monument as found,  lowered monument,  removed monument (explain)
- On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES

Not to Scale

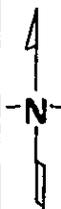

8' steel sign post  
N 45 W 20.00'

8' steel sign post  
N 45 E 20.00'



Monument is located  
 75'± into wet marsh.  
 No trees available  
 for ties.  
 8' steel sign post 2.03' south.

Monument Stamped  
 Dept. of the Interior  
 Do Not Disturb  
 T143N R25W  
S27/S26  
S34/S35  
 1983  
 Cadastral Survey  
 Bur. of Land Management

Statement of evidence relative to this corner location is on back of page. 325278

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[Signature] 11/28/90  
SIGNATURE DATE

Registration No. 17008  
 Land Surveyor,  Professional Engineer  
 County Surveyor,  County Engineer

OFFICE OF THE REGISTER OF DEEDS  
County of Cass

I hereby certify that this document was filed in the Reg. of Deeds office at 4:05 P. on the 29 day of November A.D., 19 90

Register of Deeds [Signature]  
 By [Signature], Deputy  
 DOCUMENT NO. 325278

Northeast corner, Section 34, Township  
143 North, Range 25 West, Cass County,  
Minnesota

V-17

1872 Hayward and Griffin, U.S. Deputy Surveyors, originally established this corner position while subdividing Township 143 North, Range 25 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 16 inch White Oak North 64 degrees East a distance of 5 links; a 4 inch Sugar Maple North 30 degrees West a distance of 10 links; a 6 inch Linden South 30 degrees West a distance of 7 links; and an 8 inch Sugar Maple South 46 degrees East a distance of 22 links.

1976 Bureau of Land Management dependent resurvey reestablished this corner proportionally. A 2 and 1/2 inch by 28 inch aluminum pipe with an aluminum cap was set to mark the corner. The following bearing trees were marked: an 11 inch Aspen North 33 degrees East a distance of 82 links; and a 10 inch Aspen North 16 degrees West a distance of 68 links.

1979 Gary Stevenson & Associates, Inc., survey crew found the 1976 Bureau of Land Management monuments around Section 34, Township 143 North, Range 25 West. They were used to subdivide said section.

1983 Mr. Stevenson alerted the Bureau of Land Management to information from a 1900 U.S. Corps of Engineers survey which could affect the Bureau of Land Management's 1976 survey in the township. 1983 Bureau of Land Management performed a corrective dependent resurvey based on Mr. Stevenson's 1983 notification. They removed and destroyed the corner and accessories marked in the 1976 Bureau of Land Management survey. A new 2 and 1/2 inch by 28 inch aluminum pipe with stamped brass cap was set to mark the corner. The following bearing trees were marked: a 4 inch Elm North 2 degrees East a distance of 83 links (54.78 feet); and a 3 inch Birch North 40 degrees West a distance of 104 links (68.64 feet). The corners whereby this corner was proportioned from (the north) were reset due to the U.S. Corps of Engineers information that led to the recovery of original corners to the north and east of this section. Therefore, this corner was reset at the proportional position using this new information.

1990 on October 26, a Landecker & Associates, Inc., survey crew found the 2 and 1/2 inch aluminum capped monument 5 inches above water as set by the Bureau of Land Management in 1983. No evidence was found of the 1983 bearing trees. Steel sign posts were set as noted on front of this certificate.