


T. 137 R. 30 M. 5TH Coordinates: X _____ Y _____
SE 36 Corner common to sections 36 AND 31-137-29

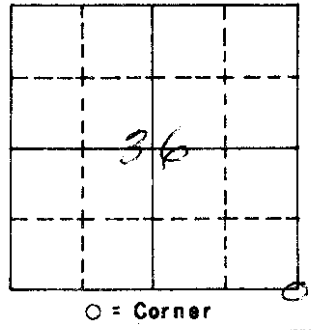

EXISTING SURVEYS

Original Government Survey

Year surveyed 1858
Original monument Post

Species	Bearing	Trees
<u>PINE</u>	<u>PINE</u>	
<u>11"</u>	<u>12"</u>	
<u>N71E</u>	<u>N71 1/4 W</u>	
<u>34LKS</u>	<u>39LKS</u>	

Original Evidence Found

Year of search _____ By _____
Monument found _____

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1910 By JOHN CURO
Location filed COUNTY SURVEY RECORDS BOOK "B" P.318-328
Monument END GOVT B.T. STUMP: 12" PINE N74-15W 25.7', SET BY BX36' CONCRETE POST FROM B.T. OF B.B. BARTLETT: 22' PINE N49E 66.6' BARTLETT END 2 ORIG B.T.S IN 1898

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Evidence of Subsequent Corner Restoration

Year of search _____ By SURVEY OF STATE RURAL HWY DEPT COUNTY BOOK B' P.474-475 CONCRETE MONUMENT
1927 JOHN GREENE, COUNTY RESURVEY "E-33' I.M.
1977 R.F. Schneider for Hwy Dept CORP#28
Set Co. Cast iron monument - filed certificate

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
<u>Aspen</u>	<u>9"</u>	<u>N14°W</u>	<u>226.70'</u>
<u>low pole</u>		<u>S87E</u>	<u>181.70'</u>
<u>J. Pine</u>	<u>5"</u>	<u>S40E</u>	<u>166.12'</u>
<u>low pole</u>		<u>S42W</u>	<u>39.47'</u>

2-25

Subsequent Corner Restoration

Year surveyed 1911 By ?
Location filed micro film - roll 115 BK 73 P.3
Monument End true corner.

1910 - Curo - microfilm - roll 115 BK 91 P.28
End stump of NE B.T.

1986 / Jan 15 Walt Curo, Terry Freeman
End cast iron monument down 1'
set 2" x 24" I.P. over cast iron
set steel post and survey marker sign 1' South
New ties:

<u>3" Jack Pine</u>	<u>N45E</u>	<u>61.32'</u>
<u>3" Jack Pine</u>	<u>S20E</u>	<u>32.42'</u>
<u>Power Pole</u>	<u>S51W</u>	<u>63.75'</u>

(old power poles gone)

Evidence of Subsequent Corner Restoration Found

Year of search _____ By CERTIFICATE - R.F. SCHNEIDER - 1977
Doc # 235,382

1998 - CCSD

Fd. in place 1 1/2" OD IP .5' above grd. 23'
S of & Co. RD. 114. I.P. was skewed; plummed
pipe and pulled ties as noted.

<u>9" J. Pine</u>	<u>61.32'</u>	<u>N 45° E</u>
<u>16" J. Pine</u>	<u>96.19'</u>	<u>S 52° E</u>
<u>B.T. stump</u>		<u>S 20° E</u>
<u>P. Pole</u>	<u>63.75'</u>	<u>S 51° W</u>

(63.54') to SRP

Also fd. two hand Dept ties one dated
1-15-86 by W.C. and T.F. on I.P. and the other
on J. Pine W.C. and T.F. 1-16-85. J. Pine
didn't have nail in tree.