


T. 139 R. 29 M. 5th Coordinates: X _____ Y _____
NE 4 Corner common to sections 3, 4 and 33, 34-140-29

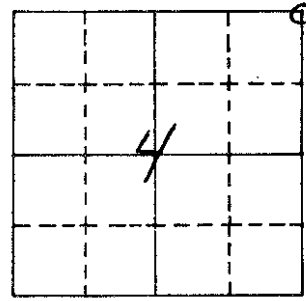

○ = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1865
Original monument POST

Original Evidence Found

Year of search _____ By _____
Monument found _____

Species	Bearing	Trees	Distance
<u>BL. PINE</u>	<u>ASPEN</u>	<u>BL. PINE</u>	<u>BL. PINE</u>
<u>16"</u>	<u>15"</u>	<u>8"</u>	<u>8"</u>
<u>N 37 1/2 E</u>	<u>N 9 1/2 W</u>	<u>S 1 W</u>	<u>S 4 1/2 E</u>
<u>142 LKS</u>	<u>92 LKS</u>	<u>60 LKS</u>	<u>65 LKS</u>

Original Bearing Trees Found

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1912 By JOHN CURO
Location filed COUNTY SURVEY RECORD BOOK "8" P. 200-211
Monument END OLD CANT BIT; STUMP 8" BL. PINE S 1 W
60 LKS, SET WOOD STAKE

Evidence of Subsequent Corner Restoration

Year of search 1969 By R. F. Schneider
Found old 2" x 2" oak stake in place

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
<u>BIRCH</u>	<u>8"</u>	<u>S 3 20 W</u>	<u>25.55'</u>
<u>POPLAR</u>	<u>8"</u>	<u>N 75 05 E</u>	<u>41.02'</u>

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
<u>R. Oak</u>	<u>5"</u>	<u>N 10 W</u>	<u>8.73'</u>
<u>Poplar</u>	<u>10"</u>	<u>N 4 SE</u>	<u>2.60'</u>
<u>Poplar</u>	<u>10"</u>	<u>N 80 W</u>	<u>13.80'</u>

PK in lower blaze old old

A-13

Subsequent Corner Restoration

Year surveyed 1975 By Walter Curro
Location filed Certificate - 223880
Monument Found 1" iron rod BT set by
John W. Curro and rotted cedar post
for section corner. Set c/m in place
of wood post in edge of road 8' west
of center.

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
PLAT - FIRST ADDITION TO BIRCH PARK
JOHN E. HOWARD 1957

Ties:

- 5" R. Oak N 49-28 W 13.28'
- 6" R. Oak S 65-30 W 32.90'
- 1" Iron Rod S 45-00 W 47.00'
- Power Pole S 23-30 E 63.05'

PLAT - TREDNIK SAND LAKE ADDITION
MYRON LANDWEKER 1981

CERTIFICATE - WALT CURRO - 1975
DOC. # 223880

AUG. 2000 - CCSO

Found in place; bottom casting of CIM down
1.0'. Top is destroyed, but checks w/ plat dist.
to a find. IP. Located 11' W & 19' S of E
Boat Access Rd. - 16' N of E Driveway.

REF. TIES:

<u>10" R. Oak</u>	<u>N 40° W</u>	<u>76.30'</u>
<u>5" R. Pine</u>	<u>N 39° E</u>	<u>64.08'</u>
<u>(TAG) P. Pole</u>	<u>S 32° E</u>	<u>64.27'</u>
<u>6" Pin Oak</u>	<u>S 33° W</u>	<u>47.41'</u>

* dist. to dbl. hd. nail.

1945 - J. W. Curro - microf. film roll 155 BK 271 P. 11, 14
Temp. sec. corner - 2x80" iron set by B.B.B.
30' west of fence corner

1924 - John Greene - microf. film roll 125 BK 189 P. 4
End SE. Bit. Stump

- ROCK: 3' Dia N 53-25 E 105.1'
- cedar stake 4" S 45 E 46.7'
- " " " N 45 W 46.7'
- Iron pin 1 1/2" x 2" S 45 W 46.7'

CORNER GPS CCSO 8/8/02
CCSO Fd broken CIM, 10' ± W. of E down
0.9

Remonumentation certificate prepared _____

By _____

Filed at _____

Date _____