


T. 141 R. 28 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 32 Corner common to sections 28, 29, 32, 33

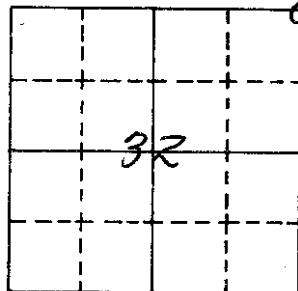

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874  
Original monument POST

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

Species	Bearing	Trunks
<u>N. PINE</u>	<u>N. PINE</u>	<u>W. BIRCH</u>
<u>17"</u>	<u>7"</u>	<u>12"</u>
<u>N57E</u>	<u>N53W</u>	<u>S30W</u>
<u>37 LKS</u>	<u>74 LKS</u>	<u>141 LKS</u>

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1914 By JAMES M. DOOLEY  
Location filed COUNTY SURVEY RECORD BOOK B<sup>1</sup> P 122-276  
Monument FND GALV I.P., REMAINS OF OLD GOVT BITS:  
17" N. PINE N57E 37 LKS, 7" N. PINE N53W 74 LKS.  
1916, E.B. HORST BOOK B<sup>1</sup> P 384-390 FND 2 1/2" x 4 1/8" GALV  
IRON W/ CAP SET BY M. DOOLEY  
1917 BEN CLARK BOOK B<sup>1</sup> P 67 FND I.M. IN TWP. ROAD

Species	Diameter	Bearing	Distance
<u>ROAK</u>	<u>7"</u>	<u>N0-47W</u>	<u>59.91'</u>
		<u>1916 - HORST - also on microf. film - roll 115 BK 77 P. 65</u>	

Evidence of Subsequent Corner Restoration

Year of search 1918 By GLO  
FILED AT: SECRETARY OF STATE FND 2" I.P.  
AND GOVT BITS: 14" PINE STUMP N57E 37 LKS, 12" PINE  
STUMP N53W 77 LKS SET 2x36" I.P.W/BRASS CAP  
7 1/4" IN RR BW  
529 / 528

Species	Diameter	Bearing	Distance
<u>W. PINE</u>	<u>8"</u>	<u>N63 1/2 W</u>	<u>99 LKS</u>
<u>N. PINE</u>	<u>10"</u>	<u>N32 3/4 E</u>	<u>94 LKS</u>

OVER

Subsequent Corner Restoration

Year surveyed 1919 By E.B. HORST  
Location filed COUNTY BOOK E<sup>1</sup> P 211  
Monument FND I.M.  
1942, JOHN CURR, BOOK D<sup>1</sup> P 286 I.M.  
TIES:  
15" N. PINE N34-25E 28.63', 16" R. OAK S69E 102.7'  
14" N. PINE S32-40W 79.6', 16" N. PINE N63-10W 61.80'

1968 - Co Hwy Dist - Co Rd #5 2" I.P. in place  
CORNER GPS 7/31/02 CCSO  
CCSO 7/31/02 Found alum. cap. men  
down 0.3', 22' ± S. of E. co. Rd. #5, on  
E. Shagrila.

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
1989 Certificate - David Landecker  
Doc. # 311161  
Found 1" iron pipe inside a 2" iron  
monument. Removed 1" iron pipe. Set 3/4"  
rod with aluminum cap inside 2" iron  
monument and cemented in place, top of  
cap is 3" below surface. TIES: 21" Norway  
Pine N4W 119.63'; 18" Norway Pine N26E  
104.40'; 15" Norway Pine S30E 135.23'; 19"  
Norway Pine S18E 137.09'.