


T. 141 R. 31 M. 5th Coordinates: X _____ Y _____

NE 6 Corner common to sections 5, 6 and 31, 32-142-31

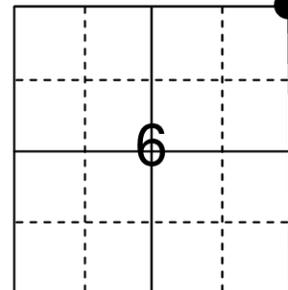

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument Post

Original Evidence Found

Year of search _____ by _____
Monument found _____

Bearing Trees

Species	Poplar	Y. Pine	Tamarack	W. Pine
Diameter	4"	14"	6"	18"
Bearing	N 4° E	N 30° W	S 28° W	S 41 1/2° E
Distance	68 links	100 links	42 links	142 links

Original Bearing Trees Found

Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 4/1916 By F.F. Wilson
Location filed: Survey Record #399, Book C, page 120 and Curo Monument: Curo Book 86, page 22. Search for GLO witnesses, none found.

Evidence of Subsequent Corner Restoration

Year of search 12/1917 By E.B. Horrst, LS 376
Location filed: Survey Record #399, Book C, page 125 and Curo Monument: Set IM Curo Book 86, pages 67 and 68. Set corner proportionately.

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

Species	White Pine	Norway Pine	Norway Pine
Diameter	12"	12"	12"
Bearing	N 47°15' E	N 79° W	S 87° E
Distance	69.7'	34.6'	40.4'

Subsequent Corner Restoration

Year surveyed 4/1919 By E.B. Horrst, LS 376
Location filed: Survey Record #473, Book C, page 498 and Curo Monument: Corner established previous to this survey Curo Book 86, page 74, Section resurvey, Sec 32-142-31

Evidence of Subsequent Corner Restoration Found

Year of search 7/1962 By R.H.McDonald, USFS
Location filed: USFS Book 2, page 51 T142N R31W
Monument: Found 2" ODIP tipped over in trail S31 | S32
Set 2" iron pipe with USFS brass cap, witnessed S6 | S5
8" Oak, N 49° W, 24.9' blazed T141N
11" Oak, S 78° W, 13.9' blazed 1962
Steel Sign Post, N 84° E, 3.05' RLS NO 3628

6/1925, J.M. Greene
Section resurvey, Contract of April 7, 1925, Doc. #81679
Indicates corner set by this survey, 545.2' SE of 1919 survey.
J.W. Curo, LS 1428

1978, M.E. Stefan, LS12261
Certificate of Survey, #1169
Indicates corner as USFS Brass capped iron pipe.

2/1931, R.A. Dahms, LS 936
Ditch Shelf 1, Book 158, page 30
Indicates iron pipe at the NE corner of Section 6.

1990, Landecker & Assoc.
Certificate of Location
Found Corner and NW bearing tree and accepted as location of the perpetuation of the 1925 Greene survey.

2/1942, J.W. Curo, LS 1428
Curo Book 425, pages 45-4
Indicates 2" IM with cap and witnessed as follows
5" Twin Red Oak, N 30°16' E, 41.20' to spot at base of tree
18" N. Pine, N 30°50' W, 52.40' to spot at base of tree
22" N. Pine, S 20°50' W, 63.0' to spot at base of tree
8" Red Oak, S 48°50' W, 43.00' to spot at base of tree

10/1990, D.S. Landecker, LS 17008
Certificate of Location, Doc, #327281
Found USFS corner, up 19" and witnesses.
10.5" Burr Oak, N 49° W, 24.99'(1962)
7" Aspen, N 8° W, 38.16'
11" Burr Oak, N 80° W, 93.72'
Steel Sign Post, West, 3.55' Steel Sign Post, East, 3.2'
Steel Sign Post, North, 3.6' Steel Sign Post, South, 3.50'

1937, USFS
USFS Book 2, page 51
8" Oak, West, 20 links(13.2') Metal location poster

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found

Year surveyed 2/2001 By T.L. Freeman, LS 21367

Year of search _____ By _____

Location filed: Certificate of Survey, #1098

Location filed:

Monument: Brass cap monument found

Monument:

8/2018, CCHD/SO
#2018.005

Found USFS brass capped 2" ODIP, up 2.8', 15'+/-, E. of trail.

12" B. Oak, N 49° W, 24.99'(1962) 20d spike, up 1.1', S. side

10" Aspen snag, N 8° W, 38'(1990)

12" B. Oak, N 80° W, 93.72'(1990) 20d spike, up 1.0', N. side

6" R. Oak, S 38° E, 11.24' duplex nail, up 1.0', E. side

Steel Sign Post, West, 3.7'(1990)

Steel Sign Post, East, 3.5'(1990)

Steel Sign Post, North, 3.7'(1990)

Steel Sign Post, South, 3.6'(1990)

