


T. 142 R. 28 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
E 1/4 2 Corner common to sections 1, 2

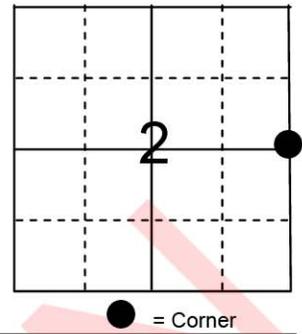

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species	<u>W. Pine</u>	<u>Spruce</u>
Diameter	<u>6"</u>	<u>6"</u>
Bearing	<u>S 55° E</u>	<u>S 35° W</u>
Distance	<u>15 links</u>	<u>27 links</u>

Original Bearing Trees Found

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 6/1916 By H.F. Baldwin, Deputy Surveyor  
Location filed: Survey Record #287 Book B, page 218 and Curo  
Monument: Set Iron Monument  
Curo Book 55, page 19, set proportionally and witnessed.

Evidence of Subsequent Corner Restoration

Year of search 8/1919 By E.B. Horst, LS 376  
Location filed: Survey Record No. 435, Book C, page 342  
Monument: Indicates corner.

Bearing Trees, Reference Objects

Species	<u>W. Oak</u>	<u>Birch</u>
Diameter	<u>9"</u>	<u>12"</u>
Bearing	<u>N 35° E</u>	<u>S 57° E</u>
Distance	<u>33.80'</u>	<u>33.60'</u>

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 6/1928 By E.G. Harrington, U.S. GLO  
Location filed: Minnesota Historical Society  
Monument: I.M.  
The field notes of a portion of the work executed by Harrington were lost. The proportional point for the corner is marked by a 2" galv. iron pipe, set by County Surveyor, no new iron post is set. New witness as follows:  
14" Birch, N 53°30' W, 96 links (63.36')

Evidence of Subsequent Corner Restoration Found

Year of search 9/2014 By CCHD/SO  
Location filed: #2009.025 T142 R28W  
Monument: Set 1"x 30" Alum. tube with alum. cap 1/4  
in rust ring, down 0.5', 1'+/-, E. of CL #157, S2|S1  
witnesses all good. 2014  
8/2019, CCHD/SO RLS 21367  
#2009.025  
Found mag nail, 3.5', E. of bituminous centerline #157, 2009  
witnesses all good.

12/1933, Boy Lake Township  
Final Road Order of Town Board  
Surveyor's Report and plat indicates road on the N. and E. lines of Sec. 2, No survey made as road follows section line.

7/2009, CCHD/SO  
#2009.025  
Found rust ring, down 1.5', runs westerly than becomes vertical and continues vertical for 1'+, -. set spike, 4'+, - E. of new centerline Co. Rd. #157 and witnessed:  
13" Burr Oak, N 88° E, 43.93' duplex nail, up 2.9', S. side  
Power Pole, N 11° W, 147.63' duplex nail, up 1.0', E. side  
10" Burr Oak, S 75° W, 72.69' duplex nail, up 1.0', S. side

