


T. 142 R. 28 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 11 Corner common to sections 1, 2, 11, 12

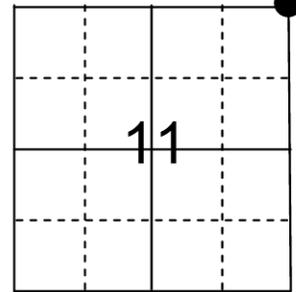

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874  
 Original monument Post

Original Evidence Found

Year of search 1916 by Baldwin  
 Monument found \_\_\_\_\_  
 Survey Rec #287 Bk B, pg 216

Bearing Trees

Species	Maple	Maple	Birch	Fir
Diameter	5"	4"	6"	12"
Bearing	S 42° W	S 10° E	N 45° W	N 40° E
Distance	16 links	42 links	26 links	22 links

Original Bearing Trees Found

Species	Maple (Dead)	Birch		
Diameter	5"	Stub		
Bearing	S 42° W	N 45° W		
Distance	16 links	26 links		

Subsequent Corner Restoration

Year surveyed 5/1916 By H.F. Baldwin, Deputy Surveyor  
 Location filed: Survey Record #287 Book B, page 216 and Curo  
 Monument: Set Iron Monument  
 Curo Book 55, page 7, set from GLO witness trees and  
 witnessed.

Evidence of Subsequent Corner Restoration

Year of search 8/1919 By E.B. Horst, LS 376  
 Location filed: Survey Record No. 435, Book C, page 342  
 Monument: I.M.  
 Indicates corner.

Bearing Trees, Reference Objects

Species	<u>Spruce (Stub)</u>		
Diameter	<u>14"</u>		
Bearing	<u>S 22° E</u>		
Distance	<u>41.50'</u>		

Bearing Trees, Reference Objects

Species			
Diameter			
Bearing			
Distance			

Subsequent Corner Restoration

Year surveyed 6/1928 By E.G. Harrington, U.S. GLO  
 Location filed: Minnesota Historical Society  
 Monument: I.M.

Evidence of Subsequent Corner Restoration Found

Year of search 9/2005 By T.L. Freeman, LS 21367  
 Location filed: Certificate of Survey  
 Monument: Found GLO brass cap monument

The field notes of a portion of the work executed by Harrington were lost. The original point for the corner is marked by a 2" galv. iron pipe, set by County Surveyor, no new iron post is set. New witness as follows:

- 16" Maple, S 5°30' E, 118 links (77.88')
- 8" Maple, S 20°45' W, 38 links (25.08')
- 20" W. Oak, N 75° W, 215 links (141.90')

7/2009, CCHD/SO  
 #2009.025

Found USFS brass capped iron pipe, down 0.5', 8'+, - E of centerline Co. Rd. 157. USFS 1993 witnesses all good.

8/2019, CCHD/SO  
 #2009.025

Found USFS brass capped iron pipe, 8'+, - E of centerline Co. Rd. 157. USFS 1993 witnesses all good.

12/1933, Boy Lake Township  
 Final Road Order of Town Board  
 Surveyor's Report and plat indicates road on the N. and E. lines of Sec. 2, No survey made as road follows section line.

7/1993, R. Main and C. Krause, USFS  
 USFS Book 6, page 12  
 Fd Co. 2 1/2" x 45" in place, top 12" bent at angle. Replace with 2" x 24" iron pipe with brass cap, down 8", 8' E. of Co. Rd. 157.

T142N R28W  
S2 | S1  
S11 | S12  
 1993  
 USFS

- 7" W. Oak, S 60° E, 73.20'
- 10" W. Oak, S 21° E, 79.95'
- 12" W. Oak, N 70° W, 79.02'
- 12" W. Oak, N 39° W, 108.55'
- Steel Sign Post, S 85° E, 16.5'

