


T. 142 R. 28 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NW 1/16 Corner common to sections 25

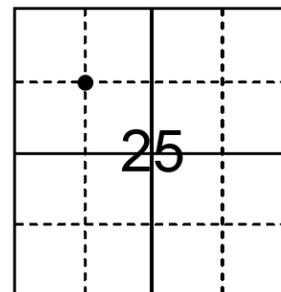

25

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 8/1919  
Original monument 1"x 36" I.P. w/Brass cap  
E.G. Harrington, U.S. GLO  
NW 1/16 S25  
1919

Original Evidence Found

Year of search 1919 by Horst  
Monument found GLO Brass Cap  
Survey Rec. #435, Bk C, pg 344

Bearing Trees

Species Red Oak Red Oak  
Diameter 6" 10"  
Bearing N 3° E S 22°45' W  
Distance 92 links 160 links

Original Bearing Trees Found

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 8/1919 By E.B. Horst, LS 376, Deputy  
Location filed: Survey Record #435, Book C, pg. 344 and Ditch  
Monument: U.S. I.M.  
Ditch Shelf 5, Book 34, page 8, states At Sta. 56645.4 U.S.  
I.M. N.W. 1/16 S. cor. Sec. 25.

Evidence of Subsequent Corner Restoration

Year of search 8/1985 By C.R. Krause, USFS  
Location filed: Field Book 1, page 54  
Monument: Found iron pipe bent over, 4 inches below road surface, base of iron in place and the following witness.

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Bearing Trees, Reference Objects

Species Red Oak  
Diameter 17"(GLO)  
Bearing N 3° E  
Distance 60.7'

Subsequent Corner Restoration

Year surveyed 6/1997 By C.R. Krause, USFS  
Location filed: Field Book 1, page 54  
Monument: Set 2"x 2' galvanized pipe with brass cap  
in place of GLO iron, 12" below Co. Rd T142N R28W  
#128 surface, Magnet below monument NW 1/16 S 25  
and witnessed as follows. 1997  
19" Red Oak, N 4° E, 60.7'(GLO) USFS  
9" Maple, N 55° W, 60.83'  
8" White Oak, N 22° W, 33.30'  
5.5" Red Oak, N 8° E, 51.69' 60d spike

Evidence of Subsequent Corner Restoration Found

Year of search 8/2020 By CCHD/SO  
Location filed: #2018.016  
Monument: Reset the USFS brass cap monument  
down 0.5', 1', +/-, N. of centerline Co. Rd. #128, 2018 witnesses  
are good.


5/2005, R. Main, USFS,  
Field Book 1, page 54  
Indicates Corner located with Global Positioning System  
(GPS), the 1997 iron and witness are OK.

6/2018, CCHD/SO  
#2018.016  
Found USFS brass cap monument, prior to reconstruction of  
Co. Rd. #128, , down 0.9', 1', +/-, N. of centerline, removed  
monument and witness as follows.  
Red Oak snag, N 4° E, 60.7'(GLO)  
8" Red Oak, N 8° E, 51.69'(1997) 60d spike, up 0.4', W. side  
Power Pole, S 36° E, 42.78' 16d duplex nail, up 1.0', E. side  
6" White Pine, S 20° W, 59.75' 16d duplex nail, up 1.0', W. side

Index No. 522

CASS COUNTY LAND CORNER RECORD

T. 142 R. 28 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NW 1/4 Corner common to sections 25

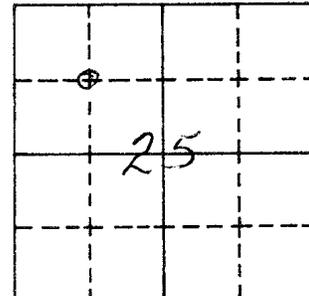

EXISTING SURVEYS

Original Government Survey

Year surveyed 1919  
Original monument 1x36" 1/4" w/ BRASS CAP NW 1/4 525 1919

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees  
Species ROAK ROAK \_\_\_\_\_  
Diameter 6" 10" \_\_\_\_\_  
Bearing N3E S22-45W \_\_\_\_\_  
Distance 92 LKS 160 LKS \_\_\_\_\_

Original Bearing Trees Found

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 1919 By E. B. HORST  
Location filed COUNTY BOOK 2 P. 344  
Monument FND U.S. I.M.

Evidence of Subsequent Corner Restoration

Year of search \_\_\_\_\_ By \_\_\_\_\_

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Bearing Trees, Reference Objects

\_\_\_\_\_

Subsequent Corner Restoration

Year surveyed \_\_\_\_\_ By \_\_\_\_\_  
Location filed \_\_\_\_\_  
Monument \_\_\_\_\_

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_

Re monumentation certificate prepared \_\_\_\_\_ By \_\_\_\_\_  
Filed at \_\_\_\_\_ Date \_\_\_\_\_