

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 22, Township 141, Range 29, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 6/19/80 found a 2" GLO brass cap monument in place as set in 1918.
DATE
- left monument as found, lowered monument, removed monument (explain)
- On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

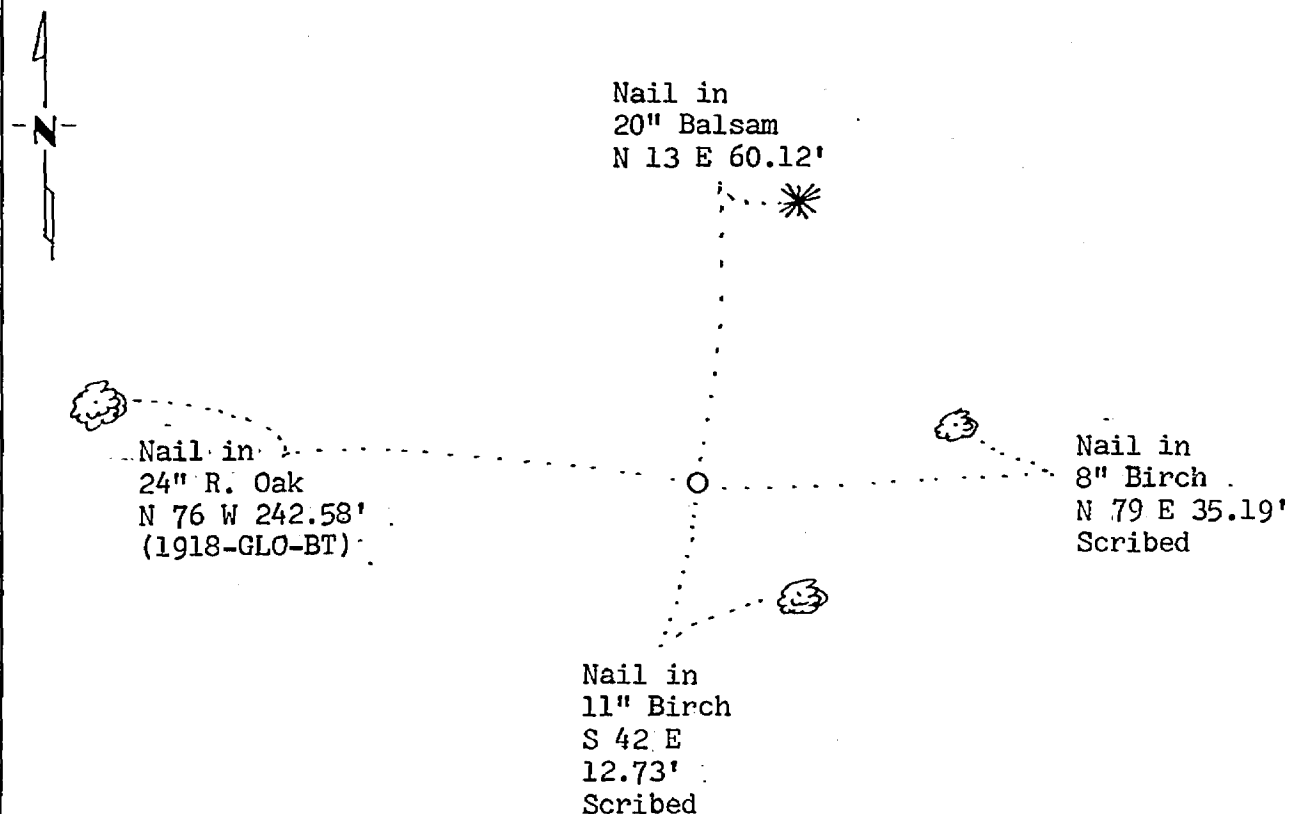

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

261 009

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stevenson 12-23-81
SIGNATURE DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:47 A.M. on the 31 day of Dec. A.D., 1981

County Recorder Burlah Herdinger

By MS, Deputy

DOCUMENT NO. 261 009

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 6" W. Pine S 60 E 20 links, 6" W. Pine N 20 E 28 links, 7" W. Pine N 40 E 9 links, and 8" Poplar S 35 W 21 links.
- 1918 U.S. General Land Office dependent resurvey found the corner marked by a wooden post 3" square and 18" above the ground with indications of scribe marks. A 12" pine stump with signs of scribe marks was found N 27-45 E at 28 links. A 12' pine stump marked BT was found N 40 W 9 links. A note is made that a mistake was evidently made in recording this bearing as N 40 E in the original notes. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 6" Balsam N 14-45 E 166 links and 10" Black Oak N 76-15 W 367 links.
- 1969 USFS technician L. Witthoeft found the brass cap monument in place and both 1918 GLO bearing trees.
- 1980 USFS technician William Olson found the brass cap monument in place and both 1918 GLO bearing trees. Two new bearing trees were marked and are shown on this certificate.
- 1981 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1981 On Dec. 8, I visited this corner and found the GLO brass cap monument in place. The brass cap had been hammered and bent somewhat. The pipe was in good shape and straight. It did not appear that it had been moved. The cap was facing west instead of the normal of facing north. The balsam that had been noted in the 1969 and 1980 USFS reports did not appear to be the 1918 bearing tree. This balsam was found to be N 13° E 60.12' to nail on side. The GLO distance given would be 109.56'. The Oak was found as noted, but no scar was evident. I reviewed this corner with USFS technician Bill Ausk. On Dec. 18, he revisited the corner and cut open the Oak and found the scribe marks plain from the 1918 survey. He rechecked the bearing and distance and found it to agree with the 1918 record. He also cut open the Balsam and found no scribing. He also searched the true area of the Balsam and found no evidence. No evidence was found of the original pine stumps as noted in 1918.

I accepted the monument as being in the same location as set in 1918 based on the 1918 Oak bearing tree.

