


T. 144 R. 30 M. 5th Coordinates: X _____ Y _____
E 1/4 10 Corner common to sections 10, 11

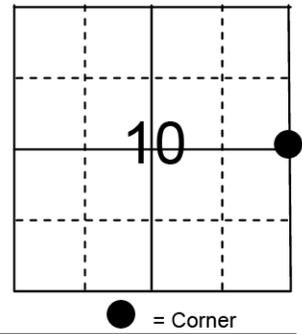

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search _____ by _____
Monument found _____

Bearing Trees

Species	<u>White Birch</u>	<u>Cedar</u>
Diameter	<u>10"</u>	<u>12"</u>
Bearing	<u>S 78° E</u>	<u>S 82° E</u>
Distance	<u>227 links</u>	<u>435 links</u>

Original Bearing Trees Found

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 5/1930 By H.D. Craig, US Surveyor
Location filed: Minn. Hist. Society, notes pg. 80
Monument: Set 1"x36" iron pipe with brass cap up 6", at proportionate distance and mark new witnesses as follows. 1/4 S10 |S11 1930

Evidence of Subsequent Corner Restoration

Year of search 10/1934 By D.J. Sutton, Compassman CCC
Location filed: Form 874-9
Monument: Found brass cap iron pipe up 9" in good condition, placed a metal location poster on the NW BT and notes witnesses as follow.

Bearing Trees, Reference Objects

Species	<u>Spruce</u>	<u>Birch</u>
Diameter	<u>6"</u>	<u>6"</u>
Bearing	<u>S 62° E</u>	<u>N 44 1/4° W</u>
Distance	<u>85 links</u>	<u>34 links</u>

Bearing Trees, Reference Objects

Species	<u>Birch</u>	<u>White Spruce</u>
Diameter	<u>6"(1930)</u>	<u>7 1/2"(1930)</u>
Bearing	<u>N 46°15' E</u>	<u>S 64° E</u>
Distance	<u>34 links</u>	<u>85 links</u>

Subsequent Corner Restoration

Year surveyed 4/1981 By G. Brama, USFS
Location filed: USFS Book 1, page 42
Monument: Found GLO 1" iron pipe with brass cap up 10", 200'+/-, S. of FR 2135K, lines E. and S. to FS standard and witnesses as follows.
Spruce Stump, S 62° E, 56.1'(1930) remains of scribe
13" Birch, N 45° E, 22.4'(1930) with scribe
7" Elm, N 39° E, 60.50' nail, scribed
9" Birch, S 63° W, 57.0' nail, scribed
8" White Oak, East, 77.66' nail, scribed

2/1984, G. Brama, USFS
USFS Book 1, page 42
Found GLO iron pipe with brass cap and added following.
Steel Sign Post, East, 2.75' with signs
Steel Sign Post, South, 2.85' with signs

12/2002, R. Main, USFS
USFS Book 1, page 42
Found GLO iron pipe with brass cap and added following.
Birch, N 45° E, 22.4'(1930) rotted windfall
Birch, S 63° W, 57.0'(1981) 10' snag
12" White Oak, East, 77.66' add new tags
Steel Sign Post, East, 2.75' with signs
Steel Sign Post, South, 2.85' with signs, bent by logging
6" Birch, North, 275' FSLP, at FR 2135K

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

