


T. 145 R. 30 M. 5th Coordinates: X _____ Y _____
E 1/4 10 Corner common to sections 10, 11

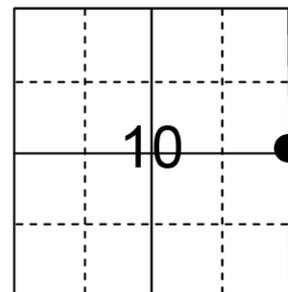

10

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874
Original monument Post

Original Evidence Found

Year of search 1933 by Bandy
Monument found _____
Notes page 56

Bearing Trees

Species Yellow Pine Yellow Pine
Diameter 14" 10"
Bearing N 88° E N 13° W
Distance 90 links 27 links

Original Bearing Trees Found

Species Norway Pine
Diameter 18"
Bearing N 13° W
Distance 27 links

Subsequent Corner Restoration

Year surveyed Cir 1930 By CCC
Location filed: USFS Form 874-9
Monument: No stake
22" norway tree faced on S scribed 1/4 S BT, this tree sets in small green jack pine.

Evidence of Subsequent Corner Restoration

Year of search 7/1933 By W.W. Bandy, Surveyor, GLO
Location filed: MN Historical Society, Notes page 56 1/4
Monument: Set 1"x 3' iron post with brass cap S 10 | S 11
from remains of original witness, up 9" and marked new witness tree as follows. 1933

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Bearing Trees, Reference Objects

Species Jack Pine
Diameter 8"
Bearing S 28° E
Distance 32 links

Subsequent Corner Restoration

Year surveyed 5/1966 By M. Hansey, USFS
Location filed: USFS Book 2, page 15
Monument: Found GLO iron with brass cap and witnesses as follow.
Norway Pine stump, N 13° W, 17.82'(GLO) scribe visible
Pine stump, S 28° E, 21.12'(1933) scribe visible
10" Norway Pine, S 28° W, 45.0' scribed
6" Norway Pine, S 30° E, 37.8' scribed

Circa 1980, C. Krause, USFS
USFS Book 2, page 15
Found GLO brass cap, up 16" in good condition, 600' N. of Norick Rd. and 60' W. of wood trail, blazed line N. of iron, both BT's are good and adds the following.
Steel Sign Post, West, 2.1' 54-4 sign

2/1992, G. Brama, USFS
USFS Book 2, page 15
Found GLO brass cap, up 16", new woods trail is now 300' E. of corner, area has been windrowed and planted, he witnesses
16" Norway Pine, S 28° E, 45.0'(1966)
6" Red Pine, S 65° E, 8.00' 60d spike
11" Red Pine, N 16° E, 12.35' 60d spike


Evidence of Subsequent Corner Restoration Found

Year of search 5/2003 By CCHD/SO
Location filed: 2001.002
Monument: Found 1" ODIP with brass cap up 1.2' in pine plantation and witnesses as follow.
14" Norway Pine, S 28° E, 45.0'(1966) old scars
8" Norway Pine, S 65° E, 8.00'(1992) 60d spike
14" Norway Pine, N 16° E, 12.35'(1992) 60d spike
8" Norway Pine, S 68° W, 22.68' duplex nail
Steel Sign Post, West, 2.2'

Index No. G 17

CASS COUNTY LAND CORNER RECORD

T. 145 R. 30 M. 5TH Coordinates: X _____ Y _____
E 1/4 10 Corner common to sections 10, 11

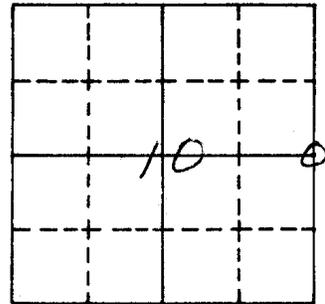

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874
Original monument post

Original Evidence Found

Year of search _____ By _____
Monument found _____

Bearing Trees
Species Y. pine Y. pine
Diameter 14" 10"
Bearing N 88 E N 13 W
Distance 90 LKS 27 LKS

Original Bearing Trees Found
Species _____
Diameter _____
Bearing _____
Distance _____

○ = Corner

Subsequent Corner Restoration

Year surveyed 1933 By GLO
Location filed Sec. of State
Monument Found NW BIT New 18" - set N 36 W 14"
W brass cap
14
510 1511
1933

Evidence of Subsequent Corner Restoration

Year of search 1966 By William Okerman
Found GLO monument in good condition

Bearing Trees, Reference Objects

Species J. Pine
Diameter 8"
Bearing S 28 E
Distance 32 LKS

Bearing Trees, Reference Objects

Red Pine Red Pine
10" 6"
S 28 E S 30 W
45.0' 37.8'

Subsequent Corner Restoration

Year surveyed 5/1/63 By CCSO
Location filed _____
Monument Found Brass cap on 1" pipe, cap 1/2" in
pine plantation. Some large Norway's
were left around the corner.
14" N. pine N 16° E 12.35' 60d spike
8" N. pine S 65° E 8.00' 60d spike
14" N. pine S 28° E 45.0' (old scars)
8" N. pine S 68° W 22.68' dbl hd rail
Steel sign post 2.2'

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CERTIFICATE - BILL OKERMAN - 1966

Remonumentation certificate prepared _____

By _____

Filed at _____

Date _____