


T. 145 R. 31 M. 5th Coordinates: X _____ Y _____

E 1/4 33 Corner common to sections 33, 34

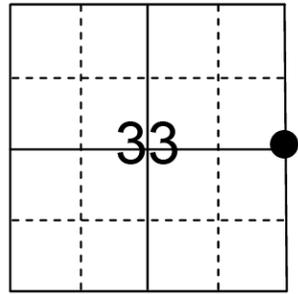

33

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875
Original monument Post

Original Evidence Found

Year of search 1913 by Curo
Monument found _____
Survey Rec #237, Bk A, pg 606

Bearing Trees

Species	<u>Red Oak</u>	<u>Ironwood</u>
Diameter	<u>8"</u>	<u>4"</u>
Bearing	<u>S 77 1/2° W</u>	<u>S 86° E</u>
Distance	<u>28 links</u>	<u>20 links</u>

Original Bearing Trees Found

Species	<u>Red Oak</u>	<u>Ironwood</u>
Diameter	<u>8"</u>	<u>Roots</u>
Bearing	<u>S 77°30' W</u>	<u>S 86° E</u>
Distance	<u>28 links</u>	<u>20 links</u>

Subsequent Corner Restoration

Year surveyed 7/1913 By J.W. Curo, LS 1428
Location filed: Survey Record #237, Book A, page 605
Monument: Set 2.5"x 48" iron pipe with cap
From GLO witness, SW standing green and plainly marked, by flat measurement from face of figures, than find roots of Ironwood at course and distance, new witnesses as follows.

Bearing Trees, Reference Objects

Species	<u>Elm</u>	<u>White Pine</u>
Diameter	<u>10"</u>	<u>30"</u>
Bearing	<u>S 43°49' W</u>	<u>N 86°14' E</u>
Distance	<u>63.73'</u>	<u>89.26'</u>

Evidence of Subsequent Corner Restoration

Year of search 6/1916 By J.F. Pomasel, LS 1728
Location filed: Curo Book 62, image 165
Monument:
Level notes, indicate corner at 79+18.0, notes chaining to 1/4 cor. not accurate.

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 12/1933 By J.A. Gjelhaug, Eng. CCC
Location filed: USFS Form 874-9
Monument: Found corner in road
notes witnesses as follows.
16" Red Oak, S 77 1/2° W, 28 links(18.48')GLO
4" Red Oak, N 29° W, 54 links(35.64')

5/1981, C. Krause, USFS
T145N R31W Field Book 1, page 15
Found 2.5"x 48" iron pipe with cap, down 6" in centerline of road, old fence, mostly down, E. from corner, 300'+/-, S. of pipeline and witnessed as follows.
W. Pine stump, N 86° E, 89.3'(1913) well rotted
11" Red Oak, S 65° E, 69.60' spike in side
10" Red Oak, N 31° E, 135.25' spike in side
10" White Oak, S 50° E, 112.05' spike in side

10/1996, D.L. Burntson, LS 13794
Certificate of Survey for Great Lakes Gas, #915 indicates found capped pipe at corner.

7/2000, CCHD/SO
#2000.024
Found and located 1.75" I.P. with plumber cap, 4'+/- W. of centerline of Co. Rd. #143.

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

