Index No. A 17

CASS COUNTY LAND CORNER RECORD

T. 135 R. 32 M. 5TH Coordinates: X _____ Y _____

NE 3 Corner common to sections 2,3 AND 34,35 - 136 - 32

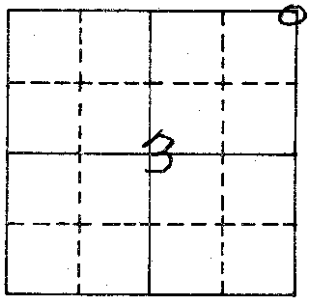

O = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1858

Original monument Post

Bearing Trees

Species	Y. PINE	Y. PINE	Y. ASH	Y. ASH
Diameter	8"	9"	7"	6"
Bearing	N22E	N53W	S37E	S59W
Distance	15 LKS	27 LKS.	22 LKS	14 LKS.

Original Evidence Found

Year of search _____ By _____

Monument found _____

Original Bearing Trees Found

Species				
Diameter				
Bearing				
Distance				

Subsequent Corner Restoration

Year surveyed 1915 By E.B. HORST

Location filed COUNTY BOOK C P. 47

Monument FND CORNER SET 1½x48" I.M.

COUNTY BOOK "C" P. 406 4x4 WOOD POST IN ROAD

1915 R. BRYANT, BOOK "C" P. 572 FND COR. AND 1 B.T.

ALSO ON MICROFILM - ROLL 115 BK 71 P. 88

Bearing Trees, Reference Objects

Species	N. PINE	N. PINE		
Diameter	3"	4"		
Bearing	SW	NW		
Distance	41.2'	52.0'		

Evidence of Subsequent Corner Restoration

Year of search _____ By _____

1915 - ALSO ON MICROFILM - ROLL 115 BK 71 P. 122 P. 128

1985 - 8/26 - TERRY FREEMAN FND 1½" I.P. AT INTERSECTION OF RDS. POSSIBLE 1915 NW B.T. TORN OUT BY ROOTS

Bearing Trees, Reference Objects

	P.P.	PP		
	NW	SW		
	50.7'	53.78'		

Subsequent Corner Restoration

Year surveyed _____ By _____

Location filed _____

Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

CERTIFICATE - WAIT CURE - 1985

DOC # 286242

FND I.P. AND POSSIBLE 1957 HIGHWAY DEPT B.T.

NE 91'

7" J. PINE N 68E 70.92'

4" W. OAK N 42E 89.87'

POWER POLE S 45W 53.87'

8" W. OAK N 45W 108.90'

2000 - CCSO -

FND. INPL. 1½" I.P. W/ SPK. IN CENTER, DOWN 0.1'. LOCATED @ CR 106 N/S & @ 72ND ST. E/W

REF. TIES:

R. PINE	16"	N 61°W	119.47'
P. POLE		N 74°E	107.25'
12" J. PINE		S 13°E	100.43'
P. POLE (TOP SPK. FND.)		S 45°W	53.92'

DEC. 1901; TWP RD ORDER SHOWS NO SURVEY

Remonumentation certificate prepared _____ By _____

Filed at _____ Date _____