Index No. Z 17

CASS COUNTY LAND CORNER RECORD

T. 137 R. 30 M. 5TH Coordinates: X _____ Y _____

SE 34 Corner common to sections 34, 35

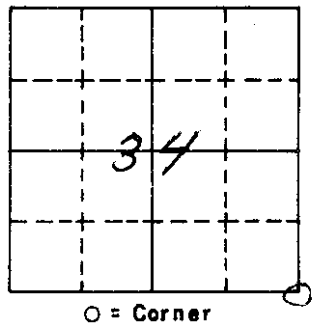

EXISTING SURVEYS

Original Government Survey

Year surveyed 1858

Original monument LOST

Bearing Trees

Species	DEAD TAM	DEAD PINE
Diameter	5"	5"
Bearing	N63E	N77W
Distance	34 LKS	31 LKS

Original Evidence Found

Year of search _____ By _____

Monument found _____

Original Bearing Trees Found

Species			
Diameter			
Bearing			
Distance			

Subsequent Corner Restoration

Year surveyed 1911 By A.W. MOULSTER

Location filed COUNTY SURVEY RECORD Book "B" P258-264

Monument SET 2x48" GALV. PIPE PROPORTIONALLY

1917, E.B. HORST, Book "B" P.565 FND 2½ x 48" S

I.M. SET BY MOULSTER

1911 - also on microfilm - roll 105 BK 49 P. 128, P133

Bearing Trees, Reference Objects

Species	J. PINE	J. PINE STUMP	J. PINE STUMP	NP PINE STUMP
Diameter	9"	9"	12"	20"
Bearing	S6-39E	EAST	N44W	N58-55E
Distance	6.85'	1.45'	39.9'	65'
	1911		1917	

Evidence of Subsequent Corner Restoration

Year of search 1977 By R.F. Schneider for Hwy Dept

Co Rd #28

2" I.P. in place

" also on microfilm - roll 105 BK62 P.94

" also on microfilm - roll 115 BK90 P.65

Bearing Trees, Reference Objects

Subsequent Corner Restoration

Year surveyed 5/01 By CCSO

Location filed

Monument Found alum cap monument 1.4' S. of ℄ Co Rd #28 and 32' E. of ℄ 32nd Ave.

11" Oak S 34° E 106.58' *

12" Birch S 24° W 103.43' *

Tel Fed post N53°W 167.18' *

18" CMP N2° W 40.34' to PK

* Distance to dbl hd nail

-Corner GPS 9/17/02 CCSO

Alum cap, 1' ± S. of #28, 30' ± E. 32nd

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Remonumentation certificate prepared _____ By _____

Filed at _____ Date _____