Index No. V 17

CASS COUNTY LAND CORNER RECORD

T. 139 R. 29 M. 5TH Coordinates: X _____ Y _____

NE 34 Corner common to sections 26,27,34,35

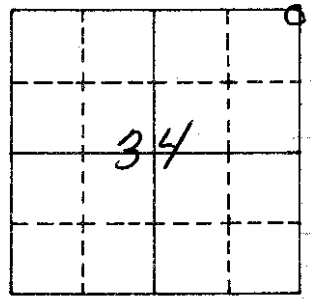

EXISTING SURVEYS

Original Government Survey

Year surveyed 1865

Original monument Post

Original Evidence Found

Year of search _____ By _____

Monument found _____

Bearing Trees

Species	TAM.	W. BIRCH	W. BIRCH	TAM.
Diameter	15"	10"	10"	10"
Bearing	N39E	N63W	S29W	S56E
Distance	23 LKS.	17 LKS	40 LKS	34 LKS

Original Bearing Trees Found

Species				
Diameter				
Bearing				
Distance				

Subsequent Corner Restoration

Year surveyed 1911 By JOHN CURO

Location filed COUNTY SURVEY RECORD BOOK A" P378-381

Monument FND NE & SE B.T.S SET 2X48" CAPPED GALV. I.P.

Evidance of Subsequent Corner Restoration

Year of search 1984 By Freeman - Oken

Survey Tech - Forster

Fnd 2" capped pipe - Put up tall post next to pipe

put land Dept tags up - no good B.T.S

Bearing Trees, Reference Objects

Species	SPRUCE	SPRUCE	TAM STUMP	
Diameter	6"	8"	12"	
Bearing	N20W	N65E	S14E	
Distance	21.25'	29.15'	10.90'	

Bearing Trees, Reference Objects

20' pine stub	J. pine			
16"	19"			
N68W	South			
48.0'	440'			
Tag	Tag			

(V-17)

Subsequent Corner Restoration

Year surveyed Dec 2002 By CCSO

Location filed

Monument Found 2" OD IP w/plumber cap, leaning at 45°, unable to straighten, Froze in, 22' ± south of creek.

20" pine stub N 68° W 48.0'

Mag nail, & snowmobile bridge, 475.42' S 68° E

Dec. 1917, Twp rd order shows no survey

July, 1921 - E.B. Horst, Roll 12, Bk 166, pg 47, Found IM set by Curo from BTs

April, 1937 - J. Curo, Roll 13, Bk 202, pg. 144-145, Found 2"x48" capped, Galvanized IM and Insts New BT's

WP 15" N67°40'W 62.25'

Spruce 14" N45°25'E 29.30'

W. Birch 8" S15°15'W 15.35'

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____

Remonumentation certificate prepared _____ By _____

Filed at _____ Date _____