

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Northeast Corner of Section 34, Township 142, Range 27, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 10/16/81 placed a cast iron monument at position determined by
DATE
1922 survey record.

SKETCH OF REFERENCE TIES

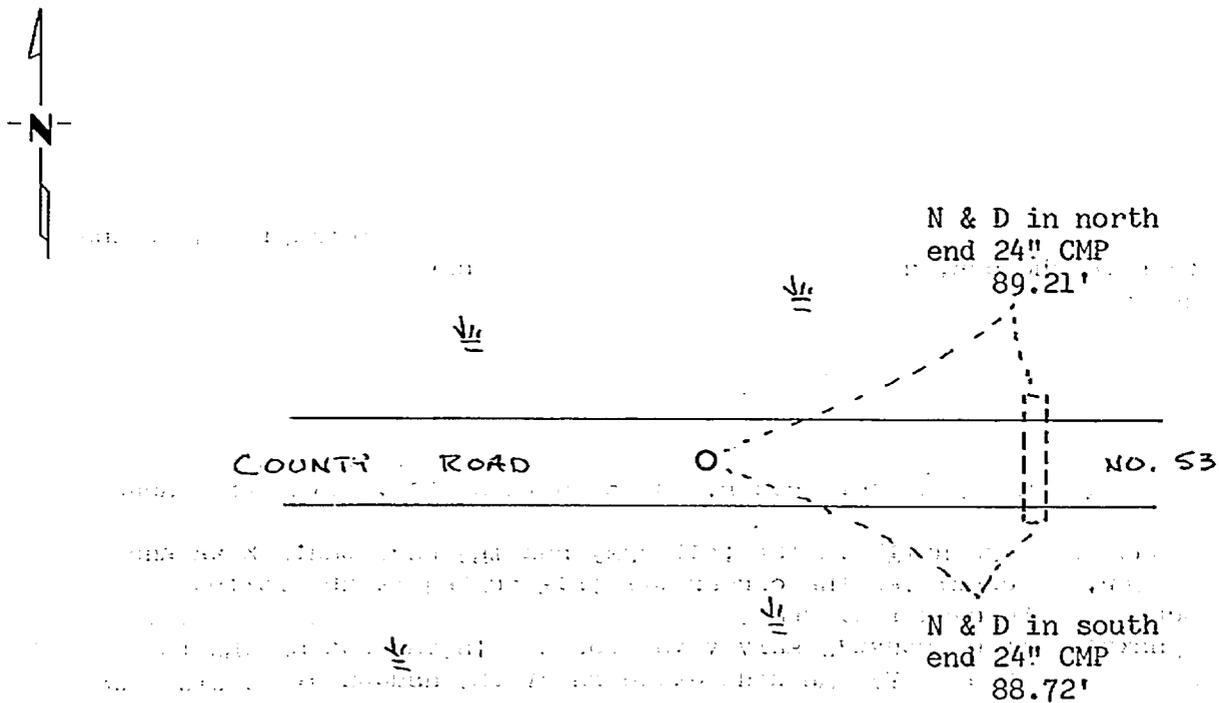

Statement of evidence relative to this corner location is on back of page. 260597

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Nancy H. Stevenson 12-2-81
SIGNATURE DATE

Registration No. 12684

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 11:05 A.M. on the 3 day of Dec. A.D., 1981

County Recorder Beverly Hendrichs

By MS, Deputy

DOCUMENT NO. 260597

Statement of Evidence:

- 1873 U.S. General Land Office established the position of this corner. The notes of this survey show post set in marsh with no bearing trees and that a witness corner was also set 6.97 chains west on the section line. The witness corner had the following bearing trees: 5" Tamarac North 42 links and 6" Cedar S 10° E 6 links.
- 1922 County Surveyor's Record Book D pages 108 & 109 show survey by E.B. Horst. The survey was for the location of a road on the section line. The survey shows a 6" x 6" x 6' cedar post marking the corner which he had set in 1915. He also states that he found both of the bearing trees for the witness corner 697 links west of the corner.
- 1980 U.S. Forest Service Office in Cass Lake was contacted for information and no resurvey information was found on this corner.
- 1981 Walter Curo, RLS, was contacted to see if he had any information on this corner or the notes from the 1915 or 1922 survey by Horst. He had no information concerning this corner.
- 1980 We measured west from the North $\frac{1}{4}$ corner of Sec. 35 along an east-west road the distance of 2650.0 feet as given by Horst in 1922. We found no type of iron monument in this area. We then continued measuring west the 697-links to the approximate area of the witness corner. We found no monument at this location. This distance fit the edge of the marsh area very well. The GLO Cedar BT would fall in the road and no evidence was found. In the area of the GLO Tamarac BT one small stump was found, but no positive identification as being a BT could be found. We then excavated a 12' x 15' x 3' hole in the center of the east-west road at a distance of 2650' from the North $\frac{1}{4}$ corner of Sec. 35. The road is filled through the marsh with water on both sides. At a depth of 3' we hit water soaked soil and it was impossible to dig further. No evidence of the wood post was found. We were still in the fill area and the post would have been much deeper. I concluded the corner was obliterated by the following evidence: 1) The center of the east-west road would control the north-south position since Horst's survey was for the laying out of the road on the section line. 2) The best evidence of the east-west position is the distance given by Horst from the North $\frac{1}{4}$ of Sec. 35. This position also agrees with the distance to the edge of the marsh as given to the witness corner. I set a county cast iron monument at this obliterated position.