

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTH QUARTER Corner of Section 35, Township 141, Range 30, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 6/17/83 placed a 2" x 36" galvanized iron pipe with a 3" marked
DATE brass cap at the lost position

SKETCH OF REFERENCE TIES

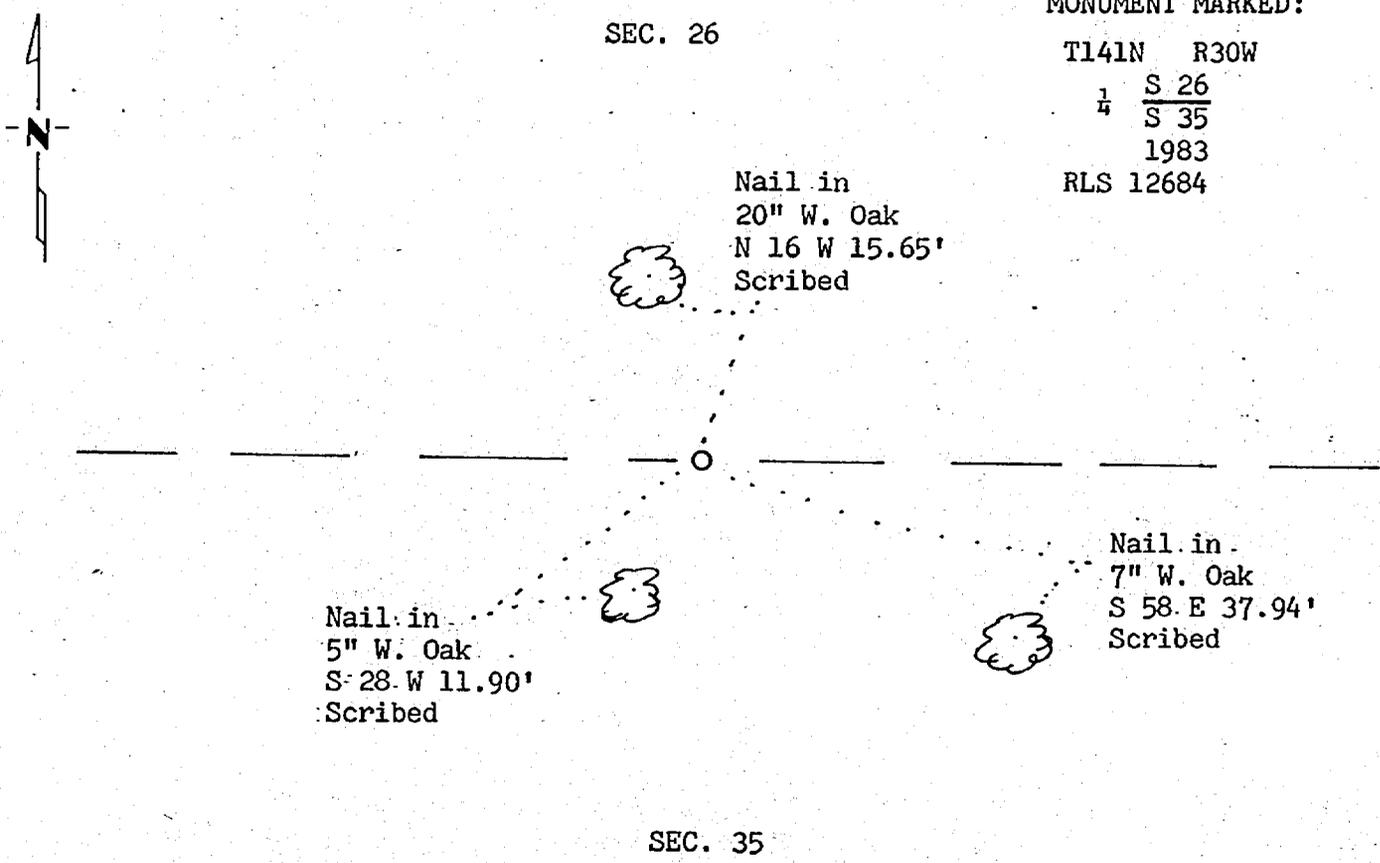

MONUMENT MARKED:
 T141N R30W
 1/4 S 26
 S 35
 1983
 RLS 12684

BEARINGS ARE APPROXIMATE MAGNETIC

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Gary H. Stevenson 6/20/83
 SIGNATURE DATE

Registration No. 12684

Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

279152
 OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 2:00 A.M. on the 3 day of Dec. A.D., 1984

County Recorder Claudia Kaylor
 By MS, Deputy

DOCUMENT NO. 279152

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 5" R. Oak S 31 W 27 links and 7" Spruce N 22½ E 46 links.
- 1982 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1982 U.S. Forest Service office in Cass Lake was contacted for information. Their records show technician J. Ekstrom had looked for the corner in 1964 and found no evidence of it.
- 1983 I ran a traverse between the NW and NE corners of Sec. 35. No evidence was found of a corner monument or the bearing trees. Distance measured between the section corners was 5343.29 feet. The corner was considered lost and reestablished by single proportion method. (Straight line and midway between the section corners.) A 2" x 36" galvanized iron pipe with a 3" marked brass cap was set for the corner. Corner falls 1.5 feet east of a 3" W. Oak. A steel sign post was set 3.2' east of the corner. Three new bearing trees were taken and are shown on this certificate.