

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 19, Township 141, Range 27, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 9/26/80 found a GLO brass cap monument as set in 1919 from  
DATE  
original bearing trees.
  - left monument as found,  lowered monument,  removed monument (explain)
- On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

### SKETCH OF REFERENCE TIES

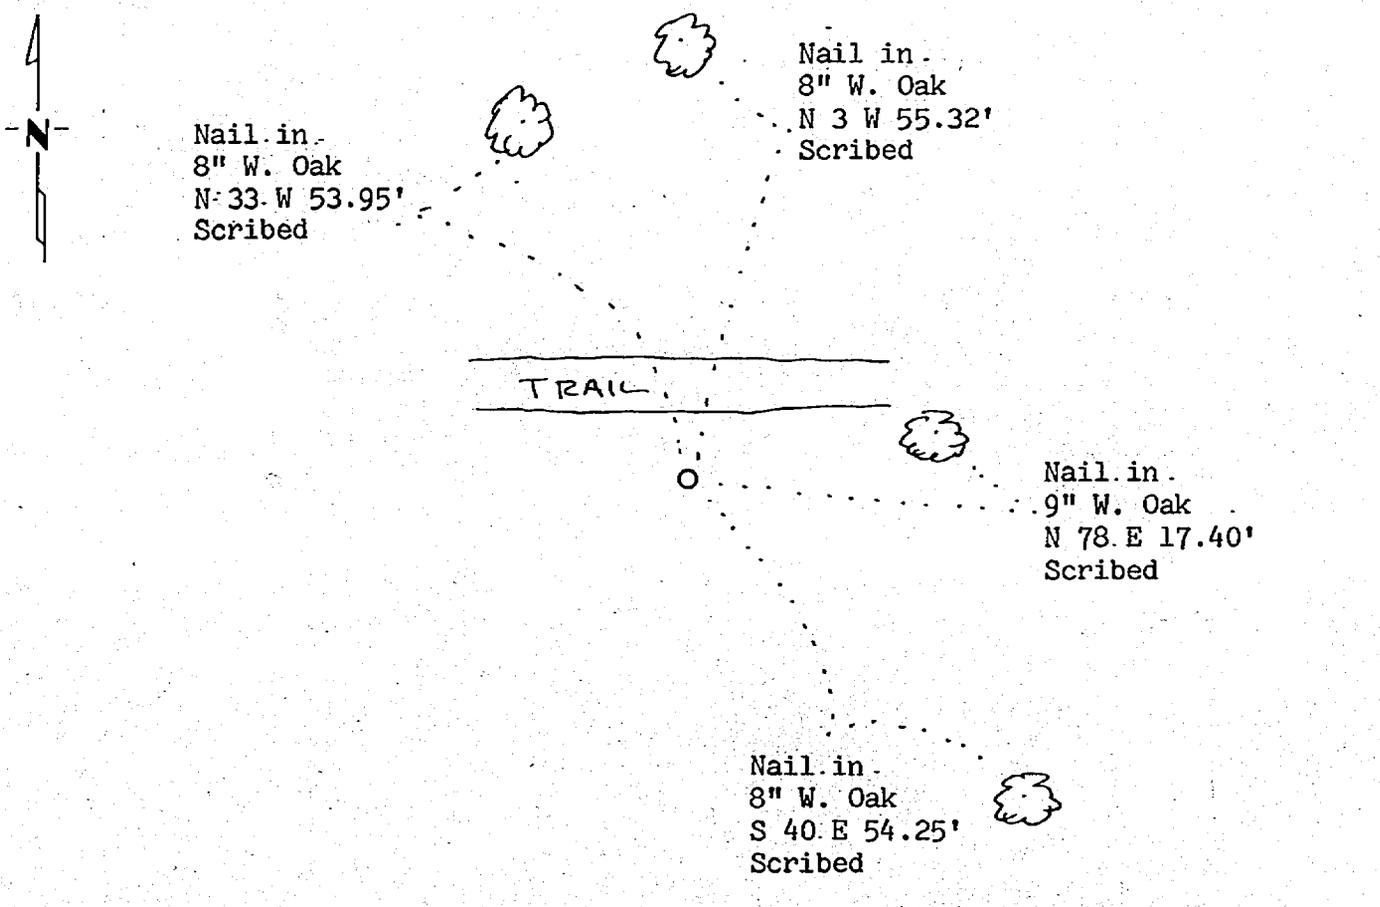

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Nancy H. Atkinson 9-14-82  
SIGNATURE DATE

Registration No. 12684

Land Surveyor,  Professional Engineer  
 County Surveyor,  County Engineer

279274  
 OFFICE OF THE COUNTY RECORDER  
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 3:56 P. M. on the 5 day of Dec. A.D., 19 84

County Recorder Claudia Kaylor  
 By MS, Deputy

DOCUMENT NO. 279274

Statement of Evidence:

- 1874 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 14" N. Pine N 10 W 65 links, 13" N. Pine N 23 W 75 links, and 4" Poplar S 25 E 11 links.
- 1913 County Surveyor's Record Book A pages 564 to 567 show survey by John Curo. Notes show government corner found.
- 1919 U.S. General Land Office dependent resurvey reestablished this corner from the stumps of the original bearing trees found: 16" Pine stump N 10 W 65 links with scribe marks and 12" Pine stump N 23 W 75 links with scribe marks. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 8" W. Oak S 52-30 E 299 links. Notes show corner in north-south road set flush.
- 1980 U.S. Forest Service technician C. Krause found the corner monumented with a GLO brass cap monument in good condition down 3" below ground and 20' south of east-west woods trail. The following bearing trees were found: Original 12" Pine stump, rotted & burned, N 23 W 49.5', Original 16" Pine stump, rotted & burned, N 10 W 42.9', and 1919 Oak stump, rotted, S 52 E 197.3'. Four new bearing trees were marked and are shown on this certificate. Old down wire fence runs east and west from corner. Piled rocks around monument flush with the ground.
- 1982 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1982 Analysis of the above data indicates that the location of this Government corner has been perpetuated. I accepted the monument as marking the corner location as when set in 1919 by the GLO resurvey based on bearing tree evidence.