

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Northeast Corner of Section 8, Township 141N, Range 26W, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On 11-4-86 found a 1" Iron Pipe 42" long.
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 12-23-86 placed a 2" U.S.F.S. Iron Pipe with Brass Cap,
DATE
stamped to identify corner.

*Magnetic: $4\frac{1}{2}^{\circ}$ E. decl. SKETCH OF REFERENCE TIES

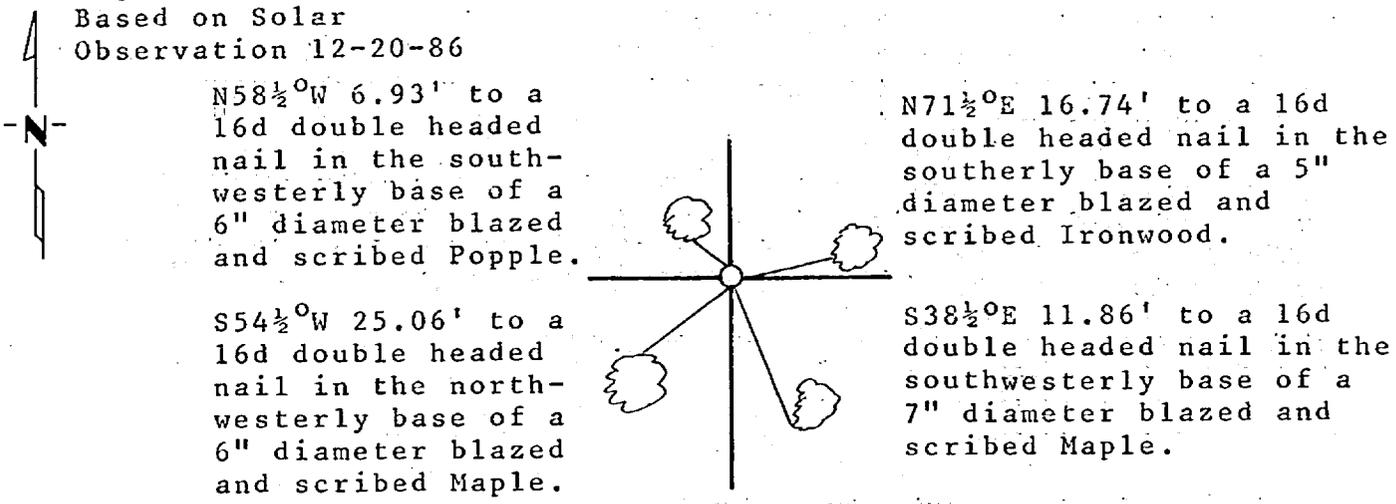

Monument is stamped

T141N R26W
 S5 | S4
 S8 | S9
 1986
 RLS 11946

Monument is located

on a slight northerly slope 390' north of the centerline of Minnesota Highway #200, 124' west of the centerline of a driveway, and 170' south of the South shore of Sand Lake. Signs 54-2, 54-9 and post, east 4.0'.

Statement of evidence relative to this corner location is on back of page. 295218

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

Roger A. Muelton

Date 2-23-87 Registration No. 11946

OFFICE OF THE COUNTY RECORDER
 County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 1:40 P.M. on the 23 day of February A.D., 19 87

County Recorder Cloudine Kayler
 By ms, Deputy

DOCUMENT NO. 295218

Statement of Evidence:

During April of 1871, Walker, Allen and Putnam, under contract with the U.S.G.L.O., surveyed and marked the East, North and West lines of Township 141 North, Range 26 West of the 5th P.M.

During May of 1871, Walker, Allen and Putnam, Contract Surveyors, surveyed and marked the interior lines of the Township.

A 1935 Minnesota Department of Transportation right of way map shows a iron pipe monument at the southwest corner of Section 4.

During the 1960's, according to local landowners, surveys were made in part of Section 4, for the purpose of laying out lots and marking boundary lines, by unknown surveyors.

During 1977, Roger A. Mustonen RLS #11946, employed by W.J. Spain, Jr & Associates, found a 1" iron pipe monument near the remnants of a fence corner, and accepts same as marking the southwest corner of Section 4. A 1" iron pipe monument was also found on line at mid-point between this accepted southwest corner and the south quarter corner of Section 4.

On November 4, 1986, Roger A. Mustonen, RLS #11946, under contract with the USDA Forest Service, found a 1" iron pipe monument, and accepts same as marking the southwest corner of Section 4, and on December 23, 1986 replaced it with a USDA Forest Service monument. (See other side for ties, etc.)

Original G.L.O. survey set a wood post, from which:

Birch 10" N2°E 39 lks
Aspen 11" N54°W 36 lks
Maple 7" S26°E 76 lks.

No evidence of G.L.O. bearing trees found.