

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 8, Township 140, Range 26, 5th P.M.

STATE OF MINNESOTA, County of CASS


At the corner location shown on the sketch:

On 10-25-83 found a pipe set by Anthony Kerick, RLS, from 1938 CCC notes.
DATE

left monument as found, lowered monument, removed monument (explain)

On 10-25-83 placed a county cast iron monument
DATE

SKETCH OF REFERENCE TIES

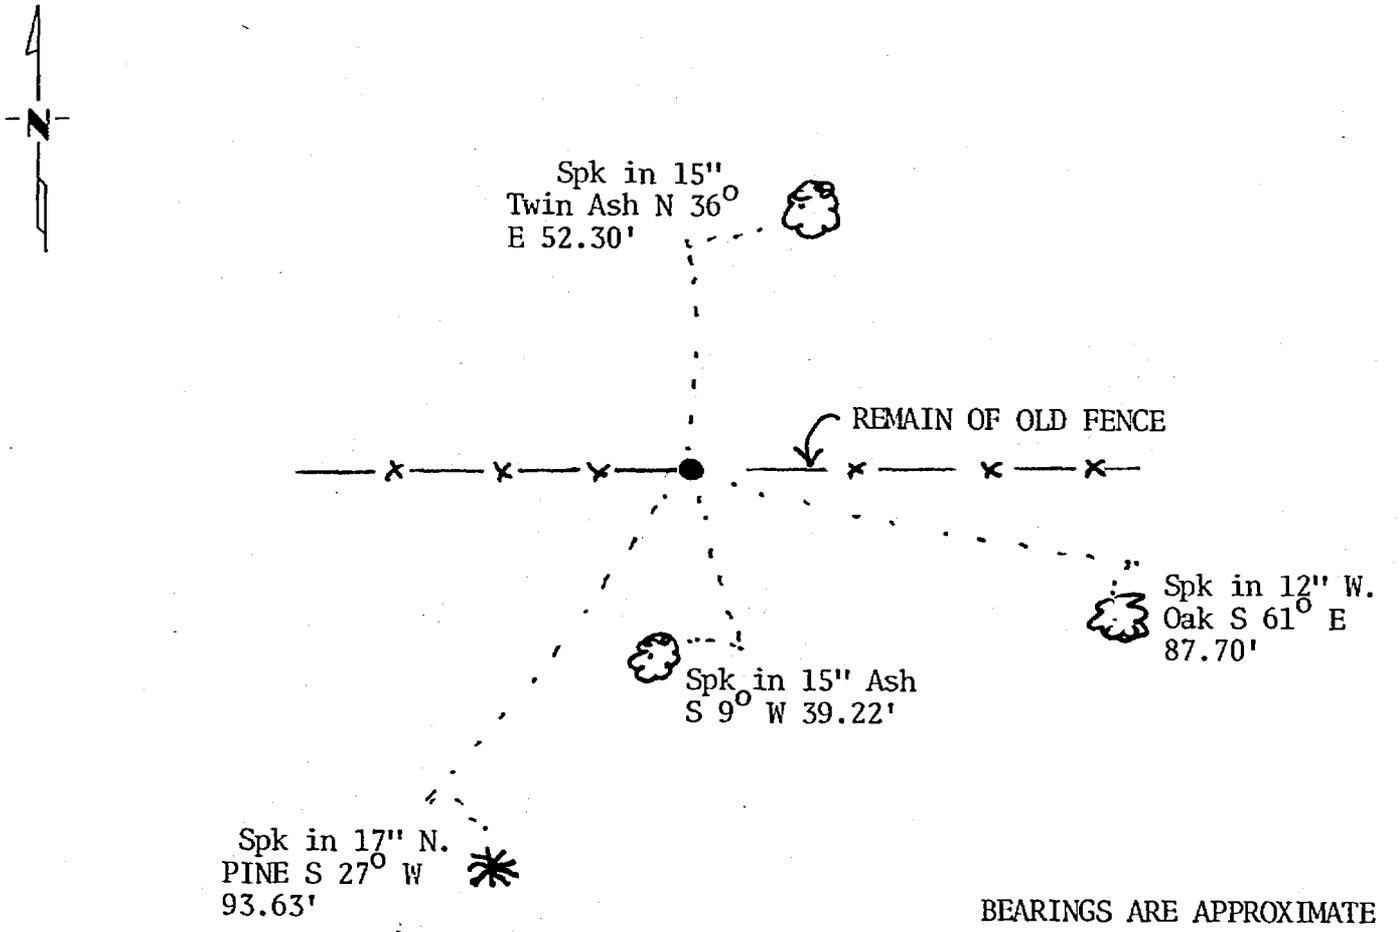

Statement of evidence relative to this corner location is on back of page. 295282

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Mary H. Stearn 2/7/87
SIGNATURE DATE

Registration No. 12684

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 3:10 P.M. on the 25 day of February A.D., 1987

County Recorder Clairine Koyler
By ms, Deputy

DOCUMENT NO. 295282

Statement of Evidence:

- 1871 - U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 4" Ash S 17° E 13 links and 5" Willow N 7° W 14 links.
- 1938 - Field notes by CCC from Washburn Lake Forestry Station show 3" Aspen stake found 3' high and scribed " $\frac{1}{4}$ S 5° " on the north side and " $\frac{1}{4}$ S 8° " on the south side. Notes show corner in willow swamp and on old east-west fence line. Distance of 2575 feet is given from this corner west to the NW corner of Sec. 8.
- 1979 - County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.
- 1961 - Plat of BAR X RANCH in Government Lot 1 of Section 8 was surveyed by Harold Curo, RLS # 3417. Plat was based on north line of Section 8, but does not show this quarter corner.
- 1980 - Anthony Kerick, RLS, set a pipe in old east-west fence by measuring the CCC distance east from the NW corner of Section 8.
- 1983 - Found iron pipe set by Kerick and check distance to NW corner of Section 8. Replaced the pipe with a Cast Iron Monument. Ties shown on this Certificate.