

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter _____ Corner of Section 28, Township 141 N, Range 29 W, 5th P.M.

STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch: Latitude: 47° 00' 08.166"
 Longitude: 94° 20' 58.922"


On _____ found a _____
DATE

left monument as found, lowered monument, removed monument (explain)

On 3/23/89 placed a 2 inch by 48 inch iron pipe with brass cap
DATE
and plastic base with magnet.

Magnetic Decl: 5° East SKETCH OF REFERENCE TIES
 Not to Scale

All distances are horizontal to nail in side of tree.

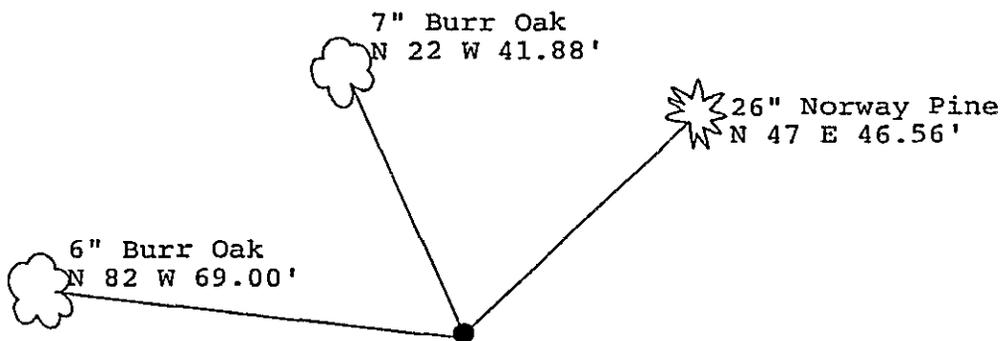

Monument is located
 ±125' East of clearcut
 and ±150' Northerly of
 trail Northeast-Southwest.
 8' steel sign post North 4.0'

Monument Stamped
 T 141 N R 29 W
 S28 | S27
 1989
 RLS 17008

All trees are painted with red enamel and marked with a 54-3 (bearing tree) tag.

Statement of evidence relative to this corner location is on back of page. 312150

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

David S. Landecker
 David S. Landecker
 Date 5-12-89 Registration No. 17008

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorder's office at 4:00 P. .M. on the 15 day of May A.D., 19 89

County Recorder Claudine Kayle

By m), Deputy

DOCUMENT NO. 312150

Statement of Evidence:

East Quarter Corner Section 28, Township 141
North, Range 29 West, Cass County, Minnesota

T-13 141-29
Bk.4 Pg.78

1873 P. H. Conger, U.S. Deputy Surveyor, originally established this corner position while subdividing Township 141 North, Range 29 West. The notes indicate a wood post was set to mark the corner position and the following witnesses: a 5 inch Birch North 60 degrees West a distance of 56 links; and a 10 inch White Pine East a distance of 80 links.

1918 U.S. General Land Office dependent resurvey did not find the original corner post and then reestablished this corner as lost proportionally. A wood post was set by them to mark this corner. No bearing trees were marked.

1988 on July 8 a Landecker-Stevenson & Associates crew searched for the corner. The following information was found and noted: searched area determined from 1918 General Land Office proportional position, no sign of any post at corner position. Pine stumps in area but none had blazes or scribing visible. This corner was determined lost.

1989 on March 23 a Landecker-Stevenson & Associates crew set a 2 inch by 48 inch iron pipe with brass cap and plastic base with magnet. This corner position was established at the lost, single proportionate position between the Northeast and Southeast corners of said Section 28. New bearing trees were marked as shown and a steel sign post is in place as noted on front of this certificate.