

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 5, Township 142N, Range 26W, 5th P.M.


STATE OF MINNESOTA, County of Cass

At the corner location shown on the sketch:

- On 8/27/90 found a 1 1/2 inch iron pipe laying on ground; this pipe is from 1916 Survey by F.F. Wilson.
 - left monument as found, lowered monument, removed monument (explain)
- On 9/4/90 placed a 2"X48" Brass Cap Monument, also placed pipe alongside in same hole.

Monument marked

SKETCH OF REFERENCE TIES
Not to scale

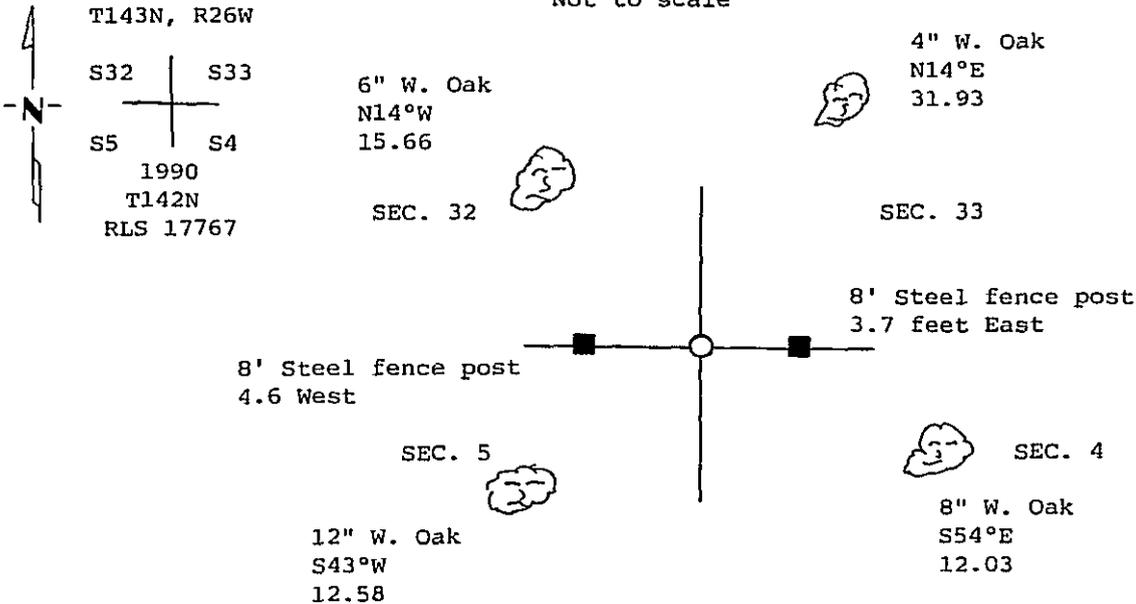

Bearings are true

All trees are scribed, painted, with a 30d spike in side, and a USFS 54-3 tag.

Statement of evidence relative to this corner location is on back of page. 325160

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Registered Land Surveyor under the laws of the State of Minnesota.

William C. Sawyer
Date 11/14/90 Registration No. 17767

OFFICE OF THE COUNTY RECORDER
County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 4:14 P.M. on the 21 day of November A.D., 19 90
County Recorder Cherline Kayler
By m), Deputy
DOCUMENT NO. 325160

Statement of Evidence:

A9 Southeast corner section 32

Cor. 4,5,32 and 33 (NE Cor. Sec. 32)

- 1872 U.S. General Land Office survey set wood post for corner and the following references were noted:
Birch 6" N 47 degrees E, 3 Links (1.98 feet)
Red Oak 14" N 21 degrees W, 22 Links (14.52 feet)
Birch 8" S 54 degrees E, 17 Links (11.22 feet)
Elm 6" S 68 degrees W, 18 Links (11.88 feet)
- 7-13-1916 Notes for County Ditch Number 5, on file in Cass County Survey Office state F.F. Wilson, a Field Engineer, set a 1.5" iron pipe in lost position between recovered quarter corner of Section 32 and Section 5, and recovered quarter corner of Section 33 and Section 4, he witnessed as follows:
Poplar 5" N 40 degrees 41 minutes E, 10.5 feet
Basswood 6" S 55 degrees W, 10.3 feet
Maple 10" S 14 degrees 10 minutes W, 65.3
- 8-27-1990 Personnel from Kovanen & Osufsen Inc. found 1.5" iron pipe laying on ground, also stump holes at 1916 BT positions.
- 9-4-1990 Personnel from Kovanen & Osufsen Inc. set a 2" x 48" brass capped monument on line and split between recovered quarter corner of Section 32 and Section 5, and recovered quarter corner of Section 33 and Section 4, and established the following witnesses:
W. Oak 4" N 14 degrees E, 31.93 feet
W. Oak 8" S 54 degrees E, 12.03 feet
W. Oak 12" S 43 degrees W, 12.58 feet
W. Oak 6" N 14 degrees W, 15.66 feet
Set 8' long steel sign post with sign attached, West 4.6 feet
Set 8' long steel sign post with sign attached, East 3.7 feet

This position is not traceable to the original GLO corner, but accepted as corner for lack of further evidence.