

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTH QUARTER Corner of Section 21 ,Township 135 N. ,Range 32 W. ,5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 3/3/00 found a 2" OD IRON PIPE(TOP MUSHED) DOWN 1' ON GRAVEL
DATE
RD CENTERLINE
- left monument as found, lowered monument, removed monument (explain)
- On _____ Placed on _____
DATE

SKETCH OF REFERENCE TIES

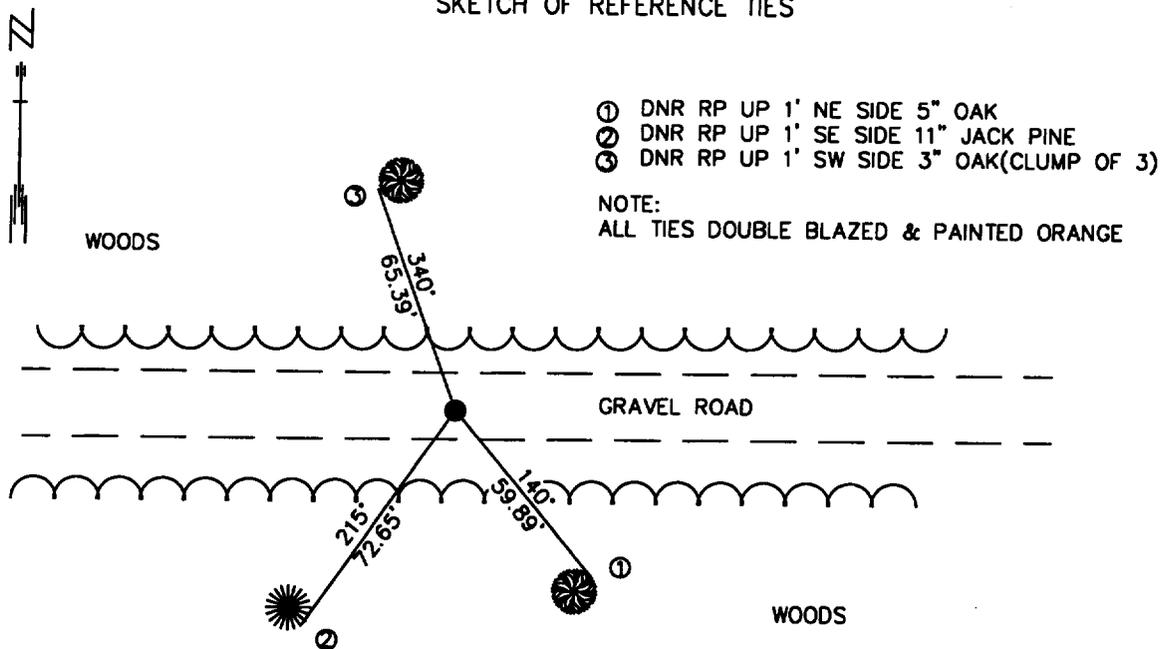

- ① DNR RP UP 1' NE SIDE 5" OAK
- ② DNR RP UP 1' SE SIDE 11" JACK PINE
- ③ DNR RP UP 1' SW SIDE 3" OAK(CLUMP OF 3)

NOTE:
ALL TIES DOUBLE BLAZED & PAINTED ORANGE

1983 CASS COUNTY SOUTH
COORDINATE SYSTEM
N= 225120.80
E= 434124.48

AZIMUTHS OBSERVED WITH A COMPASS

Statement of evidence relative to this corner location is on back of page.

JULY 2000
FOM 01868

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

John D. Walbr 4/5/01
SIGNATURE DATE

License Number 16098

- Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER 434529
 County of Cass

I hereby certify that this document was filed in the Co. Recorders Office at 2:40 P .M. on the 11th day of April A.D., 2001
 County Recorder Katherine M. Norby
 By K.F. ,Deputy
 DOCUMENT NO. 434529

North Quarter Corner Section 21, Township 135 North, Range 32 West

The Department of Natural Resources, Bureau of Engineering contacted the following offices for information regarding this corner:

MN Secretary of State
Cass County Surveyor
Widseth, Smith and Nolting of Brainerd
Landecker and Associates of Pequot Lakes
Landecker and Associates of Walker
Central Minnesota Surveying

1866 In October, the US General Land Office field notes, on file in the Secretary of State's Office, show this corner to be marked with a post and the following bearing trees were marked:

Black Pine 12" N17° E 130 links (85.8')
Black Pine 15" N 34° E 90 links (59.')

1920 Lincoln Mackey set an iron monument at 2612.9' from the Section corners east and west.

Jack Pine 10" N1°30' W 77.7'

1986 Comstock & Davis found 1 ½ " iron pipe, top broken

2000 In May, the DNR survey crew found a 2" outside diameter iron pipe (top mushed), down 12" in the centerline of the east - west road. The section corners east and west were proportioned in using the 1920 survey by E.B. Horst and Lincoln Mackey. Lost position between the section corners is 2.4' north and 1.8' west of the found iron pipe.

Northeast Corner Section 20 - S89°22'51"W 2615.76'
Northwest Corner Section 21 - N89°16'30"E 2612.09'

For more information on our survey in this area please contact MN DNR, Bureau of Engineering, Survey Section, 1601 Minnesota Drive, Brainerd, MN 56401