

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 20, Township 135 N., Range 32 W., 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On 5/03/00 found a 1 1/4" X 48" ID IRON PIPE WITH SCREW ON CAP  
DATE CENTERLINE OF EAST - WEST LOGGING ROAD
- left monument as found,  lowered monument,  removed monument (explain)
- On \_\_\_\_\_ Placed a \_\_\_\_\_  
DATE \_\_\_\_\_

SKETCH OF REFERENCE TIES

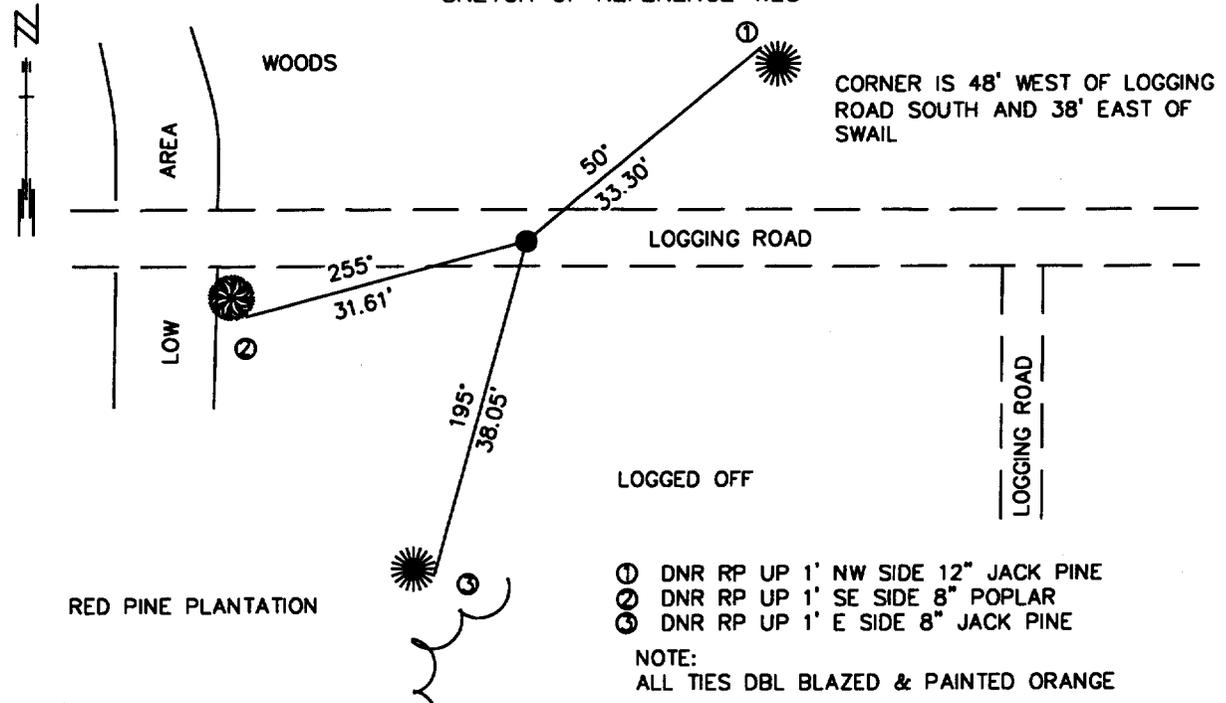

1983 CASS COUNTY SOUTH  
COORDINATE SYSTEM  
N= 222420.98  
E= 431571.12

AZIMUTHS OBSERVED WITH A COMPASS

Statement of evidence relative to this corner location is on back of page.

JULY 2000  
FOM01868

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[Signature] 4/5/01  
SIGNATURE DATE

- License Number 16098
- Land Surveyor,  Professional Engineer
  - County Surveyor,  County Engineer

OFFICE OF THE COUNTY RECORDER 434539  
County of Cass

I hereby certify that this document was filed in the Co. Recorders Office at 2:55 P .M. on the 11th day of April A.D., 2001  
County Recorder Kathryn M. Norby  
By [Signature] Deputy  
DOCUMENT NO. 434539

**East Quarter Corner Section 20, Township 135 North, Range 32 West**

The Department of Natural Resources, Bureau of Engineering contacted the following offices for information regarding this corner:

MN Secretary of State  
Cass County Surveyor  
Widseth, Smith and Nolting of Brainerd  
Landecker and Associates of Pequot Lakes  
Landecker and Associates of Walker  
Central Minnesota Surveying

1866 In October, the US General Land Office field notes, on file in the Secretary of State's Office, show this corner to be marked with a post and the following bearing trees were marked:

Black Pine 16" S 66° E 19 links (12.5')  
Black Pine 12" S 70° W 109 links (71.9')

2000 In May, the DNR survey crew searched and found 1 1/4" x 48" inside diameter iron pipe with screw on cap in the centerline of an east - west logging road. The top 18" was bent so the pipe was pulled, straightened and reset in the same hole. No other evidence was found. The following measurements were taken:

Northeast Corner Section 20 - N 01°20'05"W 2672.29'  
East Quarter Corner Section 29 - S 00°19'38"E 5300.46'

For more information on our survey in this area please contact MN DNR, Bureau of Engineering, Survey Section, 1601 Minnesota Drive, Brainerd, MN 56401