



A000668751

OFFICE OF THE COUNTY RECORDER  
CASS COUNTY, MINNESOTA  
CERTIFIED, FILED, AND/OR  
RECORDED ON

1/28/2021 10:33:32 AM

AS DOC #: A000668751

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY  
CASS COUNTY RECORDER

BY SF Dep TX#: 168663


### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Standard SE Corner of Section 33, Township 145 N., Range 31 W., 5th P.M.  
County of Cass, State of Minnesota

At the corner location shown on the sketch :

- On 06/25/2020 found 2-1/2" diameter iron pipe with cap in good condition,  
10" below gravel road surface.
- left monument as found     lowered monument     removed monument (explain)
- On \_\_\_\_\_ set \_\_\_\_\_

#### SKETCH OF REFERENCE TIES (NOT TO SCALE)

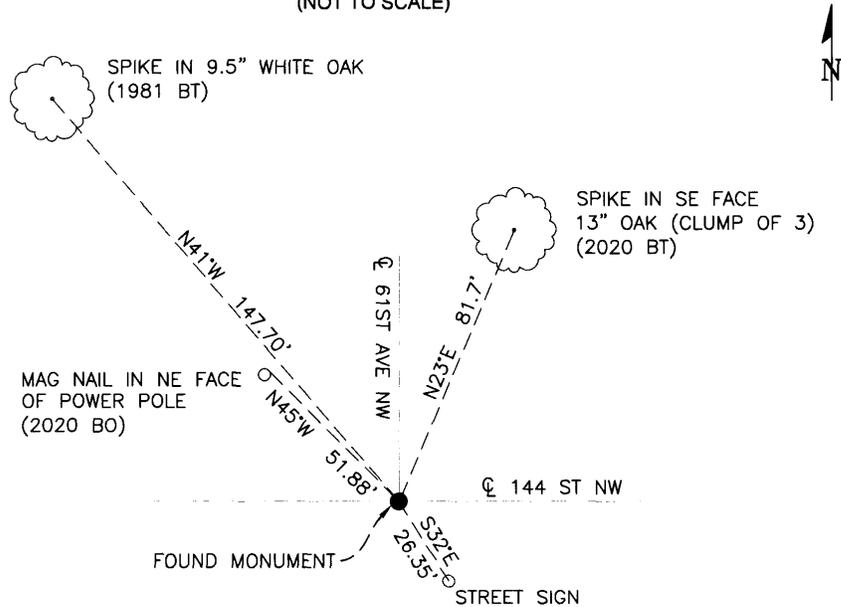

Note:  
Distances shown are horizontal  
Bearings shown are geodetic

Sheet 1 of 2

Statement of evidence relative to this corner location is on the back of this page

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the state of Minnesota.

Aaron J. Skattum  
Aaron J. Skattum  
MN License No. 54139

12-14-2020  
Date

Corner Index No. Z.0-13.0  
GCDB ID No. 400100

Cass County Coordinates  
North Zone, NAD83(2011)  
N: 289,744.520  
E: 402,910.076





Corner Index No. Z.0-13.0

**STATEMENT OF EVIDENCE****Standard Southeast Corner of Sec. 33, T.145N., R.31W., 5th P.M., Cass County, MN**

- 1871 G.R. Stuntz, US General Land Office, originally established this corner while surveying the south line of this township, and set wood post to mark the corner position with the following witnesses:

Burr oak	10"	N01'E	125 links (82.50')
Yellow pine	16"	N58'E	50 links (33.00')

Information on file at the MN Historical Society, St. Paul, MN. Copies filed with the Cass County Highway Department/Surveyor's Office (CCHD/SO).

- 1913 J. Curo, Cass County Surveyor, in Survey Record #237 (Book "A", Page 611, CCHD/SO Records) established this corner position by proportionate measurement between quarter corners east and west, and set a 2-1/2" iron pipe, 48" long with cap, noting the following witnesses:

Burr oak	10"	N01'E	82.50'	1871 BT, not found
Yellow pine	16"	N58'E	33.00'	1871 BT, not found

No new BT's were noted

Information on file at CCHD/SO

- 1930 H.D. Craig, US General Land Office, found Curo's monument and accepted it as the section corner. Curo's bearing trees were noted as destroyed by road construction, and one new bearing tree was marked:

Norway pine	25"	N69'45'W	83 links (54.78')
-------------	-----	----------	-------------------

Information on file at CCHD/SO

- 1933 (Date approximate) J.A. Gjelhaug, US Forest Service (Form 874-9, USFS Records) found a monument of unspecified type at "intersect of roads", which he noted to be a genuine GLO corner and noted the following bearing tree:

Norway pine	16"	N69'W	82 links (54.12')	assumed to be 1930 GLO BT
-------------	-----	-------	-------------------	---------------------------

USFS records cited herein are on file at the Chippewa National Forest Supervisor's Office.

- 1981 C. Krause & G. Brama, US Forest Service, (Corner Book 1, page 16, USFS Records) found the Curo monument bent and damaged in road. They repaired and straightened the monument and reset 12" below road surface and noted the following witnesses:

White oak	8"	N59'W	123.60'	New BT
White oak	7"	N41'W	147.70'	New BT
White oak	6"	N21'W	161.07'	New BT
FSLP on power pole		N45'W	51.46'	

USFS records cited herein are on file at the Chippewa National Forest Supervisor's Office.

- 2001 Cass County engineering technician (per CCHD/SO) found a 2" iron pipe with plumber's cap, down 0.7' and noted the following ties:

White oak	8"	N24'E	82.11'
White pine	12"	S32'E	35.12'
Guy pole		S54'W	47.58'
Red oak	14"	N46'W	103.38'

- 2020 A. Skattum US Forest Service, (Corner Book 1, page 16, USFS Records) found the iron pipe with cap in good condition, 10" below gravel road surface, and noted the following witnesses:

White oak	14"	N59'W	123.60'	1981 BT, now flat top stump
White oak	9.5"	N41'W	147.70'	1981 BT, found live, good condition
White oak	6"	N21'W	161.07'	1981 BT, in power line clearing, not found
FSLP on power pole		N45'W	51.46'	1981 bearing object, pole replaced
Magnail in power pole		N45'W	51.88'	New BO set in NE face of pole
White oak	13"	N23'E	81.70'	New BT, clump of 3 trees
Street sign		S32'E	26.35'	