


T. 133 R. 29 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 18 Corner common to sections 7, 18

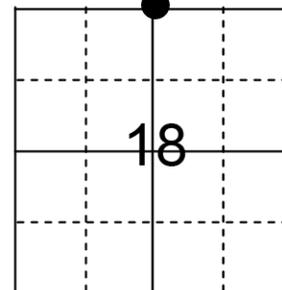

EXISTING SURVEYS

Original Government Survey

Year surveyed 1870  
Original monument Post

Original Evidence Found

Year of search 1912 by Curo  
Monument found \_\_\_\_\_  
Srv Rec #186, Bk A, pgs 438,442

Bearing Trees

Species Red Oak Black Pine  
Diameter 3" 6"  
Bearing N 74 1/2° W N 75° W  
Distance 60 links 157 links

Original Bearing Trees Found

Species Black Pine Oak  
Diameter Stump Root  
Bearing N 75° W N 75° W  
Distance 157 links 60 links

Subsequent Corner Restoration

Year surveyed 4/1912 By J.W. Curo, LS 1428, Co. Surv.  
Location filed: Survey Record #186, Book A, pages 438 and 442  
Monument: Set 4"x 36" iron pipe in a bed of cement from remains of Original witnesses and witnessed as follows. Certificate of Survey, #5877.

Evidence of Subsequent Corner Restoration

Year of search Circ 1950 By MnDOT  
Location filed: MnDOT, Map file 32-75\_008  
Monument: Iron pipe, in place at fence corner, 1443.7', N. of centerline, at P.O.T. 725+72.6.

Bearing Trees, Reference Objects

Species Pine Oak iron pipe  
Diameter stump(GLO) 5" 1 1/2"  
Bearing N 75° W N 51°30' E N 15° E  
Distance 103.62' 30.02' 5.85'

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 10/1972 By D.M. Anderson, LS 3091  
Location filed: Plat of SCEARCYVILLE, Doc. #207542  
Monument: Indicates a monument in place  
  
12/1974, D.M. Anderson, LS 3091  
Plat of FIRST ADDITION TO SCEARCYVILLE, Doc. #220950  
Indicates iron monument in place at corner.  
  
9/2000, B. Grivna, LS 17253  
Certificate of Survey for Ellstrom, #2000  
Indicates a position for the corner.  
  
6/2004, B. Grivna, LS 17253  
Certificate of Survey for Hollister, #565  
Found 4" iron pipe in place at corner and witnessed.  
12" Twin Oak, N 80° W, 19.98' spike, in S. side  
14" Oak, N 90° E, 22.28' spike, in S. side  
8" Oak, S 30° E, 17.09' spike, in W. side  
10" Twin Oak, S 25° W, 26.65' spike, in E. side  
  
1/2005, B. Grivna, LS 17253  
Plat of NELSON LAKE ADDITION, Doc. #A000494248  
Indicates iron monument found in place at corner.

Evidence of Subsequent Corner Restoration Found

Year of search 1/2008 By J.M. Leas, LS 42619  
Location filed: Certificate of Survey for Ellstrom, #3847  
Monument: Indicates iron monument found at corner.  
  
11/2016, M.T. Downing, LS 4616  
Certificate of Survey for Hollister, #8887  
Found survey monument  
  
8/2017, J. Kramer, LS 23668  
Certificate of Survey for Kientzle, #8123  
Indicates iron monument found at corner.  
  
11/2019, CCHD/SO  
#2019.021  
Found 3.5" iron pipe, up 0.5', in mound of dirt and witnesses.  
1.75" iron pipe, N 12° E, 5.85'(1912) up 0.1'  
10" Red Oak, S 35° E, 17.09'(2004) 60d spike, up 1.0', W. side  
8" Burr Oak, N 28° W, 10.86' duplex nail, up 1.0', W. side  
12" Red Oak, S 21° W, 27.40' duplex nail, up 1.0', E. side  
  
11/7/2019, T.L. Freeman, LS 21367  
Certificate of Location of Government Corner, #A000655116  
Filed on the above information.

