


T. 145 R. 30 M. 5th Coordinates: X _____ Y _____

N 1/4 33 Corner common to sections 28, 33

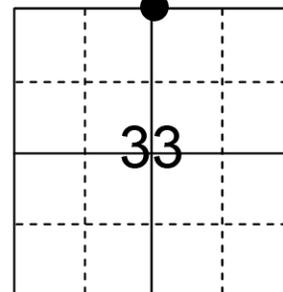

EXISTING SURVEYS

Original Government Survey

Year surveyed 1874
Original monument Post

Original Evidence Found

Year of search _____ by _____
Monument found _____

Bearing Trees

Species	<u>Birch</u>	<u>Maple</u>	_____
Diameter	<u>10"</u>	<u>4"</u>	_____
Bearing	<u>N 15° W</u>	<u>S 78° W</u>	_____
Distance	<u>96 links</u>	<u>26 links</u>	_____

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed Circ 1930 By CCC
Location filed: USFS Form 874-9
Monument: Stake burned off
No marks

Evidence of Subsequent Corner Restoration

Year of search 7/1933 By W.W. Bandy, Surveyor, GLO
Location filed: MN Historical Society, Notes page 69
Monument: Set 5" concrete cylinder with brass cap S 28
at proportionate distance, no remaining evidence 1/4 _____
of original post or bearing trees, up 4" and S 33
witnessed as follows. 1933

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

Species	<u>White Pine</u>	<u>White Pine</u>	_____
Diameter	<u>15"</u>	<u>15"</u>	_____
Bearing	<u>N 2 1/2° E</u>	<u>S 8 1/4° E</u>	_____
Distance	<u>78 links</u>	<u>55 links</u>	_____

Subsequent Corner Restoration

Year surveyed 5/1966 By J. Ekstrom, USFS
Location filed: USFS Book 2, page 21
Monument: Found GLO concrete with brass cap
and witnessed as follows.
21" White Pine, N 3° E, 51.48'(1933) rescribe
25" White Pine, S 8° E, 36.3'(1933) rescribe

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
Location filed: _____
Monument: _____

