

T. 136 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 13 Corner common to sections 12, 13



EXISTING SURVEYS

Original Government Survey

Year surveyed 1870  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ by \_\_\_\_\_  
Monument found \_\_\_\_\_

Bearing Trees

Species Elm Spruce  
Diameter 10" 8"  
Bearing S 20° E N 10° W  
Distance 10 links 35 links

Original Bearing Trees Found

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Subsequent Corner Restoration

Year surveyed 3/1917 By E.B. Horst, LS 376, Dept Surv  
Location filed: Survey Record #338, Book B, page 498 and Curo  
Monument: Set 2 x 48" I.M.  
Curo Book 62, image 204, states Sighting W. on sec line  
between secs 12-13- 136-30, I set 5" spikes at pts for 1/4 &  
1/16 cors. Image 228 states set I.M. corner.

Evidence of Subsequent Corner Restoration

Year of search 10/1929 By A.W. Prudlo  
Location filed: C.A.R. #14, Ditch Shelf 3, Book 164, page 4  
Monument: Iron pipe  
Indicates 1/4 Cor. At Station 79+19.7

Bearing Trees, Reference Objects

Species \_\_\_\_\_  
Diameter \_\_\_\_\_  
Bearing \_\_\_\_\_  
Distance \_\_\_\_\_

Bearing Trees, Reference Objects

Species Birch Birch  
Diameter 6" 6"  
Bearing South SE  
Distance 48.9' 69.1'

Subsequent Corner Restoration

Year surveyed 3/1951 By D. Cole, Cass County Eng.  
Location filed: Project S.P. 11-509-01  
Monument:  
Indicates corner assumed at station 79+20 at intersection of  
centerline and fence lines N. and S.

Evidence of Subsequent Corner Restoration Found


Year of search \_\_\_\_\_ By \_\_\_\_\_  
Location filed: \_\_\_\_\_  
Monument: \_\_\_\_\_

5/2012, CCHD/SO  
#2012.010  
No evidence of corner on centerline CSAH #17 at 1917  
distance or 1929 stationing.  
9/2019, CCHD/SO  
#2014.003  
Dug 5'x 5' hole, 2' deep to natural ground, area based on the  
1917 subdivision. The dig was 2' deep to a 2" ODIP with a  
pinched top, tipped NE, stood vertical, and witnessed.  
4/2020, CCHD/SO  
#2018.019  
After reconstruction of CSAH #17, set a 1"x 32" alum. Co.  
mon. over the recovered iron pipe, down 0.05', 4.4', N. of new  
centerline of CSAH #17.

Index No. J 23

CASS COUNTY LAND CORNER RECORD

T. 136 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 13 Corner common to sections 12, 13

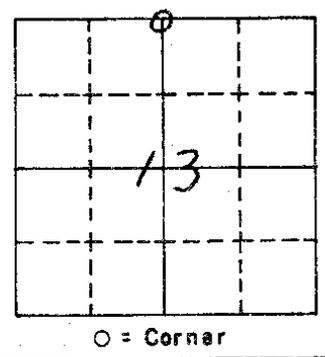

EXISTING SURVEYS

Original Government Survey  
 Year surveyed 1870  
 Original monument Post

Original Evidence Found  
 Year of search \_\_\_\_\_ By \_\_\_\_\_  
 Monument found \_\_\_\_\_

Bearing Trees  
 Species ELM SPRUCE  
 Diameter 10" 8"  
 Bearing S 80 E N 10 W  
 Distance 10 LKS. 35 LKS.

Original Bearing Trees Found  
 Species \_\_\_\_\_  
 Diameter \_\_\_\_\_  
 Bearing \_\_\_\_\_  
 Distance \_\_\_\_\_

Subsequent Corner Restoration  
 Year surveyed 1917 By E. B. HORST  
 Location filed COUNTY BOOK B' P. 498-502  
 Monument SET 5' SPIKE PROPORTIONALLY SET BY YB'  
J. M.  
also on microfilm - roll 105 BK 62 P. 52, 78

Evidence of Subsequent Corner Restoration  
 Year of search \_\_\_\_\_ By \_\_\_\_\_

Bearing Trees, Reference Objects  
 Species \_\_\_\_\_  
 Diameter \_\_\_\_\_  
 Bearing \_\_\_\_\_  
 Distance \_\_\_\_\_

Bearing Trees, Reference Objects  
 \_\_\_\_\_  
 \_\_\_\_\_  
 \_\_\_\_\_  
 \_\_\_\_\_

Subsequent Corner Restoration  
 Year surveyed \_\_\_\_\_ By \_\_\_\_\_  
 Location filed \_\_\_\_\_  
 Monument \_\_\_\_\_  
June 1912 - Twp Road order shows no survey

Evidence of Subsequent Corner Restoration Found  
 Year of search \_\_\_\_\_ By \_\_\_\_\_

Remonumentation certificate prepared \_\_\_\_\_ By \_\_\_\_\_  
 Filed at \_\_\_\_\_ Date \_\_\_\_\_