


T. 141 R. 26 M. 5th Coordinates: X _____ Y _____
E 1/4 2 Corner common to sections 1, 2

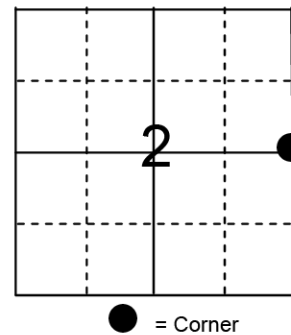

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871
Original monument Post

Original Evidence Found

Year of search _____ by _____
Monument found _____

Bearing Trees

Species	<u>Aspen</u>	<u>Aspen</u>
Diameter	<u>6"</u>	<u>7"</u>
Bearing	<u>S 80° E</u>	<u>S 4° W</u>
Distance	<u>145 links</u>	<u>600 links</u>

Original Bearing Trees Found

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed Circ 1910 By Soo Line Railroad
Location filed: Railroad map
Monument: Corner position provides land ties S. and W. to the subject corner from specified points stationed on the railroad centerline.

Evidence of Subsequent Corner Restoration

Year of search 8/1910 By O. Gobler, Surveyor
Location filed: Plat of Remer, # 26120
Monument: Plat graphics indicate ties N. and E. to the Soo Line Railroad.

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Subsequent Corner Restoration

Year surveyed 10/1912 By G. Darby, Surveyor
Location filed: Plat of Blocks 5, 6 and 7 Remer
Monument: Plat graphics indicate ties N. and E. to the Soo Line Railroad.

Evidence of Subsequent Corner Restoration Found

Year of search Circ 1934 By MN/DOT
Location filed: T.H. #6 R/W map 30-9, web site Doc. #1946364
Monument: Labels the corner, does not reference it to highway stationing.

11/1913, J.M. Greene, Surveyor
Plat of WESTERN ADD. TO REMER, #35766
Plat graphics indicate ties N. and E. to the Soo Line Railroad.

1980, MN/DOT
Survey crew working in Section 2, notes indicates a monument found at corner. Distances between corners indicate that the corner found may be similar to cor. used for plat of MYERS.

8/1916, F.F. Wilson, Asst, Eng.
Curo Book 191, pages 3, 6, 7, 16, 75 and 80 County Ditch #8
Check location of I.M. 1/4 cor. from Soo Ry. land ties, then run S. from NW cor sec 1, 2704.1' I.M. 1/4 cor.

1984, G. Stevenson, LS 12684
Worksheet of his subdivision of Section 1
Indicates 1-3/4" iron pipe at corner and distances N'ly to both the centerline of railroad and NW corner of Section 1.

7/1920, R. Krueger
Ditch shelf 4, Book 107, page 3, Walker-Remer road used Main St to sec line as corner, Found cor about Sta. 1741.

6/1990, W.E. Curo, LS 11395
Plat of SOO ADDITION TO REMER, #322070
Indicate a relationship to W. line of the NW 1/4, Section 1.

8/1920, Surveyor Unknown
AUDITOR'S PLAT of REMER OUTLOTS, #63101
Plat graphics indicate distance from corner to C 1/4 and a distance to centerline of the Soo Line Railroad.

6/1997, R.A. Mustonen, LS 11946
Certificate of Survey in Section 2, #5536
Indicates the subject corner as set.

9/1932, MN/DOT
T.H. #200 R/W map 5-1, web site Doc. #1947446
labels corner 50' S. of P.I. Sta. 1192+24.8.


2/1999, T.L. Freeman, LS 21367
Certificate of Survey in Section 2, #153
Indicates a bearing on the E-W 1/4 line of S. 2.

Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed <u>5/1999</u> By <u>T.L. Freeman, LS 21367</u>	Year of search <u>4/2018</u> By <u>CCHD/SO</u>
Location filed: <u>Certificate of Survey in Section 2, #150</u>	Location filed: <u>#2017.030</u>
Monument:	Monument: <u>Found 7/8" ODIP</u>
Indicates a bearing on E-W 1/4 line of section 2. 7/1999, J.J. Bunkowske, LS 24606 Certificate of Survey in SW ¼ of the NW ¼ Section 1, #182 Indicates a position for the subject corner.	down 0.5', 59'+/-, E. of centerline Hwy #6 and 34'+/-, S. of centerline Hwy #200 and witnessed as follows. Power Pole, S 44° E, 52.55'(2009) 40d spike, up 4.x', X. side 12" Spruce, S 5° E, 66.20' duplex nail, up 1.0', X. side 36" Concrete Culvert, N 22° E, 75.68' Mag nail, top, N. end
5/2000, M. Stefan, LS 12261 Certificate of Survey in NW ¼ of the SW ¼ of Section 1, #873 Indicates a bearing for section line S. of the subject corner.	
4/2001, J.J. Bunkowske, LS 24606 Certificate of Survey in SW ¼ of the NE ¼ Section 1, #1151 Indicates a computed position and found monument for C 1/4 S. 1. This corner would be necessary to make a comparison.	
1/2005, T.L. Freeman, LS 21367 Certificate of Survey in SW ¼ of the NW ¼, Section 2, #2595 Indicates a bearing on E-W 1/4 line S. 2 dependent on corner.	
3/2005, T.L. Freeman, LS 21367 Certificate of Survey in NW ¼ of SW ¼ of Section 2, #2690 Indicates a bearing on the E-W 1/4, S. 2 dependent on corner.	
7/2005, T.L. Freeman, LS 21367 Certificate of Survey in SW ¼ of NW ¼ of Section 1, #2801 Indicates a bearing and distance on W. line of 1/4 N. of corner.	
5/2006, J. Leas, LS 42619 Certificate of Survey in NE ¼ of SE ¼ Section 2, #3137 Notes corner as recovered. Later learned this was an alignment point for centerline Hwy #6 not tied to the corner.	
2006-2009, J. Leas, LS 42619 Working with CCHD/SO to review all previous work on file, as well as ties to the E. - W. 1/4 lines in both S. 1 and 2. This corner position was computed using distances from the Cass Co. ditch survey, plat monuments and distances from the plat of WESTERN ADDITION TO REMER, and monuments in place at the E. 1/4 corner and the C. 1/4 of Section 1.	
12/2009, J. Leas, LS 42619 Unrecorded Certificate of Location of Government Corner Set ½" iron pipe for corner, 59' E. of centerline Hwy #6 and 34' S. of centerline Hwy #200 and witnessed as follows Culvert Guard Post, N 81° E, 22.57' Power Pole, S 44° E, 52.55' Stop Sign Post, S 51° W, 37.20'	

Index No. C 21

CASS COUNTY LAND CORNER RECORD

T. 141 R. 26 M. 5TH Coordinates: X _____ Y _____
E 1/4 2 Corner common to sections 12

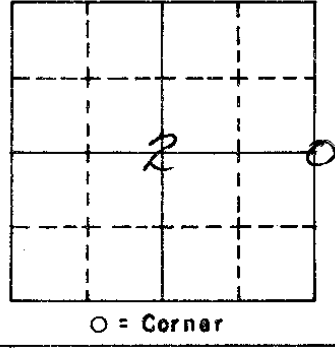

EXISTING SURVEYS

Original Government Survey
 Year surveyed 1871
 Original monument POST

Bearing Trees
 Species ASPEN ASPEN
 Diameter 6" 7"
 Bearing S80E S4W
 Distance 145 LKS 600 LKS

Original Evidence Found
 Year of search _____ By _____
 Monument found _____

Original Bearing Trees Found
 Species _____
 Diameter _____
 Bearing _____
 Distance _____

Subsequent Corner Restoration
 Year surveyed 1927 By Man for Dept.
 Location filed R/W map in Recorder's office.
 Monument Remer to Cahasset
Corner in center of road

Evidence of Subsequent Corner Restoration
 Year of search _____ By _____

Bearing Trees, Reference Objects
 Species _____
 Diameter _____
 Bearing _____
 Distance _____

Bearing Trees, Reference Objects

Subsequent Corner Restoration
 Year surveyed _____ By _____
 Location filed _____
 Monument _____

Evidence of Subsequent Corner Restoration Found
 Year of search _____ By _____
PLAT - REMER
OTTO GOBLER 1910
PLAT - PLAT OF BLOCKS 5, 6, 7, REMER
GEO. A. DARBY 1912
PLAT - WESTERN ADDITION TO REMER
JOHN M. GREENE 1913
PLAT - AUDITOR'S PLAT OF REMER OUTLOTS
NO SURVEYOR LISTED

Remonumentation certificate prepared _____ By _____
 Filed at _____ Date _____