


Index No. X 25

CASS COUNTY LAND CORNER RECORD

T. 142 R. 31 M. 5TH Coordinates: X _____ Y _____
E 1/4 36 Corner common to sections 36 AND 31 - 142 - 30

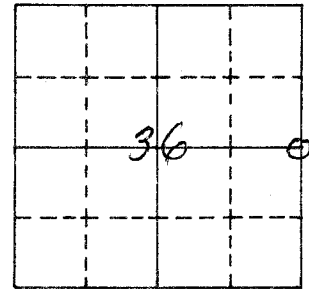

○ = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument POST

Original Evidence Found

Year of search 1917 By GLO
Monument found 4" sp. pine post

Bearing Trees

Species	<u>Y. Pine</u>	<u>Y. Pine</u>	_____
Diameter	<u>14"</u>	<u>12"</u>	_____
Bearing	<u>S79 1/4 E</u>	<u>N43 W</u>	_____
Distance	<u>9 lks</u>	<u>26 lks</u>	_____

Original Bearing Trees Found

Species	<u>Y. Pine stp.</u>	<u>Y. Pine stp</u>	_____
Diameter	<u>16</u>	_____	_____
Bearing	<u>S79 1/4 E</u>	<u>N63 W</u>	_____
Distance	<u>9 lks</u>	<u>26 lks</u>	_____

Subsequent Corner Restoration

Year surveyed 1916 By F.F. Wilson
Location filed COUNTY BOOK C' P114-115
Monument END WOOD POST
1916, E.B. HAST, BOOK C' P523 END BOTH GOVT B.TS. SET
4x4x60" WOOD POST
- also on micr. E. 1/4 - roll 115 BK 80. P. 40

Evidence of Subsequent Corner Restoration

Year of search 1917 By GLO
Set 1" x 36" I.P. w/ Br. Cap at found
post.

Bearing Trees, Reference Objects

Species	_____	_____
Diameter	_____	_____
Bearing	_____	_____
Distance	_____	_____

Bearing Trees, Reference Objects

<u>W. Oak</u>	<u>R. Oak</u>	_____
<u>7</u>	<u>6</u>	_____
<u>S77 E</u>	<u>N32 W</u>	_____
<u>44 lks</u>	<u>35 lks</u>	_____

Subsequent Corner Restoration

Year surveyed 1984 By J. Freeman & USFS
Location filed _____
Monument End GLO Brass cap down 2' in road
raised to 1' below surface
new B.Ts by USFS:
14" W. oak S25E 98.45'
8" W. oak N78E 63.65'
15" R. oak N33W 42.50' G. Stevenson tree
also find other GHS trees 6" W. oak N83E 27.5'

Evidence of Subsequent Corner Restoration Found

Year of search March 1922 By _____
Twined order shows no survey

Remonumentation certificate prepared _____

By _____

Filed at _____

Date _____