

CORNER RESTORATION THIN R25

CORNER  
RESTORATION  
THIN R25W

FIELD BOOK

82-0012

BOOK #2






A-3

1/4 CORNER BETWEEN SECTIONS 6 & 31  
FROM ORIGINAL SURVEY OF 1871

40.00	1/4 SECTION POST	
	W. PINE	W. PINE
	24"	16"
	N84W	SOUTH
	? IKS	20 IKS
		13.2'

5.00 CHS. EAST, ENTER SWAMP.

SET A 2" X 5' GALV. STEEL PIPE, FILLED  
WITH CONCRETE, 42" IN THE GROUND,  
WITH BRASS TABLET STAMPED AS  
FOLLOWS:

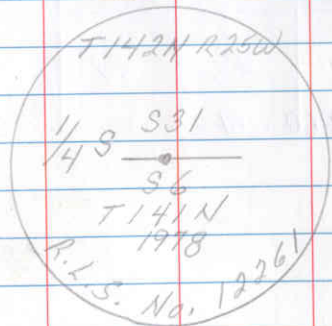

9/29/18  
Ronald Chew

FROM WHICH BEARS:

W oak	10"	N71°W	164.48'	1/4 S 31 BT
W Birch	9"	N84W	88.72'	1/4 S 31 BT
W oak	6"	N33E	20.90'	1/4 S 31 BT
8' Long steel post	W/S	9054-4	South	1.6'

July 13, 1977

STEFAN

Found:

- 1) 2" X 4' IRON PIPE NEAR FENCE  
CORNER - FENCES, NORTH, EAST, SOUTH & WEST
- 2) LARGE W. PINE STUMP SOUTH, 13.2'  
ROTTED NEARLY TO GROUND, SIZE ABOUT
- 3) LARGE W. PINE STUMP N84°W, DIST-  
ANCE NOT READABLE IN FIELD NOTES.  
23"-24" WOULD FIT AS 40-41 IKS.  
12" BIRCH & TWO 8" BALSAM FIR GROWING  
OUT OF THIS VERY DECAYED STUMP.  
SIZE VERY GOOD.

1922 J.H. Flynn

Found old W. Pine stump south 13.2'  
Set 1 1/2" by 44" flue pipe



SECTION CORNER COMMON TO SECTIONS 5, 6,

31 & 32, T141N & T142N, R25W

FROM ORIGINAL SURVEY OF 1871

80.00 SET POST

H. MAPLE H. MAPLE

4" 4" 5" 14"

N 81°W S 39°E N 3°E S 76°W


12 IHS 6 IHS 38 IHS 86 IHS

JULY 13, 1977

STEFAN

FOUND: 1) BADLY DAMAGED CONCRETE  
MONUMENT WITH STEEL ROD &  
CAP MARKED TO IDENTIFY CORNER.  
MONUMENT AT FENCE CORNER,  
FENCE NORTH & WEST.

REPLACED DAMAGED MONUMENT WITH A  
2" X 5' GALV. STEEL PIPE, FILLED WITH  
CONCRETE, 42" IN THE GROUND, WITH  
BRASS TABLET STAMPED AS FOLLOWS:

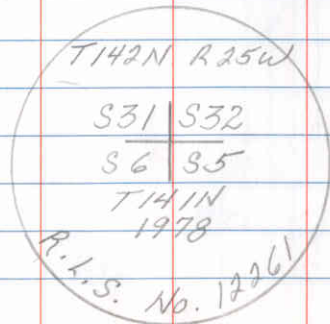

FROM WHICH BEARS:

R. OAK 13 N 72°W 68.71 MKD T142N R25W S31 BT

H. MAPLE 11 N 70°E 39.45 MKD T142N R25W S32 BT

E. WOOD 10 S 42°E 37.33 MKD T141N R25W S5 BT

B. WOOD 8 S 50°W 46.38 MKD T141N R25W S6 BT

8" STEEL POST SET DUE NORTH 4.0' BOTH SIGNS

8" STEEL POST SET DUE WEST 18.7' BOTH SIGNS

9-25-78

CH &

1922 J. H. Flynn, Cass Co.

Set concrete monument

Aspen, 4", S 06°E, 6.4 ft

Aspen, 4", S 15°W, 4.0 ft

1935 Sykes B74-9

Found Iron Pin with metal cap  
Metal location post

Aspen 6" N 77°W 66.0'

Tag on East side of tree



C-5

1/4 CORNER BETWEEN SECTIONS 5 & 6  
FROM ORIGINAL SURVEY OF 1871

39.10 SET 1/4 SECTION COR. POST

TAM	BIRCH
10"	7"
S37°W	S38°E
53 IHS	81 IHS
34.98'	53.46'

.60 CHS. SOUTH, LV. SWAMP, E-W

1.00 CHS. NORTH, LV. SWAMP, E-W

SEPT 21, 1977

STEFAN

FOUND: 1) VERY OLD FENCE LINE WEST-EAST.

2) 14"-16" W. BIRCH STUMP &amp; 10" SPROUT ORIGIN TREE.

PULLED DISTANCE & BEARING  
FROM BIRCH, POINT FALLS  
AT EAST END OF FENCE ROW.

SET POINT &amp; LOCATED TAM.

3) STUMP 10"-12", S39°W, 35'

JUNE 18, 1978

TRAVERSE TO THIS POINT FROM SECTION  
CORNER NORTH IS SHORT BY 6.37'

PROPORTIONAL POSITION IS EASTERLY  
3 FEET. AS NO CONCLUSIVE EVIDENCE

3

ORIGINAL SURVEY CALLS

RANDOM LINE-NORTH

TRUE LINE-SOUTH

79.10  
65

65

41.00 - LEAVE MARSH  
E-W

40.00 - TEMP. POST

39.10 1/4 CORNER  
61539.40 - ENTER SMALL  
MARSH  
E-W

OF THIS CORNER HAS BEEN LOCATED,  
I CHOOSE TO DISREGARD THE MANY  
PICKETS & FENCE POSTS & POSSIBLE  
BEARING TREE STUMPS AND PLACE THIS  
CORNER'S POSITION BY LAST CORNER  
METHODS, AT THE SINGLE PROPOR-  
TIONAL POSITION FROM SECTION CORNERS  
NORTH & SOUTH:

M. E. P. R.

MONUMENTATION NOTES PAGE 21

SEC. COR. COMMON TO SECTIONS 5, 6, 7 & 8  
FROM ORIGINAL SURVEY NOTES 41871

80.00 SET POST

SPRUCE SPRUCE SPRUCE BIRCH

8" 8" 14" 10"

N40°W S18°W N34°E S39°E

34 IKS 41 IKS 53 IKS 34 IKS

22.44' 27.06' 34.98' 22.44'

1.85 EAST - M.C. TO BIRCH LAKE

122.10'

TAM

TAM

8"

8"

N89°W

S38°W

37 IKS

59 IKS

24.42'

38.94'


4.50 NORTH - ENTER TAM. SWAMP - NW-SE.

UPON SEVERAL TRIPS BACK TO THIS CORNER  
AREA, HAVE FOUND NO EVIDENCE OF THE  
ORIGINAL CORNER OR ITS POSITION.

A FENCE WANDERS THROUGH THE AREA  
BUT STATED BY OSCAR SCORM THAT  
IT IS NOT THE SECTION LINE. I  
THEREFORE DECLARE THIS CORNER AS  
LOST AND PROPORTION IT IN FROM  
CORNERS EAST, WEST, NORTH & SOUTH.

M.E. Stefan

SET A 2" X 5' GALV. STEEL PIPE, FILLED  
WITH CONCRETE, 42" IN THE GROUND,  
WITH BRASS TABLET STAMPED AS FOLLOWS:

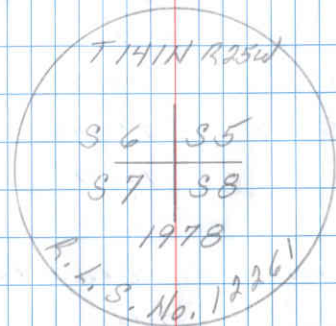

FROM WHICH BEARS:

B. ASH 14", N35°E, 28.68 M AND T141N R25W S6 BT

B. ASH 11", S28°E, 39.84 M AND T141N R25W S8 BT

B. ASH 16", S30°W, 74.90 M AND T141N R25W S7 BT

B. ASH 13", N24°W 138.86 M AND T141W R25W S6 BT

8' SIGN POST EAST 2.6'

8' SIGN POST NORTH 3.9'

FENCE EAST-WEST 27.0' NORTH OF CORNER

7/26/78

CK + M.E.S



E-3

1/4 SEC. COR. TO SECTIONS 6 &amp; 7

FROM ORIGINAL SURVEY NOTES - 1871

38.32 1/4 SEC. COR. POST

ASPEN ASPEN

6" 7"

S 58° W N 8° W


12 IHS 27 IHS

7.92' 17.82'

AREA DESTROYED BY ROAD WAY SOUTH &  
HIGHWAY #200 IN GENERAL AREA.

I DECLARE THIS CORNER AS LOST &  
POSITION IT FROM THE CENTER-LINE OF  
COUNTY ROAD NORTH & ABANDONED ROAD  
SOUTH WITH INTERSECTION OF FENCE LINE TO  
THE WEST.

SET A 5" X 3 1/2" X 24" CONCRETE POST,  
4" BELOW GROUND SURFACE, WITH BRASS  
CAP STAMPED AS FOLLOWS:

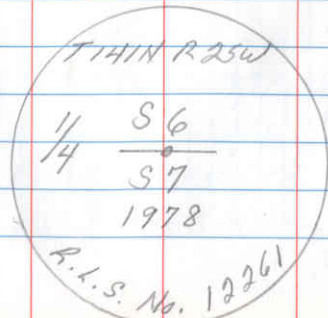

5

FROM WHICH BEARS:

WAX 16" S 91° E 259.95' MKD 1/4 ST BT

R.PINE 8" N 28° E 142.10' MKD 1/4 S 6 BT

ASH 14" N 15° W 243.00' MKD 1/4 S 6 BT

8' STERN POST SET DUE EAST 16.1' ATTEN. SIGN

9-20-78

CK &amp; MEB

1/4 OF N-S ROAD

FENCE LINE (UP) WEST OF COR.

1911 Harry Todd

Found both Govt. BT's - set corner

E-1  
 SEC. COR. COMMON TO SECTIONS 1, 6, 12 & 7  
 FROM ORIGINAL SURVEY OF 1867

80.00 SET POST  
 TAM. TAM. TAM.  
 10" 10" 14"  
 S52°E S38°W N3°W  
 18 IKS 48 IKS 46 IKS  
 11.88' 31.68' 30.36'

2.00 SOUTH - LV. WILLOW & TAM. SWAMP E.W.  
 12.00 SOUTH - ENTER CREEK BOTTOM.  
 13.00 SOUTH - CREEK - 50 IKS. WIDE, RUNS S.E.  
 4.00 NORTH - LV. SWAMP.  
 2.32 EAST - LV. MARSH & WILLOW SWAMP N.E.S.W.  
 2.52 WEST - CREEK - 30 IKS WIDE, RUNS SOUTH.  
 10.79 NORTH - CREEK - 50 IKS " , RUNS S.W.

SEPT. 21, 1977

STEFAN

FOUND: 1) FENCE CORNER; FENCE EAST  
 SOUTH & NORTH.


2) 10"-12" TAM. STUMP, VERY ROTTEN  
 S52°E, 11.9'

3) 12"-14" TAM. STUMP, VERY ROTTEN  
 S38°W, 31.8'

4) CALLS TO SWAMP EDGE SOUTH & EAST FIT.

5) CALLS TO CREEK NORTH, SOUTH & WEST  
 FIT WELL ON PHOTOS.

6  
 FROM REMAINS OF ORIGINAL BT<sup>W</sup> I  
 SET A 2" X 5' GALV. STEEL PIPE, FILLED  
 WITH CONCRETE, 42" IN THE GROUND,  
 WITH BRASS TABLET STAMPED AS FOLLOWS:

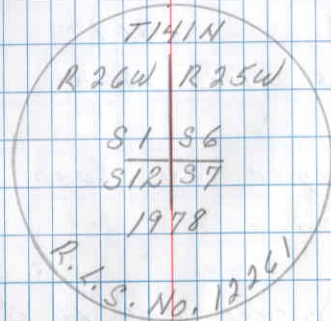

FROM WHICH BEARS:

12" O. ASH N51°E, 32.58' MKD T141N R25W  
 S 6, BT

6" ELM. S16°E, 77.58' MKD T141N R25W  
 S 7 BT

8" W. OAK S79°W, 122.14' MKD T41N R26W  
 S 12 BT

10" W. OAK N148°W, 145.39' MKD T141N R26W  
 S 1 BT

8' STEEL SIGN POST WEST 2.0' / 54-4



C-1

1/4 SEC. COR. BETWEEN SECTIONS 196

FROM ORIGINAL SURVEY OF 1867

40.00 SET 1/4 SEC. COR. POST

ASPEN ?

8" 4"

N81E S64°W

14 IKS 13 IKS

AREA DESTROYED BY ROAD CONSTRUCTION.

JULY 13, 1977

STEFAN.

FOUND: 1) STEEL PIN IN CENTER OF ROAD, 6" BELOW SURFACE.

2) F.S. LOCATION POSTERS ON TWO FENCE POSTS SOUTH 25.7' (TO NAIL ON EAST EDGE OF POST) &amp; S5°W, 26'.

3) NAIL ON WEST EDGE OF 12" POST N15°W, 28.1'.

4) 1 1/2" PIPE NORTH 25.7'.


5) FENCE LINE NORTH &amp; SOUTH.

THIS STEEL PIN HAS BEEN IN PLACE MANY YEARS. IT HAS BEEN USED AS THE 1/4 CORNER FOR TOWN OF FEMER, FENCES NORTH-SOUTH & ROAD EAST-WEST. I ACCEPT ITS POSITION AS THE 1/4 CORNER BETWEEN SECTIONS 196.

M. Stefan

7

SET A 6" X 6" X 24" CONCRETE POST IN REPLACEMENT OF IRON PIPE, 18" BELOW THE ROAD SURFACE, WITH BRASS TABLET STAMPED AS FOLLOWS:

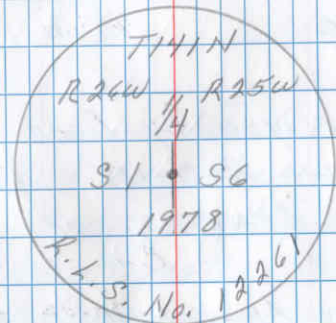

FROM WHICH THE FOLLOWING BEAR:

W. Oak 7" N34°W 43.10

W. Oak 18" S46°W 108.45'

W. Pine 17" S74°E 96.60'

8' Long steel sign post w/ sign  
54-4 North 25.5'

9/28/78

Ronald Olson  
ms

1/4 CORNER BETWEEN SECTIONS 7 & 8

FROM ORIGINAL SURVEY OF 18

40.00 SET 1/4 SEC. COR. POST

SPRUCE

SPRUCE PINE

7"

7"

S41E

N70°W

13 IKS

16 IKS

JULY 1977


AREA DESTROYED BY ROAD CONSTRUCTION  
AND FARMING ACTIVITY. NO TRACE OF  
1/4 CORNER REMAINS.

CORNER IS RESTORED USING § OF  
NORTH-SOUTH ROAD FOR DEPARTURE  
AND FENCE LINE EAST & WEST FOR  
LATITUDE.

PLACED HUB TEMPORARILY

SEPT 1978

REPLACED HUB WITH A 6" X 6" X 24" CONCRETE  
POST 8" BELOW ROAD SURFACE, WITH  
BRASS TABLET STAMPED AS FOLLOWS

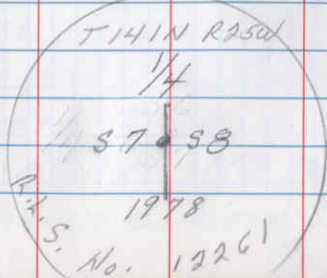

FROM WHICH THE FOLLOWING BEAR:

R. MAPLE 14", S40°E, 25.87' MHO 1/4 S8 BT

W. BIRCH 13", S20°E, 33.68' MHO 1/4 S8 BT

ELM 18", N57°W, 44.80' MHO 1/4 S7 BT

8' SIGN POST 2.2' SOUTH / 54-4

9/20/78 MEB

May 15, 1911

J. Curo & Crew.

Found both original gov't survey  
BT's standing and plainly marked.  
Courses don't match. Set corner  
by proportionate measurement.

1913 Flynn & Todd Fnd both BT's Set Corner

W. Pine, 14", S43°E, 49 ft

W. Birch, 12", S57°W, 45 ft

1941 D. Campbell

Found 1913 W. PINE Stamp S43°E 49.0'

Metal location PESTER ON

ELM 6" N51°W 41.6'

TAG ON SE side of TREE



E-5,6

MEANDER CORNER ON WEST SHORE  
OF BIRCH LAKE, BETWEEN 5 & 8

TRUE LINE EAST BETWEEN SECTION 5 & 8  
1.85 MARGIN OF LAKE & SET M.C.

TAMARAC

TAMARAC

8"

8"

N89°W

S38°W

37 IKS

59 IKS

24.42'

38.94'

7/6/77

STEFAN

FROM SURVEYED POINT FOR SECTION  
CORNER 1.85 CHAINS WEST, SEARCHED  
AREA & COULD FIND NO TRACE OF  
M.C. LAKE APPEARS TO BE AT  
MUCH HIGHER WATER LEVEL. MANY  
STUMPS UNDER WATER. OLD N-S  
GRADE ABOUT ON SECTION LINE.

MONUMENT NOT PLACED BECAUSE OF  
HIGH WATER AT PRESENT TIME


Mil. Stefan 7/78

C-3

## CENTER 1/4 CORNER SECTION 6

CORNER POSITION ESTABLISHED AT  
THE INTERSECTION OF N-S 1/4  
LINE & THE E-W 1/4 LINE DURING  
THE SUB-DIVISION SURVEY OF  
SECTION 6, T141N, R25W.

PLACED A 6" X 6" X 24" CONCRETE  
POST, 24" BELOW THE ROAD SURFACE  
WITH BRASS TABLET STAMPED AS  
FOLLOWS:

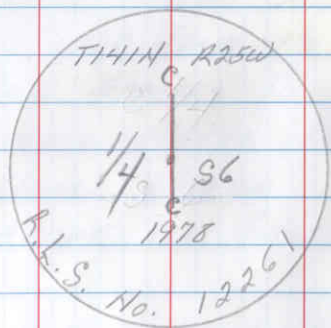

FROM WHICH BEARS:

TAM 5" S54°E 70.63 MKD C/456 BT

TAM 4" S85°E 43.49 MKD X BT

BM-R34 N45°W 38.49 3" BRASS CAP IN CONCRETE

8" STEEL POST SET DUE EAST 21.3' ATTN SIGN

9/26/78 MMS



B-3

CN No 566

JULY 1977

STEFAN

SCRIBED POST ALONG SIDE FENCE CORNER.

NO INFORMATION ON HOW THIS WAS  
PLACED HAS BEEN TURNED UP.

MONUMENTED THIS CORNER ON  
PAGE 22 - THIS BOOK.

1940 R. DEFANT

FOUND STAKE

METAL LOCATION POSTER ON

ASPEN 8" N20°E 40.92'

TAG ON SW SIDE OF TREE

See BK <sup>2</sup>~~1~~, PP 22

Z-5

SECTION COR. TO SECTIONS 31+32

EAST ON TRUE LINE ON SOUTH SIDE OF SEC. 31.

80.00 CORNER TO SECTION 31+32:

?

?

?

?

N3°W

N43°E

106 IKS

18 IKS

12/27/74

WITTHOEF

FOUND 1/4" IRON PIPE 20" ABOVE  
GROUND, MARKED 31/32 ON CAP.



E-7,8

MEANDER CORNER BET. SECTIONS 5 &amp; 8

EAST SHORE OF BIRCH LAKE

FROM ORIGINAL NOTES OF 1871:

WEST ON TRUE LINE FROM SECTION COR.

EAST

24.03 SET POST FOR M.C.

TAM. TAM

6" 8"

N60°E S71°E

59 IKS 32 IKS

38.94' 21.12'

SOUTH 11.5 INLET TO LAKE, 50 IKS WIDE

3/19/78 STEFAN


PULLED DISTANCE FROM MOUTH OF CREEK  
 & FOUND 10" TAM STUMP WITH REVERSED  
 IMPRESSION OF SCRIBING FROM "BT" FACE.

THIS WAS THE N.E. B.T. & M.C. NOW  
 FALLS IN LAKE. S.E. BT ALSO FALLS  
 IN LAKE. WILL PLACE W.C.M.C. ON  
 SECTION LINE ON SHORE.

PLACED W.C.M.C. 90.00 FEET EASTERLY &  
 ON LINE BETWEEN M.C. & SECTION  
 CORNER EAST. WEST

13

SET A 2" X 5' GALV. STEEL PIPE, FILLED  
 WITH CONCRETE, 42" IN GROUND,  
 WITH BRASS TABLET STAMPED AS FOLLOWS

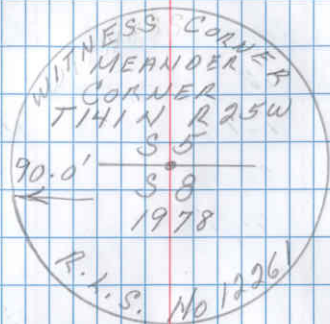

FROM WHICH BEARS:

W. BIRCH 8" N 4' W, 39.60 MKD MC 55 WCBT

CEDAR 11" S 20° W, 6.38 MKD MC 58 WCBT

TAM 7" N 51° W, ~~23~~ 44.99 MKD MC 55 WCBT

SIGN POST WEST 4.2'

ORIG. BT STUMP N 72° W 59.7'

9/26/78 MEB

E-9

## SECTION CORNER COMMON TO SECTIONS

4, 5, 8 &amp; 9

FROM ORIGINAL SURVEY OF 1871

80.00 SET POST FOR SECTION CORNER

TAM CEDAR

12" 8"

N61°E N40°W

26 lks 19 lks

17.3' 12.54'

3/19/78

STEFAN

PULLED CHAIN FROM M.C. 24.03 CH

WEST &amp; FOUND TAM. SNAPE CUT

OFF 4' HIGH WITH OVER GROWN

FACE AT DBH &amp; STOMP. TO

MUCH FROST &amp; SNOW COVER TO

COMPLETE SEARCH THIS DAY.

8/24/81

Kib. Whitehorn, R. Olson, D. Roerick


Found 5"x5" cedar post lying in swamp along with 13" Tamarack stub with scribing visible. Also found 6"-8" Cedar log lying in swamp covered with moss. Pulled off moss and blaze was faintly visible but part of overgrowth with reverse image was salvagable. Dug in swamp in

## CERTIFICATE FILED

144

a 5' Radius of found cedar post, found no evidence of the point so set a 8' x 2" galvanized steel pipe with brass cap using bearing and distance to Tamarack and checked bearing and distance to the cedar log.

Brass cap marked:

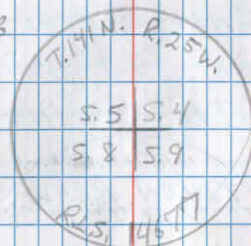

Certificate  
filed 2-23-83  
Doc # 267408

Bearing trees:

Found Tamarack Stub 13" N61°E 26 lks (17.16) Orig

Found 3-8" Cedar log S 29°E 6 lks (3.96) Orig

Cedar 7" N 39°W 41.87'

Cedar 7" N 57°E 15.76'

Cedar 9" S 66°E 21.72'

Cedar 11" S 45°W 29.57'




A-4

EAST  $\frac{1}{16}$  BETWEEN SECTIONS 6 & 31

POSITION ESTABLISHED AT MID-POINT  
AND ON LINE BETWEEN SECTION CORNER  
EAST  $\frac{1}{4}$  CORNER WEST DURING  
THE SUB-DIVISION SURVEY OF  
SECTION 6, T14N, R25W.

SET 2" X 5' GALV. STEEL PIPE FILLED  
WITH CONCRETE, 42" IN PEAT SOIL  
WITH BRASS CAP STAMPED AS FOLLOWS:

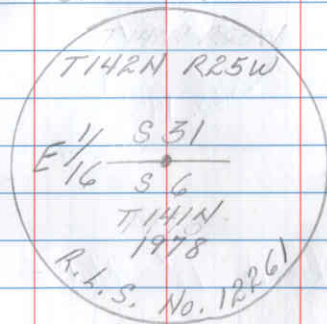

FROM WHICH BEAR:

TAM.	7	S35W	11.92'	MKD E $\frac{1}{16}$ S6 BT
TAM.	9	S69E	29.94	MKD E $\frac{1}{16}$ S6 BT
TAM.	11	N48E	35.60'	MKD E $\frac{1}{16}$ S31 BT

8' STEEL POST SET DUE EAST 4.1' BOTH SIGNS

8' STEEL POST SET DUE SOUTH 3.6' BOTH SIGNS


9-25-78

*mm*

B-4  
NE  $\frac{1}{16}$  TO SECTION 6

POSITION ESTABLISHED BY SURVEY  
AT THE INTERSECTION OF E-W  $\frac{1}{16}$   
LINE & N-S  $\frac{1}{16}$  LINE IN THE NE  
 $\frac{1}{4}$  OF SUB-DIVISION SURVEY OF  
SECTION 6, T141N, R25W.

SET A 2" X 5' GALV. STEEL PIPE, FILLED  
WITH CONCRETE, 42" IN THE GROUND  
CAPPED WITH A BRASS TABLET  
STAMPED AS FOLLOWS:

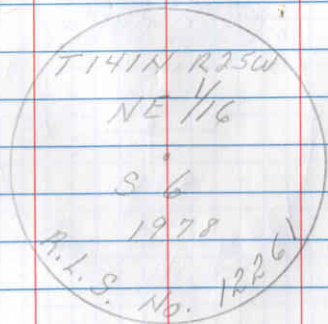

FROM WHICH BEAR: mjs

TAM.	8	S37E	62.65'	<del>63.30</del>	MKD NE $\frac{1}{16}$ S6 BT
W. PINE	13	S1W	76.81'	<del>78.00</del>	MKD NE $\frac{1}{16}$ S6 BT
TAM.	12	S15W	1.00'	<del>2.85</del>	MKD NE $\frac{1}{16}$ S6 BT

8' STEEL POST SET DUE NORTH 2.6' BOTH SIGNS

8' STEEL POST SET DUE EAST 2.3' BOTH SIGNS

9-25-78 mjs




B-5

NORTH  $\frac{1}{16}$  BETWEEN SECTIONS 5 & 6

POSITION ESTABLISHED AT PROPORTIONAL  
MEASURE FROM SECTION CORNER NORTH  
&  $\frac{1}{4}$  CORNER SOUTH, DURING THE SUB-  
DIVISION SURVEY OF SECTION 6, T14N, R25W.

SET A 2" X 5' GALV. STEEL PIPE FILLED  
WITH CONCRETE, 40" IN THE GROUND,  
CAPPED WITH A BRASS TABLET  
STAMPED AS FOLLOWS:

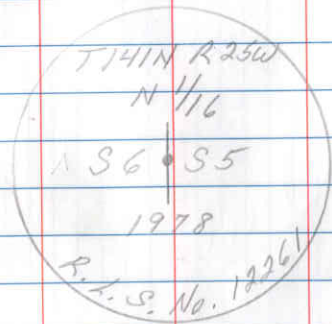

FROM WHICH BEARS:

R. OAK 6" S13W 35.50' MKD N $\frac{1}{16}$  S6 BTR. OAK 22" S84W 28.45' MKD N $\frac{1}{16}$  S6 BTR. OAK 9" N41W 68.90' MKD N $\frac{1}{16}$  S6 BT

8" STEEL POST SET DUE WEST 3.5' BOTH SIGNS

8" STEEL POST SET DUE SOUTH 41' BOTH SIGNS

9/25/78


mjs

C-4

CENTER EAST  $\frac{1}{16}$  TO SECTION 6

POSITION ESTABLISHED ON LINE  $\frac{1}{4}$   
MID-POINT BETWEEN THE C $\frac{1}{4}$  & E $\frac{1}{4}$   
TO SECTION 6, T14N, R25W.

PLACED 2" X 5" GALV. STEEL PIPE  
FILLED WITH CONCRETE, 42" IN THE  
GROUND, WITH BRASS TABLET STAMPED  
AS FOLLOWS:

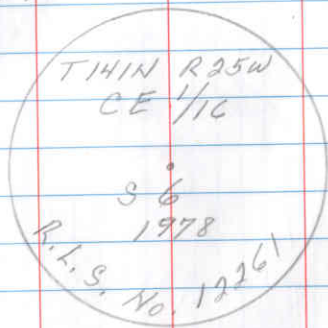

FROM WHICH BEARS:

R. OAK 19" S43W 69.90' MKD CE  $\frac{1}{16}$  S6 ET

R. OAK 16" S66E 126.50' MKD CE  $\frac{1}{16}$  S6 ET

R. PINE 9" N2°W 149.65' MKD CE  $\frac{1}{16}$  S6 ET

8' STEEL POST SET DUE SOUTH 2.6' BORN SIGNS

8' STEEL POST SET DUE EAST 2.7' BORN SIGNS

9/25/78

MRS




D-4

SE  $\frac{1}{16}$  TO SECTION 6

POSITION ESTABLISHED BY SURVEY  
AT THE INTERSECTION OF N-S  $\frac{1}{16}$  LINE  
& E-W  $\frac{1}{16}$  LINE TO THE SE  $\frac{1}{4}$  OF SUB-  
DIVISION SURVEY OF SECTION 6, 141, 25

SET A 2" x 6' GALV. STEEL PIPE, FILLED  
WITH CONCRETE, 40" IN PEAT SOIL,  
WITH BRASS CAP STAMPED AS FOLLOWS:

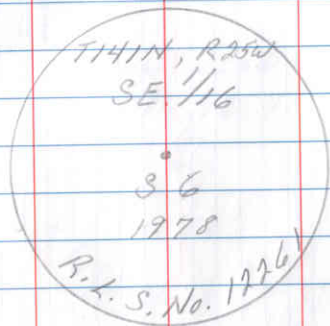

FROM WHICH BEARS:

TAM. 14" N37°E 54.87' MKD SE  $\frac{1}{16}$  S6 BT

TAM. 10" N84°W 23.09' MKD SE  $\frac{1}{16}$  S6 BT

TAM. 11" N87°W 31.20' MKD SE  $\frac{1}{16}$  S6 BT

8' STEEL POST SET DUE NORTH 5.0' BOTH SIGNS

8' STEEL POST SET DUE EAST 4.4' BOTH SIGNS


7/24/78  
MNO

D-5

SOUTH  $\frac{1}{16}$  BETWEEN SECTION 5 & 6

POSITION ESTABLISHED BY SURVEY  
ON LINE AND MID-POINT BETWEEN  
THE SECTION CORNER SOUTH  $\frac{1}{4}$   
CORNER NORTH.

SET A 2" X 5' GALV. STEEL PIPE  
FILLED WITH CONCRETE, 42" IN THE  
GROUND, WITH A BRASS TABLET  
STAMPED AS FOLLOWS:

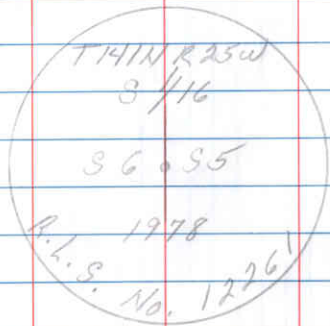


FROM WHICH BEARS:

Y. BIRCH 13", N43E, 26.07 MKD S  $\frac{1}{16}$  S5 BT  
B. ASH 10", S 93E, 25.65 MKD S  $\frac{1}{16}$  S5 BT  
B. ASH 5", N36W, 19.80 MKD S  $\frac{1}{16}$  S6 E  
8' SIGN POST SOUTH 4.1'  
8' SIGN POST WEST 3.2'

9/26/78 MBL



C-5, CONTINUED FROM PAGE 3  
 1/4 CORNER BETWEEN SECTIONS 546  
 BY SURVEY OF SECTION 6, BY MILO STEFAN,  
 SET A 2" X 5' GALV. STEEL PIPE, FILLED  
 WITH CONCRETE, 42" IN PEAT SOIL, WIRED  
 TO AN 8" STEEL FENCE POST, WITH  
 BRASS TABLET STAMPED AS FOLLOWS:

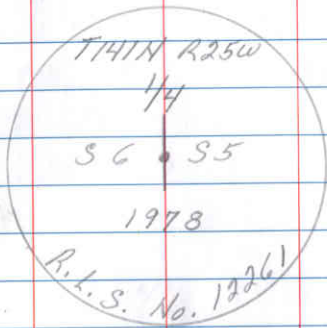

FROM WHICH BEARS:


TAM.	8"	N 67° E	62.90'	MKD 1/4 S5 BT
TAM.	5"	S 37° E	26.76'	MKD 1/4 S5 BT
R. PINE	20"	N 1° W	71.58'	MKD 1/4 S6 BT

8' STEEL POST SET DUE NORTH 2.5' BOTH SIGNS  
 8' STEEL POST SET DUE WEST 3.8' BOTH SIGNS  
 9/25/78 MED

B-3 CN  $\frac{1}{16}$  TO SECTION 6

BY SURVEY OF SECTION 6, BY M.L.O.F. STEFAN, ESTABLISHED THIS CORNER ON LINE BETWEEN THE C  $\frac{1}{4}$  & N  $\frac{1}{4}$  OF SECTION 6 AND AT THE PROPORTIONAL DISTANCE THEREOF.

MONUMENTED POSITION BY PLACING A 2" X 5' GALV. IRON PIPE, FILLED WITH CONCRETE, WITH BRASS TABLET STAMPED TO IDENTIFY AS FOLLOWS:

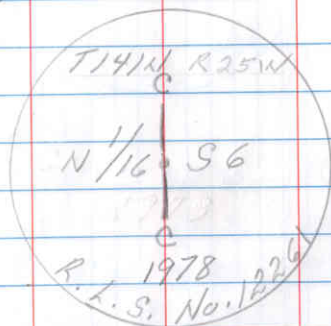

FROM WHICH THE FOLLOWING BEAR:

- 6" W. OAK N65E, 128.37, MND CN  $\frac{1}{16}$  SEC 6 T
- 3" TAM. S 8° W, 117.65, MND " X BT
- 13" W. OAK, N60W, 92.03, MND CN  $\frac{1}{16}$  SEC 6 T
- 8' STEEL SIGN POST N45° E 1.5' / 54-4

See BK 2, PP 11



T141N R25W Sec Cor 7, 18, 12, &amp; 13

Original Gov't Survey

Cedar, 6", N47½°E, 11.88 ft

Tom., 10", S27¾°W, 16.50 ft

Cedar, 8", N56°E, 11.88 ft

Tom., 5", N66°W, 11.22 ft

1919 J.H. Flynn

Found all 4 Gov't BT stumps

B. Ash, 6", N37°W, 34.2 ft GONE

B. Ash, 8", S42°W, 49.0 ft GONE

B. Ash, 10", S66°E, 40.3 ft GONE

SURVEY RECORD # 507-BOOK D - Pgs. 62-63

By J.H. FLYNN - JUNE 23-27-1919

Fd. EVIDENCE OF GOV'T. BT'S.

MARKED TREES RECORDED ABOVE

DISTANCE NORTH TO ¼ CORNER IS 2627.0'

AND DISTANCE SOUTH TO ¼ CORNER IS 2641.0'

1-2-40 DEFANT 874-9

Fd 2" PIPE 2 FT ABOVE GROUND IN DITCH ON  
EAST SIDE OF ROAD. PLACE FSLP ON ASH 12"  
FROM WHICH CORNER BEARS S50°E 165 ch.

5-16-02 RMAEN

Fd 2" X 1/4 FT IRON PIPE IN EAST DITCH  
OF OLD ROAD, Fd NO EVIDENCE OF ORIG OR 1919  
BT'S. NO EVIDENCE OF DEFANT TREE OR TAG.  
IRON FITS WITH CALL TO NORTH BANK OF  
WILLOW RIVER I BELIEVE THIS IRON IS  
IN PLACE AND IS TRACED TO ORIGINAL.  
MARK 2 BT'S AS FOLLOW.

ASH 7" N86°W 34.00 FT TO SPK MKD BT.

ASH 7" N41°E 14.40 FT TO SPK MKD BT

24

3-5

T141NR25W Sec. Cor. 7, 18, 8, 417

Original Gov't Survey

Spruce Pine, 18", N26°E, 17.16 ft  
 Fir, 14", N67°W, 25.08 ft  
 Cedar, 12", S57°E, 34.98 ft  
 Birch, 15", S50°W, 29.04 ft

May 27, 1920 Curo

Find post point in middle of Twp Road

1913W. Birch, 14", N42½°W, 36.0 ft  
 1913 Elm, 20", N27¼°E, 84.4 ft

June 4, 1920 Curo

Set Iron Pipe 2½ ft long, 3 in diameter  
 with cap S 17 18 7 8 with  
 stone mound

1913 J.H. Flynn

Found old Gov't BT's

W. Birch, 14", N42½°W, 36.0 ft  
 Elm, 20", N27¼°E, 84.4 ft

June 14, 1985 G. Kosenko, G. Robertson

Recovered a 2½ inch outside  
 diameter Iron Pipe, sheered off

## CERTIFICATE FILED

24

4 inches from the top with the  
 remainder of the pipe still in the  
 road. This is Curo's 1920 Iron Pipe.

Place the following ties:

Fence Post, 5", S52°E, 32.02 ft.

W. Spruce, 16", S31°W, 33.52 ft

Will place a new monument later etc.

July 1, 1985 G. Robertson B. Ausk

Pulled old monument and set a 2 ft long  
 by 2½ in. O.O. concrete filled galvanized  
 iron pipe with a 3 in. dia. brass cap  
 stamped as shown:  
 10 ft below Rd. surface

From which:



Elm, 9.8", N77°E, 69.53 ft to a 1/6d nail in S. face  
 double blazed, scribed "58 BT" w/60d spike

Power pole, S40°E, 60.49 ft to a 1/6d nail driven  
 flush in NE face

Spruce, 16.0", S31°W, 33.52 ft to 1/6d nail in SE  
 face, base blazed, scribed "BT" w/60d spike

Aspen, 8.8", N37°W, 45.26 ft to a 1/6d nail in SW  
 face, double blazed, scribed "57 BT" w/60d spike

TREE BLAZES Painted CARD filled  
 See BK 3 P. 24  
 BT



25

T141NR25W  $\frac{1}{4}$  cor Sec 7 & 18  
Original Gov't Survey

Tam, 18", N47°E, 16.50 ft

Spruce, 20", S85°W, 17.82 ft

May 14, 1911 J. Curro & Crew

Found BT's but proportioned in the  
corner because their courses don't fit

Tam, 18", N25°E, 12.85 ft

Spruce, 20", S85°W, 12.00 ft

5-21-02 R MAIN

Found  $\frac{3}{4}$ " DIAMETER IRON PIN FLUSH WITH GROUND.  
LATH NEXT TO IRON WITH N $\frac{1}{4}$  SEC 18 WRITTEN  
ON SAME. FOUND 3 TIES R. PINE SPRUCE ASPEN  
WITH PK AND WASHER. WASHER HAS L513336 STAMPED.  
PIN IS  $\pm$  20 FT SOUTHEAST OF CURVE OF WOODSTRATH  
 $\pm$  30 YR OLD R. PINE PLANTATION NORTH EAST, YOUNG  
ASPEN IN ~~THE~~ QUADRANTS NW & SE. SPRUCE  
MIX IN SOUTHWEST QUADRANT. PIN IN INTERSECTION  
OF OLD ROAD BED NORTH AND WEST.

25

SPRUCE 9" S58°W 52.20 PK & WASHER

ASPEN 8" N54°W 35.48 PK & WASHER

R. PINE 7 $\frac{1}{2}$ " N66°E 23.55 PK & WASHER

26

T141N R25W Y4 Sec 8 & 17  
Original Gov't Survey

Tam., 8", S25°W, 13.20 ft

Tam., 7", N42°W, 9.24 ft

May 27, 1920 Curo

Find a 4" square post in center  
of Remer + Shovel Lake Rds.

June 5, 1920 Curo

Set an iron pin, 4 ft. long 2 in  
diameter drove in middle of  
Shovel Lake Rd.

1913 J.H. Flynn

Found both old Gov't BT's

Tam., 9", S16°W, 23.5 ft

Fir, 6", N17°W, 23.8 ft

June, 17, 1985

G. Kosenko

G. Robertson

Dug a 4 foot diameter by 3 foot  
deep hole at the intersection of the  
Shovel Lake and old Remer Roads. Could  
not find anything. We did find a


J-7

CARD Filed **CERTIFICATE FILED**

2 1/2 inch outside diameter iron pipe  
bent over and laying on the south  
shoulder of the road

July 2, 1985 G. Robertson R. Feltus (M.A.E.D.)

Set a 2 ft. long by 2 1/2 in. O.D. concrete  
filled galvanized iron pipe with a 3 in. dia  
brass cap stamped:  
Under road surface 1.0 ft  
Decl. 5° East.

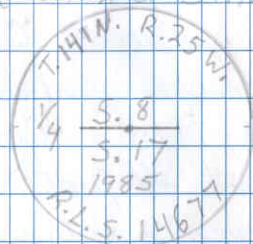

From which:

B. of G., 13.6", S16°E, 53.20 ft to a 1/6d nail in W face  
double blazed, scribed: "1/4 S17 BT" w/60d spike

Ash, 7.2", S 39°W, 72.34 ft to a 1/6d nail in SE face  
double blazed, scribed: "1/4 S17 BT" w/60d spike

Ash, 7.1", N 27°W, 91.68 ft to a 1/6d nail in SW face  
double blazed, scribed: "1/4 S17 BT" w/60d spike

All BT's painted red with red ring



27

J-9

T141N R25W Sec. Cor. 8, 9, 17, +16  
Original Gov't Survey

Fir, 10", N55°E, 15.18 ft  
Spruce, 6", S68°E, 6.60 ft  
Aspen, 14", S47°W, 18.48 ft  
Spruce, 6", N22°W, 16.50 ft

May 27, 1920 Curo

Find a point of post in T. Road

June 6, 1920 Curo

Find old post. Set a 2½ ft. long iron pipe with a cap marked S 8' 9" 16' 17" with 2 60d spikes in bottom with stone mound. Corner is in middle of Shovel Lake Rd

1913 JH Flynn

Found Original Trees

Fir, 10", N55°E, 15.18 ft  
Spruce, 6", S68°E, 6.60 ft  
Aspen, 16", S47°W, 13.20 ft (Down)

June 14, 1985 G. Kosenko G. Robertson

Found a 2½" outside diameter iron pipe sheared off and laying along the south side

27

CERTIFICATE FILED

of county road. There are old fence lines running north and south here. The pipe is J. Curo's 1920 work. I believe the fence lines were put in from this pipe. P.C. 6/14/85

June 17, 1985

R.S. - G. Kosenko

Asst. - G. Robertson

R.L.S. - K. Whitehorn

Dug hole in E Shovel Lake Rd @ intersection of fence line. N & S. Found 10-15 cables in concentrated area with rotted wood fiber and charcoal remains. No evidence of original post point. Hole was 3ft x 2ft by 4ft deep. No definite pinpoint could be established with the rock mound so set a 2½ in (OD) by 24 in long galv. IP with 3 in diameter brass tablet stamped to mark corner position at E Rd & Fence line N & S. top of monument is 19 ft below the grade of Shovel Lake Rd.



See page 75

28

T141N R25W 1/4 Sec J-11  
9+16

Original Gov't Survey

Fir, 8", N59°E, 18.48 ft

Elm, 10", S20°W, 11.22 ft

1913 J.H. Flynn

Found old Gov't BT's: Stub of Elm  
and part of (down) fir

W. Pine stump, 24", S22 1/2°W, 35.0 ft

June 18, 1984

G. Kosenko

G. Robertson

Found the 1913 W. Pine stump, measured  
off that stump to the E of county  
road. We dug a hole 2 foot diameter  
by 1 1/2 foot deep into the road but found  
no post. The road here has been cut considerably.  
We set point for this corner which falls  
in E of road from which:

Aspen, 12.5 in, N16°E, 69.80 ft to 1/2" nail in  
east face, double blaze, set "1/4 59 BT" w/60d spikeW. Oak, 12.4 in, S22°E, 33.95 ft to 1/2" nail in  
SW face, double blaze, set "1/4 51/6 BT" w/60d spikeP. Pine, 11.0 in, N16°W, 56.83 ft to 1/2" nail  
in SW face, double blaze, set "1/4 59 BT" w/60d spikeCERTIFICATE FILED <sup>28</sup>1913 W. Pine stump, S27°W, 35.00 ft  
to the front of stump w/60d spike

1940 R. Defiant

Found Post 12' high

w/ Pine Stump, 24" S45°W 34, 32'

Metal Location Poster on same Stump

July 2, 1985 G. Robertson R. Feltus (M.E.E.D.)

Set a 2 ft long by 2 1/2 in. O.D. concrete  
filled galvanized iron pipe with a 3 in.  
dia. brass cap stamped:

0.7 ft under road surface

BT's painted red with  
red ring



29 T141NR25W w<sup>1</sup>/<sub>4</sub> Sec 18  
Original Gov't Survey

W. Birch, 11" West 14.52 ft  
W. Birch, 6" S 10° E 13.20 ft (Birg. could be S 10° E)

1919 J. H. Flynn  
Found W. Birch stump S 10° E 201ks

B. Ash, 10" N 79° E 26.8 ft GONE

B. Ash, 10" N 81° W 25.0 ft GONE

SURVEY RECORD # 507-BOOK D-Pgs. 62-63

By J. H. FLYNN - JUNE 23-27-1919

Fd. ORIG. BT AT <sup>1</sup>/<sub>4</sub> COR.

MARKED NEW BT'S. RECORDED ABOVE

DISTANCE ON PLAT FROM SEC. COR. SOUTH TO <sup>1</sup>/<sub>4</sub> COR.

IS 2641.0'

5-16-02 R MAIN

Fd 8749 TAG SET BY DEFANT 1-240. TAG  
SHOT UP AND RUSTED ON 15" ASH. Fd NO  
EVIDENCE OF FLYNN BT'S. PLACE SPK IN 1940  
ASH ON NORTH SIDE OF TREE.

T141NR25W 1/4 Sec 18+17 L-5

Original Gov't Survey

Fir, 10", N30°E, 9.90 ft  
 Spruce, 15", North, 16.50 ft

June 6, 1920 Curo

Find post marked 1/4 S17 S18

Set iron pipe with a cap, 2 1/2 ft long  
 by 3" diameter with 2 60d spikes  
 in bottom

W. Pine, 16", N42°E, 38.0 ft ← 1913 County  
 Bearing Tree

June 5, 1985 Recovery by: G. Kasenko

B. Aust

G. Robertson

Found a 3 inch diameter  
 iron cap all bent up from  
 road graders in county road  
 #133. The cap was unreadable  
 From which:

W. Pine decayed stump, N42°E, 38.0 ft


## CERTIFICATE FILED

We tied off this corner with the  
 following trees:

Aspen, 5", S65°E, 48.21 ft.  
 W. Spruce, 10", N76°E, 62.62 ft.

July 1, 1985 G. Robertson B. Aust

Removed old iron and set a 2 ft long  
 by 2 1/2 in. O.D. concrete filled galvanized  
 iron pipe with a 3 in. dia. brass cap  
 stamped as shown:

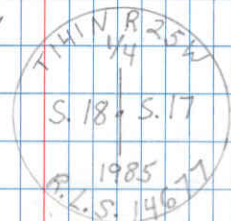

Under road surface 1.0'

Decl. 5° East

From which:

W. Spruce, 10", N76°E, 62.62 FT to a 1/6d nail  
 in N face, double blazed, scribed "1/4 S17 BT" w/60d spike  
 Aspen, 5", S65°E, 48.21 FT to a 1/6d nail in S  
 face, double blazed, scribed "1/4 S17 BT" w/60d spike  
 BT's painted red with BT tag

4-3-97 R MAIN

Ed MONUMENT IN GOOD CONDITION 1985 B.T.S ARE SNAGS

NEW WITNESSES AS FOLLOWS

ASPEN 7" S75E 48.95 FT TO SPK MKD S17 BT  
 8 FT STEEL SIGN POST N60°E 45.35 TO FACE OF POST



31

T14N R25W E 1/4 Sec 13  
Original Gov't Survey

Birch, 9", N70°W, 23.10 ft  
S. Maple, 7", S55°W, 18.48 ft

31

T141N R25W Sec Cor 18, 19, 13, & 24  
Original Gov't Survey

Tam , 14" , S13°E , 75.90ft

Tam , 16" , N48½°E 118.80ft



T141NR25W 1/4 Sec 18+19  
Original Gov't Survey

Tom. , 8" , S36°E , 10.56ft

Spruce , 8" , N84°W , 25.08ft

34 T141N R25W Sec Cor 17, 18, 19, 20  
Original Gov't Survey

Spruce, 8" N24°E, 3.30 ft  
Tamu, 10" S30°E, 17.82 ft  
Cedar, 10" S25°W, 28.38 ft  
Tamu, 6" N18°W, 9.24 ft

May 29, 1920 Curo

Found:

Cedar, 6" S61°W, 26.8 ft

June 4, 1920 Curo

Set iron pipe 2 1/2 ft long by 3 in.  
diameter with a cap stamped  
S 17 18 19 20 with 2 60d spikes  
in bottom of pipe

1920 Ben Clark

Found:

Old Tam, S. B. T.

Cedar, 6" S61°13'W, 26.8 ft

Set 3x30" L.M. in side of  
field on W. side of Ditch 12 ft  
from bridge

CERTIFICATE FILED

34

12/22/93

SHELLACK ENG. AND SURVEYING  
SET 2 1/2" X 24" LONG IRON PIPE WITH BRASS  
CAP MARKED T141N R25W

14" BELOW FR # 2302C

S18 | S17  
S19 | S20

1993

WITNESSED BY RLS NO 15572

POPLAR 7" N76W 110.80' SCRIBED S18 BT <sup>NOW</sup> WENDON


POPLAR 6" N38E 99.67' " S17 BT

POWER POLE S30W 135.28' TAG

PUNCH MARK ON SOUTH END OF 48" CULVERT  
S40E - 17.28'

PUNCH MARK ON NORTH END OF 48" CULVERT  
N32E - 19.87'

CERTIFICATE # 355094

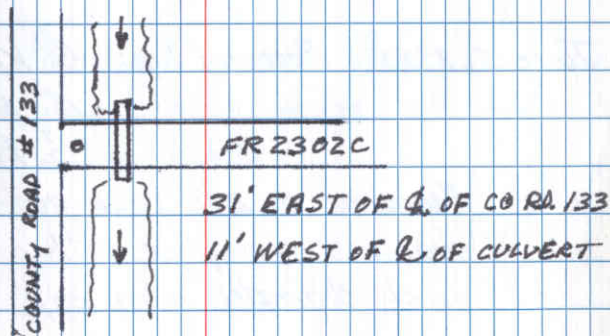



35

N-7

T141N R25W  $\frac{1}{4}$  Sec 17+20  
Original Gov't Survey

Spruce, 10", S24°E, 9.90 ft

Aspen, 22", N05°E, 20.46 ft

May 29, 1920 Curo

Find:

Birch stp, 12", S32°W, 21.1 ft

Set new hub

June 4, 1920 Curo

Find 2' x 4" square post marked  $\frac{1}{4}$  S

Set new iron pipe 2½ ft long by  
3 in. diameter with a cap marked  
 $\frac{1}{4}$  S with 2 60d spikes and  
mound of stone

June 5, 1985 Recovery by: G. Kosenko

B. Ausk


G. Robertson

Recovered a 2½ inch outside  
diameter iron pipe with a 3  
inch diameter iron cap

CERTIFICATE FILED

35

Stamped as shown,  
3 inches below road  
surface

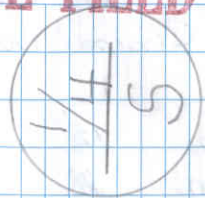

Searched for but could find no  
other BT's, either the OGS  
or the Birch Stp.

July 1, 1985 New BT's G. Robertson  
B. Ausk

Elm, 9.5", S45°E, 15.92 ft to a 16d nail in NE  
face, double blazed, scribed " $\frac{1}{4}$  S20 BT" w/60d spike

Birch, 7.0", S45°W, 24.63 ft to a 16d nail in NW  
face, double blazed, scribed " $\frac{1}{4}$  S20 BT" w/60d spike

Birch, 11.3", N57°W, 57.58 ft to a 16d nail in NE  
face, double blazed, scribed " $\frac{1}{4}$  S17 BT" w/60d spike

All trees Painted with Rings

CORNER is on South Edge of old  
Road Bed No Posts

T141N R25W 1/4 Sec 16 &amp; 21

Original Gov't Survey

Tam. 15" S46°W, 5.28 ft

Tam. 18" North, 9.90 ft

~~1917 Cass County Road Survey~~~~Found Gov't Corner and established  
new witnesses:~~~~Cedar Post, 5" S37°E, 51'~~~~Cedar Post, 5" S52°W, 51'~~~~Cedar Post, 5" N43½°W, 48'5"~~~~Corner 5" N28°30'W, 40.6'~~~~This entry should have been for~~~~T143N R26W. See Cass Co.~~~~Book #C pg 42 & 43. M. H. [unclear]~~



T141N R25W Sec Cor 13, 24, 18, & 19  
Original Gov't Survey

Tam. 18" N47°W 19.80 ft

Tam. 10" S23°W 15.84 ft

T141N R25W W $\frac{1}{4}$  Sec 19  
Original Gov't Survey

Tam. 4" West 9.90 ft

Tam. 4" S80°E 5.28 ft



T141N R25W  $\frac{1}{4}$  Sec 19+20  
Original Gov't Survey

Spruce Pine, 10", S37°W, 15.18 ft

Fir, 10", N36°E 16.50 ft

June 6, 1920 Clark Rose

No monument found

Find:

W. Pine stp, BT, 14", N28°W, 74.5 ft

W BIRCH STP 8" S4745E 6'  $\frac{1}{4}$  BT

1962 DNR Engineering

Set railroad spike

T141N R25W E $\frac{1}{4}$  Sec 24

Original Gov't Survey

Tow. , 9" , N25°W, 8.58 ft

Tow. , 12" , S33°W, 15.84 ft



T141N R25W Sec. Cor. 19, 30, 24, & 25  
Original Gov't Survey

Tom. 12" N84°E, 14.52 ft

Tom. 8" N05°W, 13.20 ft

Tom. 12" S59½°E, 9.24 ft

Tom. 5" S27°W, 13.20 ft

7-22-02 R MAIN

FD 1½" PIPE UP 1.3 FT IN ASPEN WILLOW  
ASH AND GRASSY LOWLAND. CORNER IS IN LINE  
WITH E OF OLD RD ON TWP LINE RUNNING NORTH.  
CORNER ALSO ± 120 FT WEST OF OLD FIELD EDGE.

FD WHITHOFT TAG ON FENCE CORNER LAYING DOWN  
EAST OF PIPE. ALSO FD TAG GROWING OVER BY  
A 14" ASPEN N10W 7.0 FT FROM CORNER. PLACE  
SPIKE FOR DIST AND NEW FSLP ON SAME.

2-20-1974 L. WITHHOFT

RECORDED ON CORNER CARD. LEO FD 1" GALVANIZED  
PIPE 16" ABOVE GROUND NO CAP. PLACED FSLP ON  
FENCE POST FROM WHICH CORNER BEARS 130 IKS WEST.  
CORNER 105 IKS EAST OF TWP ROAD. CARD STATES  
"SIG MEYERS TOLD ME HE WAS WITH COUNTY  
SURVEYOR WHEN CORNER WAS PUT IN." LEO ALSO  
PLACED A LP ON POST ON EAST SIDE OF ROAD FROM  
WHICH CORNER BEARS EAST 105 IKS. FENCE RUNS  
EAST AND NORTH FROM FENCE POST EAST OF CORNER.


42

T141N R25W · 1/4 Sec 19 & 30

Original Gov't Survey

Ash, 10", S45°W, 61.38 ft

42

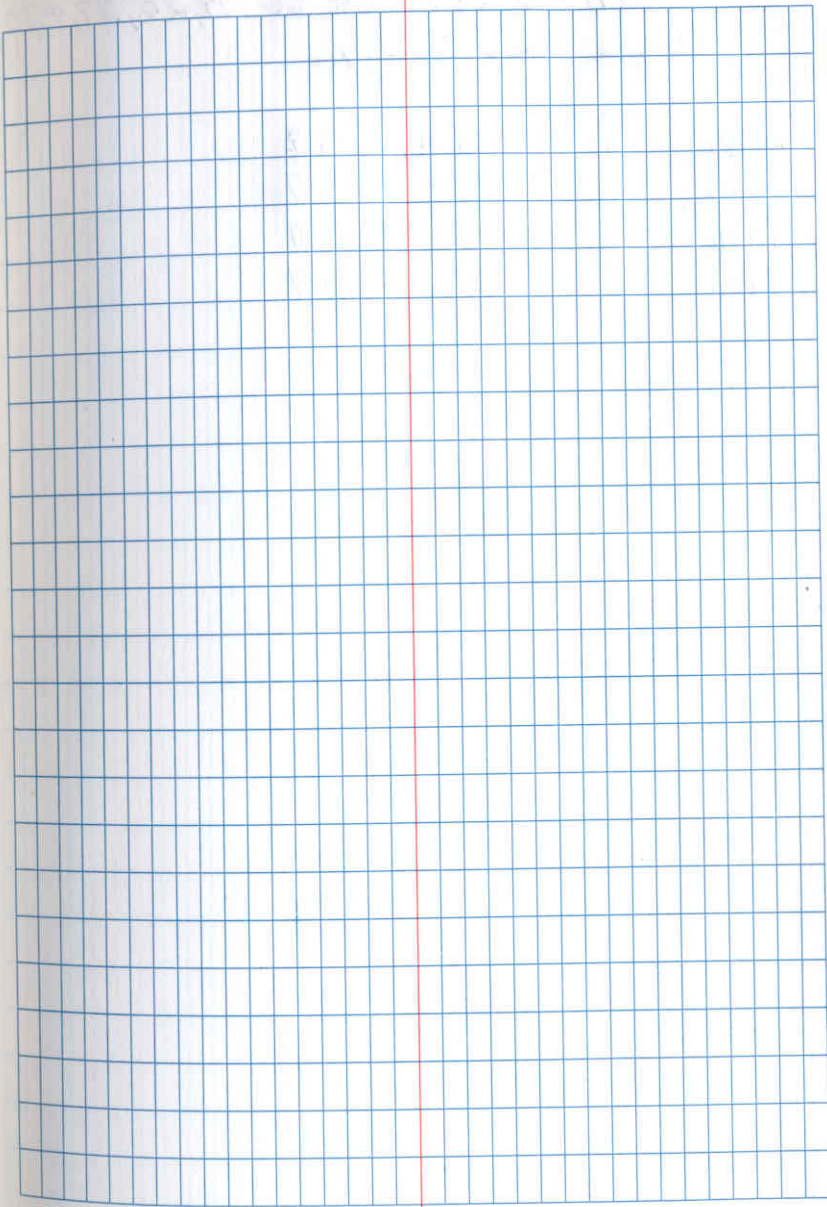



T141N R25W Sec Cor 19, 20, 29, &amp; 30

Original Gov't Survey

Tam. , 8" , N45°W, 5.28 ft

Tam. , 8" , S24°E, 10.56 ft

Tam. , 6" , N03°E, 8.58 ft

Fin. , 8" , S20°W, 18.48 ft

44 T141N R25W 1/4 Sec 20+29

Original Gov't Survey

Fir 3" S10°E 3.30 ft

Birch 10" N20°W 15.84 ft

45

T141N R25W Sec Cor 24, 25, 19, 430  
Original Gov't Survey

Birch, 6", N38°W, 15.18 ft

Ash, 8", S87°W, 13.20 ft

45



46

T141N R25W W $\frac{1}{4}$  Sec 30

Original Gov't Survey

Basswood, 9" S 80° W, 11.88 ft

Basswood, 4" S 40° E, 7.92 ft

1921 E. B. Hurst

Found

Basswood, 16" S 40° E, 7.92 ft

7-18-02 RMAIN

RECORDED IN BOOK #1 Pg<sup>#</sup> 75 T141 R26

46

47

T141NR25W 1/4 Sec 29+30

Original Gov't Survey

R. Cedar, 12" , West, 2.64 ft

W. Cedar, 10" , S80°E, 9.24 ft

47

T141N R25W E $\frac{1}{4}$  Sec 25

Original Gov't Survey

Birch, 12" N18°W, 15.18 ft

Spruce, 6" S55°W, 19.14 ft



T141N R25W Sec. Cor. 30, 31, 25, & 36  
Original Gov't Survey

Aspen, 10"  $N\frac{1}{2}^{\circ}E$ , 9.57 ft.

1921 J. H. Flynn

Set  $2\frac{1}{2} \times 30$ " I.M. proportionately  
in about center of Ditch Bank


50

T141N R25W Y4 Sec. 30 + 31

Original Gait Survey

No trees

50

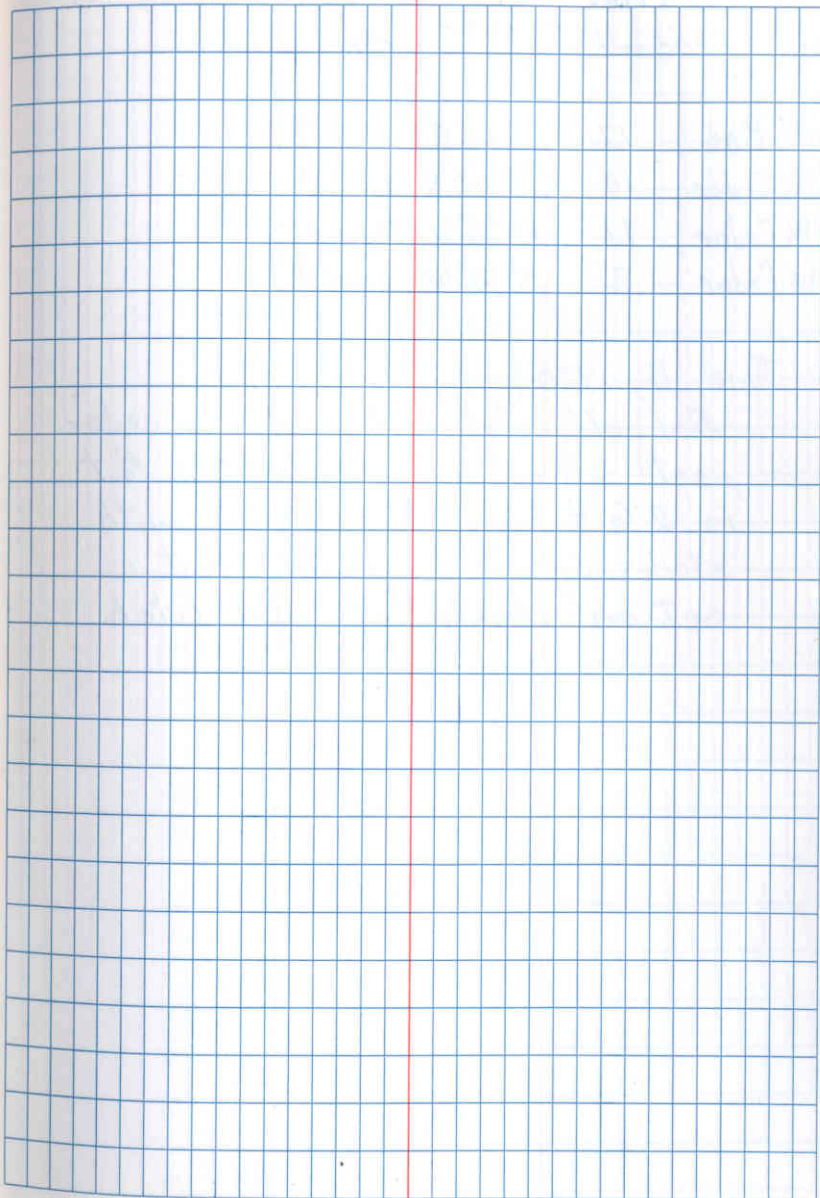

T14N R25W Sec Cor 29, 32, 30, #31

Original Gov't Survey

W. Pine, 12", S 12° E, 6.60 ft

W. Cedar, 10", N 74½° E, 16.50 ft

W. Cedar, 12", N 53° W, 10.56 ft

W. Cedar, 8", S 79° W, 6.60 ft

June 11, 1920

Find old cedar post, set new cedar post scribed "S 29-30-31-32". Post is 2½ ft long set in a hole with stones around the post. Post is set on "illegable word" of a ditch.



52

T14N R25W  $\frac{1}{4}$  Sec 29 + 32  
Original Gov't Survey

Alder, 4", S10°W, 39.60 ft

52

53

T141N R25W Sec Cor 25, 36, 30 &amp; 31

Original Exit Survey

Tarn, 3", N41°W, 28.38 ft

Spruce, 3", S80°W, 16.50 ft

53

54

T141N R25W W $\frac{1}{4}$  Sec 31  
Original Gov't Survey

Tam., 4", S08°W, 6.77 ft

1921 J. H. Flynn

Set 1 $\frac{1}{2}$  x 40" I.M. proportionally

April 12, 1978

Remains of 1921 survey

Set a 2" by 60" galvanized  
steel pipe with brass cap

B. Spruce, 6", S86°E, 47.00 ft

Tam, 5", N35°W, 49.40 ft

Tam, 5", N83°W, 72.90 ft

8' sign post, North, 2.20 ft w/54-2+54-4

8' sign post, West, 2.20 ft w/54-2+54-4

54



T141NB25W  $\frac{1}{4}$  Sec 31 + 32

Original Gov't Survey

Aspen, 4", East, 2.64 ft

Birch, 6", West, 13.20 ft

6-11-20

Fd OLD POST MKD S31 32, Fd TAM 3" NORTH  
106 LKS DOWN, TAM 3 N45E 18 LKS DOWN "BT".  
SET 4' X 6" TAM POST MKD S31 S32

56

T141N R25W E 1/4 Sec 36

Original Gov't Survey

Spruce, 3" , N52°W, 36.30 ft

Spruce, 3" , S30°W, 85.80 ft

56

T14N R25W SW Sec Cor 31

Original Gov't Survey

Cedar, 5", N15°E, 25.08 ft

Cedar, 5", N68°W, 7.26 ft

1921 J.H. Flynn

Found

Cedar, 10", N68°W, 7.26 ft

Cedar stump, 12", N15°E, 25.08 ft

New BT's

W. Birch, 8", N45°W, 30.6 ft

Spruce, 12", N48°E, 25.4 ft

See 14426 Book 1, Page 67



T141N R25W S 1/4 Sec 31  
Original Gov't Survey

Fir, 6", N05°E, 25.74 ft  
Maple, 7", N40°W, 26.40 ft

T141N R25W S<sup>1</sup>/<sub>4</sub> Sec 32

Original Gov't Survey

Fir, ? N75°E, 19.80 ft

Birch, ? N10°W, 13.20 ft

T141N R25W Sec Cor 32, 33, 5, & 4  
Original Gov't Survey

Tam. , 6" , N07°W, 9.90 ft

Tam. , 6" , N37°E, 20.46 ft



61

T141N R25W S 1/4 Sec 33  
Original Gov't Survey

Fir, 4", N60°E, 10.56 ft  
Maple, 8", N35°W, 13.20 ft

61

T141N R25W S 1/4 Sec 35  
Original Gov't Survey

Pine , 9" , N80°E , 7.26 ft

Fir , 4" , N25°W , 7.92 ft

63

T141N R25W Sec Cor 35, 36, 1, &amp; 2

Original Gov't Survey

W. Cedar, 5", N50°W, 3.96 ft

W. Cedar, 9", N25°E, 26.40 ft

63



64 T14N R26W S1/4 Sec 36

Original Gov't Survey

Tam. , 8" , N90°W , 15.18 ft

Fir. , 8" , N40°W , 5.94 ft

T141N R25W SE Sec Cor 36  
Original Gov't Survey

See BK 2, PP 73

T14N R25W C4 S 17

May 31, 1920 Curo

Set a 2½ ft. long iron pipe with  
a cap stamped C4 S 17

Cedar, 6", N42°W, 11.08

1940 R. DeLant

Found Iron Pipe Co. No Bt's

Metal Location PASTER on

<sup>DEAD</sup>  
TAMARAC 3" South 198.33

TAG on South Side of TREE



T141N R25W EY16 S17+20

May 29, 1920 Curo

Set Tam. post

Elm, 12", N29°E, 34.8 ft

Elm, 8", S25°W, 24.0 ft

T141N R25W CW  $\frac{1}{16}$  Sec 17

May 31, 1920 Curo  
Iron pin 2 ft long

CERTIFICATE FILED

T141N R25W E $\frac{1}{16}$  8-17

June 3, 1920 J. Curo

Set iron pin 2 ft long by 1 in. dia.  
drove in the middle of shovel Lk. Rd.

CERTIFICATE FILED

FOREST SERVICE CONTRACT  
R.L.S. LOWELL SCHELLACK  
JAN. 1994



T141N R25W CN 1/16 Sec 17

June 3, 1920 J. Curo

Set an iron pin 2 ft long by 2 in.  
dia. drove 1 ft in ground

CERTIFICATE FILED

71

T141 N R25W NE 1/16 Sec 17

June 3, 1920 J. Curo

Set an iron rod 5 ft long by  
1 in. dia. drove into ground  
4 ft.

**CERTIFICATE FILED**

71

T141N R25W CE 1/16 Sec 17

May 31, 1920 J. Curo

Set an iron rod 5 ft long by  
2 in. dia.

**CERTIFICATE FILED**



T141N R26W SE Sec 36

Original Gov't Survey

Set post

Cedar, 8", S50°E, 161ks

Tam, 10", N12½°W, 231ks

Tam, 10", N58°E, 221ks

Tam, 12", S52°W, 211ks

1921 J.H. Flynn

April 12, 1978 M.E. Stefan

remains of 1921 survey

set a 2"x60" galvanized steel  
pipe with brass cap

Cedar, 13", N46°W, 82.85 ft

Cedar, 17", N21°W, 96.50 ft

W. Pine, 21", N85°E, 85.30 ft

8' sign post, North, 2.30 ft w/54-2454-4

8' sign post, East, 2.50 ft w/54-2454-4

Should be SE sec. 36  
T141N R26W

141-26 Book 1

Page 67

M.E. Stefan

~~Sec BK 2, PP 65~~

74

TIMIN R25W SEC 17  
SW 1/4

1940 R. DEFRANT

Found wooden post

Balsam 3" West 51ks

Metal location marker on

Fence Post 10" AT CORNER

74

T141N R25W 8, 9, 16, 17

Cont'd from pg 27

From which:

Ash 8.6 in N27°E 77.59 ft to 16d nail in  
west face, double blaze, scri: "59 BT" w/60d spikeAspen 10.6 in S22°E 85.97 ft to 16d nail in  
NE face, double blaze, scri: "516 BT" w/60d spikeRed Maple 11.0 in S75°W 84.83 ft to 16d nail in  
north face, double blaze, scri: "517 BT" w/60d spikePower Pole 8 in N04°W 38.17 ft to a 16d nail  
flush w/west face, no scribing or spike

1936 G. TYNES

Found Capped Pipe Cap Broken

2" Below Road

Metal Location Post on

Fence Post 6" South 17.82'

TAG on South side of Post




76 T144N R25W 1/4 Sec 16 & 17

Cont'd from BK1 Pg 57

July 2, 1985 G. Robertson R. Feltus

Pulled old pipe and set a 2 ft long  
by 2 1/2 in. O.D. concrete filled monument  
with a 3 in. dia. brass cap stamped  
as shown

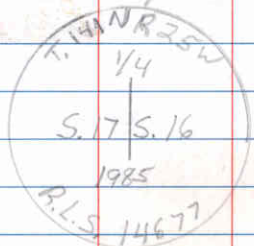

Decl. 5° East

0.8 ft below surface

S. 17 | S. 16

1985

P.L.S. 14677

From which:

Aspen, 11.6", N 48° E, 57.84 ft to a 16d nail in the  
E. face, double blazed, scribed "1/4 S 16 BT" w/60d spike

Aspen, 7.9", S 81° E, 84.6 ft to a 16d nail in the S  
face, double blazed, scribed "1/4 S 16 BT" w/60d spike

Aspen, 6.5", S 11° W, 21.38 ft to a 16d nail in the E  
face, double blazed, scribed "1/4 S 17 BT" w/60d spike

All BT's painted red with red ring

Corner is in Powerline Right of Way so buried  
monument to prevent it from being  
disrupted

CERTIFICATE FILED

76

T141N R25W

1145 15 + 16

From which:

Metal fence post, S83°E, 10.61 ft

Metal fence post, S55°W, 10.89 ft

Metal fence post, N30°W, 15.91 ft

All fence posts are painted red, tagged, and measured to their face




78

T141N R25W 1/4 cor. Sec. 21+22

July 25, 1985 G. Robertson, B. Ausk, G. Kosanko

Set a 2 ft. long by <sup>2.8</sup>~~2.6~~ in. O.D. aluminum monument with a <sup>3.0</sup>~~2.6~~ in. aluminum cap stamped as shown:

Monument is 0.6 ft below the surface in an old wheel rut.

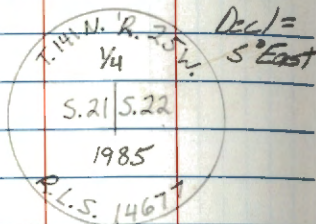

From which:

Power pole, 9.4 in, N68°E, 40.67 ft to a 1/2" nail in NW face pounded all the way in, no scribing

Tamarack 1.8 in S50°E 97.13 ft to a 1/2" nail  
 NOW 8" x 6 FT TALL (CUT OFF BY POWER LINE COMPANY)  
 in north face, double blaze, scr: 1/4 522 BT w/rod spike

Ash 4.0 in, N76°W, 50.52 ft to a 1/2" nail  
 NOW 8" in south face, double blaze, scr: " x BT" w/rod spike

All trees are painted red and tagged w/a BT tag. The Power Pole has no tag

07-28-2009 R. MAIN

FD IRON IN PLACE AND GPS.

CERTIFICATE FILED 78

See BK pg 39