

T142N R30W
CORNER RESTORATION

R
FIELD BOOK

820012

BOOK 3


T142N R30W

BOOK 3



DISTANCES FROM SIDE STAKES FOR CROSS-SECTIONING

Roadway of any Width. Side Slopes 1½ to 1.

In the figure below: opposite 7 under "Cut or Fill" and under .3 read 11.0, the distance out from the side stake at left. Also, opposite 11 under "Cut or Fill" and under .1 read 16.7, the distance out from the side stake at right.

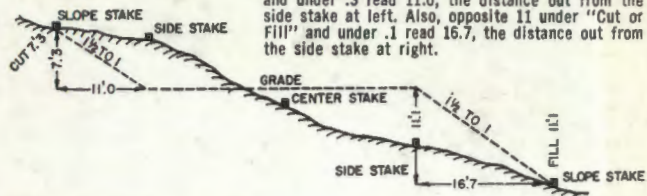

Cut or Fill	Distance out from Side or Shoulder Stake										Cut or Fill
	0	.1	.2	.3	.4	.5	.6	.7	.8	.9	
0	0.0	0.2	0.3	0.5	0.6	0.8	0.9	1.1	1.2	1.4	0
1	1.5	1.7	1.8	2.0	2.1	2.3	2.4	2.6	2.7	2.9	1
2	3.0	3.2	3.3	3.5	3.6	3.8	3.9	4.1	4.2	4.4	2
3	4.5	4.7	4.8	5.0	5.1	5.3	5.4	5.6	5.7	5.9	3
4	6.0	6.2	6.3	6.5	6.6	6.8	6.9	7.1	7.2	7.4	4
5	7.5	7.7	7.8	8.0	8.1	8.3	8.4	8.6	8.7	8.9	5
6	9.0	9.2	9.3	9.5	9.6	9.8	9.9	10.1	10.2	10.4	6
7	10.5	10.7	10.8	11.0	11.1	11.3	11.4	11.6	11.7	11.9	7
8	12.0	12.2	12.3	12.5	12.6	12.8	12.9	13.1	13.2	13.4	8
9	13.5	13.7	13.8	14.0	14.1	14.3	14.4	14.6	14.7	14.9	9
10	15.0	15.2	15.3	15.5	15.6	15.8	15.9	16.1	16.2	16.4	10
11	16.5	16.7	16.8	17.0	17.1	17.3	17.4	17.6	17.7	17.9	11
12	18.0	18.2	18.3	18.5	18.6	18.8	18.9	19.1	19.2	19.4	12
13	19.5	19.7	19.8	20.0	20.1	20.3	20.4	20.6	20.7	20.9	13
14	21.0	21.2	21.3	21.5	21.6	21.8	21.9	22.1	22.2	22.4	14
15	22.5	22.7	22.8	23.0	23.1	23.3	23.4	23.6	23.7	23.9	15
16	24.0	24.2	24.3	24.5	24.6	24.8	24.9	25.1	25.2	25.4	16
17	25.5	25.7	25.8	26.0	26.1	26.3	26.4	26.6	26.7	26.9	17
18	27.0	27.2	27.3	27.5	27.6	27.8	27.9	28.1	28.2	28.4	18
19	28.5	28.7	28.8	29.0	29.1	29.3	29.4	29.6	29.7	29.9	19
20	30.0	30.2	30.3	30.5	30.6	30.8	30.9	31.1	31.2	31.4	20
21	31.5	31.7	31.8	32.0	32.1	32.3	32.4	32.6	32.7	32.9	21
22	33.0	33.2	33.3	33.5	33.6	33.8	33.9	34.1	34.2	34.4	22
23	34.5	34.7	34.8	35.0	35.1	35.3	35.4	35.6	35.7	35.9	23
24	36.0	36.2	36.3	36.5	36.6	36.8	36.9	37.1	37.2	37.4	24
25	37.5	37.7	37.8	38.0	38.1	38.3	38.4	38.6	38.7	38.9	25
26	39.0	39.2	39.3	39.5	39.6	39.8	39.9	40.1	40.2	40.4	26
27	40.5	40.7	40.8	41.0	41.1	41.3	41.4	41.6	41.7	41.9	27
28	42.0	42.2	42.3	42.5	42.6	42.8	42.9	43.1	43.2	43.4	28
29	43.5	43.7	43.8	44.0	44.1	44.3	44.4	44.6	44.7	44.9	29
30	45.0	45.2	45.3	45.5	45.6	45.8	45.9	46.1	46.2	46.4	30
31	46.5	46.7	46.8	47.0	47.1	47.3	47.4	47.6	47.7	47.9	31
32	48.0	48.2	48.3	48.5	48.6	48.8	48.9	49.1	49.2	49.4	32
33	49.5	49.7	49.8	50.0	50.1	50.3	50.4	50.6	50.7	50.9	33
34	51.0	51.2	51.3	51.5	51.6	51.8	51.9	52.1	52.2	52.4	34
35	52.5	52.7	52.8	53.0	53.1	53.3	53.4	53.6	53.7	53.9	35
36	54.0	54.2	54.3	54.5	54.6	54.8	54.9	55.1	55.2	55.4	36
37	55.5	55.7	55.8	56.0	56.1	56.3	56.4	56.6	56.7	56.9	37
38	57.0	57.2	57.3	57.5	57.6	57.8	57.9	58.1	58.2	58.4	38
39	58.5	58.7	58.8	59.0	59.1	59.3	59.4	59.6	59.7	59.9	39
40	60.0	60.2	60.3	60.5	60.6	60.8	60.9	61.1	61.2	61.4	40

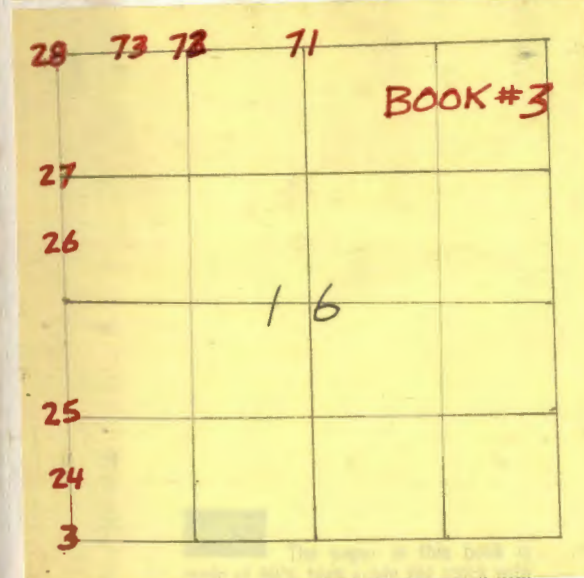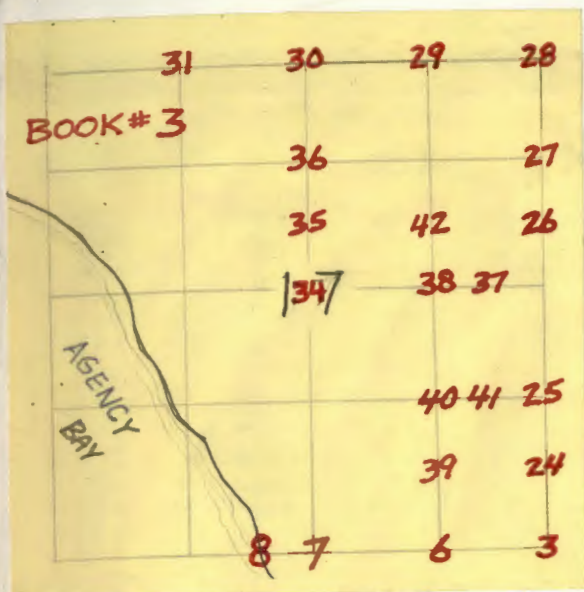

a WATER RESISTING surface sizing.

KEUFFEL & ESSER CO.

USFS, GASS COUNTY, M.W.

T. 142

Pg. 30

	8	5	4	
63 60 59 58 57				76
		8		97776
			79	73
	50 3234 33	51 30	71 20377	71
	4546	38 35	27	
18	47	37	42 337	25
		43	404125	
		57	37 24	3
		14	6	3
			2	
19	23	13	1	21
	16	2015		
	22	11	M ₁₀	
	5110	44718		
		4		
30		29	28	
31		32	33	

BOOK #3 of 6

Mer.

	2	1	
0	11	12	
15	14	13	
22	23	24	
27	26	25	
34	35	36	

Tom Merrill

1/4 Cor. Secs 20-21

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

S20 | S21

1918

Poplar 8" S87³/₄° E 173 lks - 114.18'

0-9

North N/16 Cor. Secs 20-21

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

N 1/16
S20 | S21
1918

Oak 6" S76°E 22 1ks - 14.52'

NOW 12 OAK S76E 19.1'

Birch 6" N40½°W 27 1ks - 17.82'

NOW 11 BIRCH STUMP N40W 14.0'

SEE RESTORATION CERTIFICATE BY
MEYER 1/21/64 - NOT ABLE TO
LOCATE FIELD NOTES, 4/19/78 MES

INFORMATION FROM CERTIFICATE

1/21/64

Ed. GLO 1" IRON-IN-PLACE

MARKED NEW BT'S.

OAK 12 S76E 19.1 RESURVED BT

OAK 9 N19W 45.45 MKD N/16 S20 BT

72" STEEL POST NORTH 3.75' BOTH SIGNS

N-9

Sec. Cor. Secs. 16-17-20-21

G.L.O. Resurvey notes of 1918

Iron post 3' long 2" diam with brass cap marked

1/23/90 GK, GB T142N R30W

Found GLO 2" iron S 17 S 16

with brass cap set S 20 S 21

8" below swamp. Found 1918

old 4x4 ^{post} ANE at 2.0' from corner with old tag.

Pits 18x18x12 ins. in each Sec. 5 1/2' dist.

post stands 1' above swamp.

1/24/90 GK, GB

PLACE 2 HEAVY DUTY 8' STEEL SIGN POSTS - 1 ON EAST

1 ON WEST SIDES OF 2" GLO MONUMENT - WIRED

TOGETHER - WITH CAP NOW 8" ABOVE SWAMP

POSTS IN VERY SOLID GROUND - (WILL NOT SINK)

FOR TIES

8' STEEL SIGN POST 40" HIGH NORTH 4.15'

" " " " EAST 4.05'

" " " " SOUTH 4.20'

" " " " WEST 4.05'

250' EAST TO HIGHLAND RIDGE NE + SW

3

C.C. Done 1990

1/23/90 Ran south 1° west from S 1/6 1295'.
Distance measured with string machine checked
good.

Center South 1/16 Cor. Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

S 1/16 S 20

C
1918

Poplar 6" N 20° E 13 1/2 S - 8.58'

Poplar 6" N 47 1/2° W 25 1/2 S - 16.50'

Meander Cor. Secs. 19-20

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked

MC	
S 19	S 20
T 142 N	R 30 W
1917	

Mound of stone 2' base 1 1/2' high west of
Cor, 3' dist.

N-8

East 1/16 Cor. of Sec 17-20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap

marked 10/31/89 CK, MEH, GB E 1/16 S 17

Fd. 60 iron pipe under ice S 20

but standing upright. 1918

Oak 7" S84 1/2° W 357 IKS - 235.62'

Fd.

Oak 10" N69° W 255 IKS - 168.30'

Fd.

1/24/90 CK, GB

Placed 8' steel sign posts as reference objects

North

WEST

East?

} Proper signs attached

L.T.S. goes north + west

CC Done 1992

65

10/31/89 Chained south from A.P. 3 & A.P. 4.

Distance checked good to iron.

Corner falls in a wet area. High grd. is NW.

N-7

1/4 Cot. Secs. 17-20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked $\frac{1}{4}$ S17Monument falls in cut of $\frac{1}{4}$ S20
roadway - no evidence 1918Pine 13" N73 $\frac{1}{2}$ ° E 148 IKS - 97.68' - record by
New rotted pine st. scribe marks T \pm 3 left of B.

Elm 8" S0°45'W 118 IKS - 77.88'

New 26" Elm at record brg $\frac{1}{4}$ S20

W. W. 10/12/70

To perpetuate this corner I set a 5 $\frac{1}{2}$ " x 5 $\frac{1}{2}$ "
x 60" concrete monument, 18" above ground,
and capped with a 3" dia brass tablet stamped.

T142N R30W

 $\frac{1}{4}$ S17
S20

1970

RLS NO 6807

Witnessed by

11" Elm S88° E 113.7 ft. scribed $\frac{1}{4}$ S20 Bt.6" Oak S60° E 106.7 ft. scribed $\frac{1}{4}$ S20 Bt.26" Elm S2° E 77.4 ft. scribed $\frac{1}{4}$ S20 Bt.

6" x 6" x 96" Cedar post due East 2.5' with F.S.

signs 54-2 & 54-4 attached.

10-13-70

Curt Krause

Line to Standard runs east from corner in 1990. Corner
found in place as described in 1970

N-7

At FF. obvit
3/11/74

C.K.

76

- 1 N-6,7
 1 Meander Cor. Secs. 17-20 (East shore of Agency Bay)
 6 G.L.O. Resurvey notes at 1918
 1 Iron post 3' long 1" diam with brass cap marked
 12 Found iron post 2' down T142N R30W
 M badly bent - location ok MC | S17
 12 Straightened and replaced | S20
 in exact position 1918

1 Mound of stone 2 1/2' base, 1 1/2' high, east of
 E Cor. - No evidence

who
 10/12/70

1 Placed a 4" x 4" x 72" Cedar post due East
 1.3 ft. with F.S. signs 54.2 & 54.4 attached
 X 10-13-70
 12 Arthur R. Kiame

Affidavit
 3/15/71
 CRB

1
 1
 1
 2
 6
 5
 Lin
 for

Q, R-7

Angle Point 2 of Allotment 1643 Sec. 20

G.I.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

AP 2

TR

1643

1918

7150-4 by Tausch, 9/29/68

South $1/16$ Cor. Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

S $1/16$ | S 20
C
1918

N. Pine 7" N $16^{\circ}45'E$ 123 lks - 81.18'

J. Pine 9" N $13\frac{1}{2}^{\circ}W$ 186 lks - 122.76'

Angle Point B of Allotment 1300, Angle Point 1
of Allotment 1304 and Angle Point 2 of Allotment
1727, Sec 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

APB

TR

1300

AP1 AP2

TR TR

1304 1727

1918

Center $\frac{1}{4}$ Cor. Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

City S20

1918

Pits, 18 x 18 x 12", N. & S. of Cor. 3' dist.

Special Meander Coy. on the west shore of Rice
Lake and on the West half of Allotment 1300,
Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SNC	
API	
TR	TR
1305	1300
1918	

Special Meander Cor. Sec. 20 (N. shore of Rice Lake)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

C
S20 | S20
—
C


SMC

1918

Special Meander Cor. Sec. 20 (W. shore of Rice Lake)

G.L.O. Resurvey notes of 1918


Iron post 3' long 1" diam. with brass cap
marked

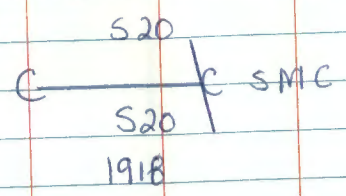

Special Meander Cor. of Sec. 20 (E. shore Agency Bay)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

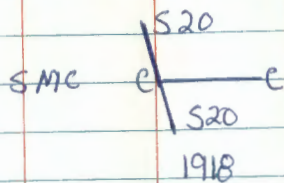

Elm 6" N30°E 147 lks - 97.02'

B. Oak 6" S11½°E 93 lks - 61.38'

Angle Point #1 of Attachment 1643, Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

AP 1

TR

1643

1918

Q-8

SE 1/16 Cor. Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SE 1/16 S 20

1918

N. Pine 6" N85 $\frac{1}{2}$ °W 58 1/3 - 38.28'

J. Pine 5" S26°E 29 1/3 - 19.14'

5680-11 by Touch 4/67

P, Q-8

Angle Point 1 of Allotment 1727, Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

AP 1

TR

1727

1918

5680-11 by Trench 4/67

19 #8

Special Meander Cor. Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

E
S 20 | S 20
E

SMC

1918

Witness Cor. to the Special Meander Cor., Sec. 20

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

S 20
WC S — S
SM C S 20
1918

N. Pine 9" S57 $\frac{3}{4}$ °E 11 1/2 KS - 7.26'

J. Pine 5" N8 $\frac{1}{2}$ °E 58 1/2 KS - 38.28'

Special Meander Cot. Sec 20 (E. shore Agency Bay)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam with brass cap marked

SMC / TR 1300
TR 1304
1918

Special Meander Cor. of Sec. 20 (E. Shore Agency Bay)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SMC / S 20
TR 1305
1918

M, N-9

Angle Point 1 of Allotment 1585 and Angle Point 4 of
Allotment 1312, Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

1/23/90 CK, GB	AP 4
Found 610 iron with	TR
brass cap set	1312
flush with	S17 ————— S16

Swamp. Monument AP 1

slightly leaning TR

north. Ice is very 1585

thick. 1918

Placed 8' steel sign post on south side
of 610 iron. Attached survey sign.

29 ~~28~~

at Anne 1990

1/23/90 CK, GB

Ran line S1°W and measured 648'. Line
and distance checked good.

South 1/16 Cor. Secs. 16-17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

S1/16
S17 | S16
1918

Ash 5" N20°E 63 | KS - 41.58'

NOW 12" ASH AT N20°E 41.58' SCAR FACING COR.

Paplar 16" N61½°W 113 | KS - 74.58'

NO TRACE AT N61W 74.58'

Form 458 on 8 Elm N42°W - 35.64 FT

NO TAG SEEN ON ELM - NOW 16" LIVING ELM N42W - 35.6'

8/30/89 GBYCK

FD. IRON & CAP - IN PLACE - ^{18"} 24" ABOVE GROUND - WILL LOWER
LATER - AT GRASS AND BRUSH EDGE OF SWAMP TO SOUTH

OLD BLUE LINES NORTH & WEST

W.OAK 12 NZ1W 46.7 MID S1/16 S17 BT

W.OAK 16 N70W 68.95' " " " "

Placed 8' steel sign posts north 4.0
and west 4.0' west with both
signs attached. Line to standard
north & west.

Angle Point 5 of Allotment 1730 and Angle Point 4 of Allotment 1734, Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

	AP4	
S 17	TR 1734	S 16
	AP5	
	TR 1730	
	1918	

8/21/89 R.M., G.B.

Chained from W 1/4 sec. 17 north. Found no evidence of corner position except for a irregular shape hole going down in the ground. North-south property line runs ^{slightly} west of the hole.

9/6/90 CK, G.B., R.D.

Line to standard north & south from this corner area.

North 1/16 Cor. Secs. 16-17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

N 1/16
S 17 | S 16
1918

Oak 6" N20°E 19/15 - 12.54'

Oak 7" S41°W 27/15 - 17.82'

8/24/89, G.B., R.M.

Fd. no evidence of corner position. Chained
from E 1/4 sec. 17 north and from NW 1/16 sec. 16
west.

2/5/90 CK, G.B., R.D. Line to standard runs
north and south from this corner area.

J-9

Sec. Cor. Secs. 8-9-16-17

G.L.O. Resurvey notes of 1917

Iron post 3' long 1" diam. with brass cap
marked

T 142N R 30W

Found Iron cap in place

S 8 | S 9

in good condition

S 17 | S 16

10" above ground

1917

Ash 6" N35³/₄°E 72 IKS - 47.52'

Now a 10" Ash scribe over grown at bry. dist.

Oak 5" S34¹/₂°E 29 IKS - 19.14'

Now a 6" Oak scribe over grown at bry. dist.

Oak 5" S39°W 85 IKS - 56.10'

Now a 14" stump with blaze and flat showing at bry. dist.

Oak 8" N34¹/₂°W 59 IKS - 38.94' scribe over grown

Now a 18" Oak which is split and broken at bry. dist.

To perpetuate this corner I scribed (2)
new bearing trees as follows.

10" Oak N46°W 52.0 ft. scribed S 8 Bt.

7" Oak S22°W 61.7 ft. scribed S 17 Bt.

72" steel sign post due South 20' with

F.S. signs 54-2 & 54-4 attached.

9-25-70

Curtis Krause

J-9

AFFIDAVIT
3/15/71
J.P.B.

28 28

W. ADK 7/82

Fd. IRON + BT'S. OK

8' STEEL SIGN POST WEST 3.0'

LINE TO STANDARD WEST

2/6/90 CK, GB, R.D.

C.C. done
10/17/90Placed 8' steel sign south 4.0' from corner
with both signs attached. Line to standard goes south.

J-8

East 1/16 Cor. Secs. 8-17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

E 1/16 $\frac{S 8}{S 17}$

Not found in high 1918

grass with soft bottom.

10-1-70

Curt Krause

29 ✱

J-7

1/4 Cor. Secs. 8-17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
markedFound in place, but bent $\frac{1}{4}$ $\frac{S 8}{S 17}$

and broken 12" down from 1918

cap. Cap was in good condition.

Oak 6" S54°W 20 lks - 13.20'

Now a rotted stump in power line clearing

Oak 3" N53°15'E 25 lks - 16.50'

Now a rotted stump in power line clearing

To perpetuate this corner I set a 2"
dia. 60" long galvanized steel pipe, filled
with concrete and capped with a 3" dia. brass
Tablet stamped.

T142 N R 30 W

 $\frac{1}{4}$ S 8

S 17

1970

RLS No. 6807

Witnessed by 14" Maple S68°E 65.0 ft. scribed $\frac{1}{4}$ S17 Bt.13" Oak S31°E 110.0 ft. scribed $\frac{1}{4}$ S17 Bt.9" Elm S38°W 40.7 ft. scribed $\frac{1}{4}$ S17 Bt.72" steel sign post due East 2.3' with F.S.
signs 54-2 & 54-4 attached.72" steel sign post due South 3.3' with F.S.
sign 54-2 attached.

9-30-70

Curtis R. Krause

J-7

Affidavit
7/5/71 (JB)

30 20

This corner falls in the middle
of a power line clearing and in
N-S line with poles. Both bearing
trees were cut off when power line
was cleared, but their stumps still
remain.

9-30-70

Curtis R. Krause

I placed the bottom 29" of the G.L.O. iron
next to the 2" dia. pipe now in its place.

8/23/89 CK-GB-RM

CC Krause

Fd IRON + CAP IN PLACE - 8' SOUTH OF SE COR. OF TRAILER HOUSE

MAPLE + OAK BT's, OK - ELM BT IS DEAD - BOTH SIGN POSTS IN PLACE

West 1/16 Cor. Secs. 8-17

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

W 1/16 S 8

S 17

1920

W. Dak 8" S59°15'E 10.1ks - 6.60'

Elm 6" N51½°W 5.1ks - 3.30'

Corner marking projection of the line between
Allotments 1344 and 1730, Sec. 17

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

TR 1730

AP 1 | AP 2

TR | TR

1344 | 1730

1920

Meander Cor. Secs. 17-18

G. L. O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap
marked

T142N R30W

S18 | S17

~~MC~~

1920

Poplar 10" S75°E 252 1Ks - 166.32'

Dak 8" N53°E 213 1Ks - 140.58'

L-37

Center 1/4 Sec. 17

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

Found iron & cap in place C 1/4 S17

in good condition 1920

8" above ground

Pine 3" N25 1/2° E 66 1/2 - 43.56'

Now a 11" W. Pine ^{NOW 14" W. PINE} at 579' dist. scribe overgrown. ^{N25E 43.56'}

Oak 6" S60° W 90 1/2 - 59.40'

Now a 9" Oak stump 29' high with marks showing. ^{NOW WELL ROTTED STUMP S60W - 59.40' dist.}

To perpetuate this corner I scribed one new bearing tree as follows.

11" Elm ^{NOW DEAD Elm N37W 17.7'} N37° W 17.7 ft scribe C 1/4 S17 Bt.

72" steel sign post due East 1.6' with F.S. sign 59-4 attached.

SIGN POST IN PLACE 8/24/89 10-1-70

Curt Krause

8/24/89 Krause & Brama C.C. Bone 10/17/80

Fd. IRON CAP - IN PLACE - 8" HIGH 25' EAST OF WOODS TRAIL N4S

MKD. NEW B.T.S.

W. PINE 13 S39E 30.57' MKD C 1/4 S17 BT

W. OAK 11 S47W 73.87' " " " "

Affidavit.
3/18/71
C.P.S.

34 33

K, L-7

Angle Point 3 of Allotment 1732 and Angle
Point 4 of Allotment 1327, Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

TR	TR
1327	1732
AP 4	AP 3

1918

8/24/89 - CK, GB, R.M.

Found no evidence of corner position.

5/4/90 GB

Set a 2½" x 24" long galvanized pipe
with brass cap marked - T142N R30W

Mon. set 5" below ground.

under E-W power line. Gravel

TR 1327	TR 1732
AP 4	AP 3

road runs NE-SW 150' north of corner

Sec. 17
1990

Mkd. BT's:

U.S.F.S.

1. W. Pine 25" N30°E 52.86 ^{Mkd} AP3 S17 BT

2. W. Pine 13" S44E 59.08 BT

3. W. Pine 16" N60E 81.05 AP3 S17 BT

Placed 8' steel sign post east 20' with
both signs attached. L. T. Standard north+east

35 84

CC. Dom 10/17/90

2/7/90 CK, GB, R.D.

Re-establishment of this angle point by survey.
Set instrument up over C/4 sec 17 and measured 1290.480
to CN 1/4. Split of 1290.48 is 645.24'. With
instrument set over C/4 and sighting CN 1/4, we
establish this angle point on line and at proportionate
distance of 645.24.

R at C/4 pt.-1

pt 1 to pt 2 Vert 89-50-55

CN 1/4 pt-2

Slope dist. 1290.48

Angle pt.-3

Horz. dist. 1290.48

pt 1 to pt 3 Vert 89-04-51

Slope dist. 645.24

Horz. dist. 645.24

Set 60d spike at Angle pt. 3 and Angle pt. 4
position. Temporary ties:

1. W. Pine 13" S44E 59.08' Tag & spike

2. W. Pine 25" N30°E 52.86

Center North 1/16 Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

N 1/16

8/24/89 GB-RM-CK

C

FD-IRON & CAP - IN PLACE

S17 | S17

BUT BENT LEVEL WITH GROUND

C

STRAIGHTEN IRON & RESET LEVEL

1918

WITH GROUND - 3' EAST OF CENTERLINE OF N+S POWER LINE

Oak 10" S51°W 47.15 - 31.02'

NO TRACE AT BRG. + DIST.

Poplar 8" N25 1/4° E 40.15 - 26.40'

NO TRACE AT BRG. + DIST.

MKD NEW BT'S.

W. OAK	12	N74W	46.45	MKD CN 1/16 S17 BT
W. OAK	8	N65E	60.45'	" " " "
W. OAK	11	S53E	33.50	" " " "
POWER POLE	8	S11W	19.45	FSLP

C.C. Bone

CHAINED SOUTH IN POWER LINE CLEARING GLO DISTANCE 1291'

DISTANCE CHECKED WITHIN A FOOT

CORNER IS 100' SOUTH OF WOODS TRAIL NW+E

L-8,9

Angle Point 2 of Allotment 1274 and Angle Point
1 of Allotment 1411, Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

8/18/89 CK, GB TR 1730

Fd. IRON & CAP - IN PLACE AP1 AP2

IN GOOD CONDITION TR TR

10" ABOVE GROUND - IN PINE 1411 1274

↳ HARDWOODS 1918

OLD BLAZED LINE BETWEEN CORNERS

CAP MKD

TR 1731

AP

TR 1

1411

1918

MKD NEW BT'S.

N. PINE 17 N1E 62.95' MKD S17 BT

N. PINE 20 S75E 5.80' " AP2 S17 BT

N. PINE 19 N66W 43.10' " S17 BT

2/5/90 Placed 8" steel sign posts east 8.0' and
west 4.0' with both signs attached.

Line to standard east + west C.C. Dome 1992

3736

L-8

Center East 1/16 Col. Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked E 1/16

8/18/89 GB-CK



Ed. IRON CAP - IN PLACE

S17

IN GOOD CONDITION - 10" ABOVE

1918

GROUND - AT EAST EDGE OF NYS WOODS TRAIL

Pine 10" S49³/₄°E 53 LKS - 34.98'

AT S50°E 35.0'

NOW WELL ROTTED PINE STUMP LEVEL WITH GROUND

Pine 14" N24¹/₄°W 28 LKS - 18.48'

NOW WELL ROTTED PINE STUMP LEVEL WITH GROUND

5680-11 by Emery - 1967

MARKED NEW BT'S.

W. OAK 5 S89E 27.15' MKD CE 1/16 S17 BT

W. PINE 12 S29E 64.25' " " " "

W. PINE 15 N79W 40.25' " " " "

2/5/90 CK, GB, R.O. Placed 8" steel sign posts
east 4/10 and north 4/10 from corner. Line to
standard east & north. CC Done 1992

CORNER IS IN HARDWOODS + PINE HEAVY UNDERBRUSH

M, N-8

Angle Point 3 of Allotment 1312 and Angle Point 2 of Allotment 1585, Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

AP3

TR

10/31/89 GB-MEH-CK

1312

FD, IRON + CAP - IN PLACE

AP2

10" ABOVE GROUND

TR

IN GOOD CONDITION

1585

IN HARDWOODS STAND 1918

W. PINE TO NORTH OF CORNER

FAIRLY OPEN TO NORTH

8' steel sign posts north 4.0' and south 4.0' with both signs att.

MAKING NEW BT'S.

W. PINE 14 N26E 65.40' MAKE AP3 S17 BT

W. OAK 12 N51W 45.1' " S17 BT

R. OAK 10 S81W 14.55' " S17 BT

LOCAL BT'S.

TWIN R. OAK 15 N12E 28.6' BLAZED + NAIL

TWIN DEAD ELM 10 S84E 12.55' " + NAIL

L.T.S. north + south. C.C. Done 1992

M-8

SE 1/16 Cor. Sec. 517

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

SE 1/16 S17

1918

Oak 5" N74°W 11 1/2 - 7.26'

NOW WELL ROTTEN OAK STP. AT N74W 7.3'

Oak 4" S23½°E 15 1/2 - 9.90'

NOW 12 MAPLE AT S23E 9.9' SCARS FACING COR.

5680-11 leg Gardner - 4/62

8/30/89 GB-CK

Ed. IRON & CAP - IN PLACE - IN GOOD CONDITION

6" ABOVE GROUND - IN OAK & PINE STAND LIGHT BRUSH

MKD NEW BT's.

W. OAK 12 N27E 53.18' MKD SE 1/16 S17 BT

MAPLE 9 N88W 62.35' MKD SE 1/16 S17 BT

LOCAL BT's.

R. OAK 18 N59W 37.05' MKD BT

W. PINE 18 N70E 31.25' TAG & BPK.
C.C. Done 1992

8' steel sign posts south and east with both signs att. L.T.S. south & east

4039

CHAINED 660' FROM AP 344 TO EAST

M28, 9

Angle Point 3 of Allotment 1274 and Angle
Point 4 of Allotment 1411, Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

8/30/89 GB-CK

FD. IRON CAP - IN PLACE

IN GOOD CONDITION - 8" ABOVE GRD.

AT EDGE OF SWAMP TO SOUTH

TR TR

1411 1274

AP4 AP3

TR 1312

1918

MKD NEW BT'S.

W. PINE 24 N33W 31.00' MKD AP4 S17 BT

TAM. 9 N76E 16.90' " AP3 S17 BT

TAM. 8 S56E 7.55' " S17 BT

2/28/90 CK, GB

Placed 8' steel sign posts east 4.0' &
west 3.4' with both signs attached:

Line to standard east & west. CC Done 1992

K, L-8

Angle Point 3 of Allotment 1734, Angle Point 4
of Allotment 1732, and Angle Point 2 of
Allotment 1730, Sec. 17

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap
marked

	TR	TR
Found Iron & cap	1732	1734
in place in good cond.	AP 4	AP 3
10" above ground		AP 2

TR
1730

1918

Placed 72" steel sign post next to iron
with F.S. sign 59-4 attached.

SIGN POST IN PLACE 10-1-70

0.5' WEST OF COR.

Curt Krause

Corner Falls 15' East of Resort road.

in a new sheard area.

F.S.L.P. on a 14" Norway Pine 15' North of iron

8/24/87 GB-RM-CK

FD. IRON + CAP - IN PLACE - IN GOOD CONDITION - 10" ABOVE
GROUND - 15' EAST OF RESORT ROAD

MKD NEW BT'S.

W. OAK 7 N40E 340 MKD AP3 S17 BT

W. PINE 22 N80E 32.05' " " "

N. PINE 18 S16E 42.65' " AP2 S17 BT

C.K. Donu
1992

Angle Point 3 of Allotment 1327 and Angle Point 2
of Allotment 1730, Sec. 17

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap
marked

TR	TR
1730	1327
AP 7	AP 3

S 17

1920

Special Meander Cont. Sec. 17 (E. shore Agency Bay)

G.L.O.R. resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

TR
SMC | 1730
517
1920

Oak 8" N31°45'W 33 1/3 - 21.78'

Oak 4" S66°E 7 1/3 - 4.62'

Angle Point 3 of Allotment 1730 and Angle Point
4 of Allotment 1344, Sec. 17

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap
marked

TR	TR
----	----

1344	1730
------	------

AP4	AP3
-----	-----

TR	1730
----	------

1920

NW 1/16 Cor. Sec. 17

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap
marked

NW 1/16 S17

1920

Oak 5" N67°15'E 261K5 - 17.16'

Oak 12" S41°15'W 171K5 - 11.22'

Special Meander Cor. Sec. 18 (East shore Agency Bay)

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

SMC N | S 18 N
S 18

1920

Poplar 6" N. 28°E 34.15 - 22.44'

Poplar 6" N. 23°W 42.15 - 29.72'

Meander Cor. Secs. 7-18

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

S7 | MC

S18

T142N R30W

1920

Oak 8" S74¹/₂°E 78 IKS - 51.48'

Oak 6" N78°45'E 157 IKS - 103.62'

J-²⁴

Meander Cor. of Secs. 7-18 (E. Shore Agency Bay)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Monument not found T142N R30W

Probably taken out by $\begin{array}{l} \diagdown \\ \text{S7} \end{array}$

ice action $\begin{array}{l} \diagdown \\ \text{S18} \end{array}$

1918

Oak 6" S83°E 168 IKS - 110.88'

This tree was cut off for identification as bearing tree 18" stump remains.

Oak 10" N72½°E 184 IKS - 121.44'

Taken out in road const. and power line clearing

To perpetuate this corner I set a 5½" x 5½" x 60" long concrete monument 18" above ground, with a 3" dia brass tablet stamped

T142N R30W

MC $\begin{array}{l} \diagdown \\ \text{S7} \\ \diagdown \\ \text{S18} \end{array}$

1970

RLS NO 6807

Witnessed by

8" Birch N44°E 29.8ft. scribed MC S7 Bt.

12" Oak S89°E 29.7ft. scribed MC S18 Bt.

6" Willow S83°E 117.0ft. scribed MC S18 Bt.

4" x 4" x 72" Cedar post due West 1.2' with

F.S. sign 34-4 attached.

10-13-70

Curt Krame

Affidavit
3/15/71
C/K

49 28

Meander Cor. Secs. 7-8 (S. shore Leech Lake)

G. L. O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T 142N R 30W

MC

57 | 58

1918


Oak 5" S 3 1/2° E 81 KS - 5.20'

Oak 3" S 47 3/4° W 21 KS - 13.86'

Special Meander Cor. Sec. 8 (S. shore Leach Lake)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

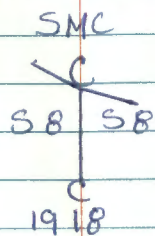

Oak 6" S30½°E 163 1KS - 107.58'

Oak 8" S76½°W 41 1KS - 27.06'

Special Meander Cor. on the Center Line of Sec. 7

G.L.O. Resurvey notes of 1920


Iron post 3' long 1" diam. with brass cap marked

C
S | 7
C
SME
1920

Closing Cor. Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

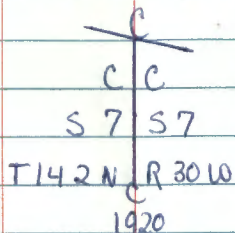

Poplar 6" N11 1/2°E 118 1/2' - 77.88'

Poplar 10" N63 1/2°W 188 1/2' - 124.08'

Center South V16 Cor. Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. With brass cap marked

CS 1/16 S7

1920


Dak 6" East 91ks - 5.94'

Dak 6" S82 1/2° W 106 1ks - 69.96'

Special Meander Cor. Sec. 7 (W. shore Leech L.)

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

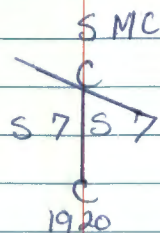

Oak 10" S42³/₄°E 39 1/2 - 25.74'

Oak 12" N53¹/₄°W 74 1/2 - 48.84'

Southwest 1/16 Cor. Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

SW 1/16 S7

1920


Poplar 8" S52°W 178 1KS - 117.48'

Poplar 8" N77³/₄°W 190 1KS - 125.40'

Special Meander Cor. Sec. 7 (N. Shore Agency Bay)

B.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

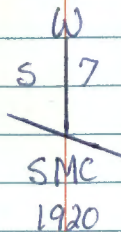

Oak 8" N76 1/4° E 24 KS - 15.84'

Oak 6" N33 1/4° W 15 KS - 9.90'

61-2
Closing Col. Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

Found in place	in good	W	C	C
condition	10" above grass	S	7	S7
placed oak post beside		T142N		R30W
brass cap.			1920	

9-11-70

Charles R. Krause

G-2

Center West 1/16 Cor. Sec. 7

G.L.O. Resurvey notes of 1920.

Iron post 3' long 1" diam. with brass cap marked

Found Iron & cap lying CW 1/16 S7

under grass with flange in place 1920

in good condition

Oak 10" N77 $\frac{1}{4}$ °E 355 IKS- 234.30'

Now a 13" Oak scribe overgrown at brg & dist.

Rescribed Bt.

I drove a 72" galvanized steel fence post
into solid bottom of swamp and wired
Iron & cap to this post.

72" steel sign post due North 1.2' with
F.S. signs 54-2 & 54-4 attached.

72" steel sign post due West 1.6' with
F.S. signs 54-2 & 54-4 attached.

9-11-70

Curtis R. Kramer

G-2

Affidavit
3/15/71
CRS

59 58


F, G-2

Special Meander Cor. Sec. 7 (W. Shore Leech L.)

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. With brass cap marked

Found iron $\frac{1}{2}$ cap in place
in good condition
under 6" of sand

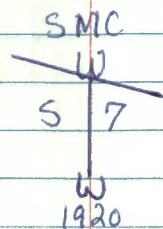

Oak 8" S16°E 70 1K5 - 46.20'

Tree has been cut off and stump burned recently

Oak 10" N85°W 43 1K3 - 28.38' (Rescribed SMC S7 B)

Now a 13" Oak at brg & dist. scribe over grown

To perpetuate this corner I scribed
(1) one new bearing Tree as follows.

10" Oak S33°W 24.8 ft. scribed SMC S7 B.

72" steel sign post due South 1.2' with F.S.

signs 54.2 & 54.4 attached.

9-11-70

Curtis R. Krause

Affidavit
3/15/70
(CR)

Closing Cor. Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

~~C 57 C~~
C 58 7
1920

No accessories available

Special Meander Cor. Sec. 7 (E. shore Gould L.)

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

SME/S7 c

1920

No accessories available

F-1, 2b

Special Meander Cor. on the N. 1/16 Sec. line of Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

N ~~S7~~ W SMC

Found iron $\frac{1}{2}$ cap in place S7

in good condition 1920

Brass cap is under 10" of sand

Oak 10" N72°W 95 IKS - 62.70'

Now a 12" Oak at brg. $\frac{1}{2}$ dist. scribe over grown.

Oak 12" S30 $\frac{1}{2}$ °W 97 IKS - 64.02'

Now a 14" Oak at brg. $\frac{1}{2}$ dist. scribe over grown.

I rescribed both Oak trees with a Bt.

72" steel sign post due West 1.6' with

F.S. signs 54-2 & 54-4 attached.

9-11-70

Curtis R. Krause

A.F.F. relawit

3/15/71

CRB

Witness Cor., to the true point for F-1, 2a
Special Meander Cor. Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap
marked

WCN | S7 N

Found iron cap in place SMC | S7

in good condition 6" above gd. 1920

Oak 10" S61 $\frac{1}{2}$ °E 194 lks - 128.04'

Falls in woods road Turn around

Oak 8" N35 $\frac{3}{4}$ °E 104 lks - 68.64'

Falls in turn around along side of small road.

To perpetuate this corner I scribe (2)

Two new bearing trees as follows.

7" Oak S88°E 85.3 ft. scribed WC SMC S7Bt

9" Oak S76°E 87.6 ft. scribed WC SMC S7Et

72" steel sign post due East 1.6' with

F.S. signs 54-2 & 54-4 attached.

9-11-70

Curto R. Kraine

AFF-davit
dist 7
(188)

67 & 3

Angle Point 1, Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

T142N AP 1

R.30 W

S 7

1920


Poplar 10" S54°E 262 1KS - 172.92'

Poplar 12" S23°E 218 1KS - 143.88'

Angle Point 2 Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

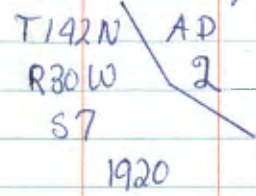

Pine 14" N12 3/4°W 38.1KS - 25.08'

Oak 10" S71 1/4°W 18.1KS - 11.88'

Angle Point 3, Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

T142 N
R30 W / AP
S7 / 3
1920

Poplar 6" N76½°E 1 IK - .66'

Dak 8" S46¼°E 257 / KS - 169.72'

Angle Point 4 Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

AP4

T142N R30W

S 7

1920

No accessories available

Witness Cor. to Angle Point 5, Sec. 7

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

T142N $\begin{matrix} \diagup \\ \text{WC} \\ \diagdown \\ \text{AP5} \end{matrix}$

R30W

S7

1920

Oak 10" N25^{3/4}°E 140 1KS - 92.40'

Witness Cor. to Angle Point 6 Sec. 2

G.L.O. Resurvey notes of 1920

Iron post 3' long 1" diam. with brass cap marked

T142N	WC
R30W	AP6
S7	
1920	

Oak 10" S12°W 115 IK5 - 75.90'

Oak 8" S86 $\frac{3}{4}$ °W 80 IK5 - 52.80'



Quarter Cor. Secs. 9-16

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

$\frac{1}{4}$ 59

516

1918

Pits 18 x 18 x 12" E. and W. of cor. 3' dist.

J-9, 10

Angle Point 4 of Allotment 1605 and Angle Point 4
of Allotment 1733 in Sec 9 and Angle Point 1 of
Allotment 1733 in Sec. 16

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found Iron cap in place S 9

in good condition TR 1733 TR 1605

10" above ground. AP 4 AP 4

AP 1

W. AUSK 7/82

TR S16

Ed. IRON + CAP OK

1733

BT'S. OK - L.T.S. EAST OF COR.

1918

To perpetuate this corner I scribed
(3) Three new bearing trees as follows.

10" Oak N19°W 5.0 ft. scribed AP 4 S 9 BT

10" Oak N76°E 22.3 ft. scribed AP 4 S 9 BT

8" Oak S46°E 26.1 ft. scribed AP S16 BT

72" Steel sign post due East 1.5' with F.S.
signs 54-2, 54-4 attached.

9-25-70

Curtis Krause

CL. Done
10/17/70

2/6/90 CK, G.B. R.D.

Placed 8" steel sign post 8.0' south from
corner. Line to standard south.

Corner and BT's are in good condition.

Affidavit

3/15/71

CRB

73

Meander Corner Secs. 8-9 (S. shore Leech Lake)

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

T142N R30W

MC

S8

S9

1918

Ash 5" S18 $\frac{1}{4}$ °W 259 1K5- 170.94'

Ash 5" S66°E 165 1K5- 108.90'

H-12

H-12

Affidavit
3/5/71
CDB

25 84

Southeast 1/16 Cor. Sec. 9

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found iron cap in place SE 1/16 S9

in good condition 1918

16" above ground

Pits 18 x 18 x 12", N. and S. of the corner 3' dist.

Both pits visible

To perpetuate this corner I scribed
(2) two new bearing trees as follows

6" Ash 565°E 156.7 ft. scribed SE 1/16 S9 Bl.

8" Ash 587°E 174.5 ft. scribed SE 1/16 S9 Bl.

72" steel sign post due North 2.0'

with F.S. signs 54-2 & 54-4 attached

9-29-70

Clayton E. Korman

Drove steel sign post 4' down next to mon.
and wired iron to post.

G-12

Center East 1/16 Cor. Sec. 9

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found Iron & cap, in place E 1/16

in good condition C ————— C

16" above ground. 59

1918

Ash 5" S45½°W 86 lks - 56.76'

Clump of Ash now growing out of stump.
at brg. & dist.

Ash 6" N59½°W 167 lks - 110.22'

Now a 15" Ash at brg. & dist. (scribe overgrown)

To perpetuate this corner I scribed
(1) one new bearing tree as follows.

14" Ash S53°W 59.7 ft. scribed CE 1/16 59 Bl.

72" steel sign post due West 1.8' with

E.S. signs 54-2 & 54-9 attached.

9-29-70

Curtis R. Krause

Drove steel sign post 4' down beside
iron and wired it to post.

G-12

W. P. Davitt
3/15/71
JRS

76

Witness Cor. to the true point for Special Meander Cor, Sec 9
G.L.O. Resurvey notes 1918

Iron post 3' long 1" diam. with brass cap marked
Found Iron cap (in place) WC
in good condition SMC | 59
12" above ground. C | 59

1918

Ash 5" S6°E 34 1KS- 22.44'

large rotted stp. at brg & dist.

Elm 6" N44°E 34 1KS- 22.44'

Now a 15" Elm snag at brg & dist. (scribe overgrown)

To perpetuate this corner I scribed

(2) Two new bearing Trees as follow.

5" Elm N58°E 30.4 ft. scribed WCSMC 59B

13" Elm S16°E 40.1 ft. scribed WCSMC 59B

72" steel sign post due East 1.6' with F.S.

signs 54-2 & 54-9 attached.

9-29-70

Charles R. Krause

At Fridau.
3/5/71
CRK

7786

N58°E 30.4

F. 11, 12

Witness Cor. to the Special Meander Cor. Sec. 9


G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found in place, in good WC

condition, 12" above

grass. Iron with cap

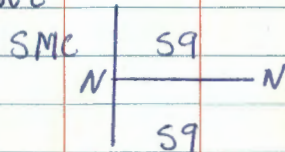

1918

Pits 18 x 18 x 12", E. of Cor., 3 ft. dist.

Found pit 3" East of corner

To perpetuate this corner I scribed

(2) Two new bearing trees as follows.

15" Elm S40°E 141.0ft. scribed WC SMC S9 Bt.

3" Elm S61°E 89.3ft. scribed X Bt.

72" steel sign post due East 2.9' with

F.S. sign 54-2 Attached.

Did not have a 54-4 with at this time

9-29-70

Curtis R. Krause

Drove steel sign post next to iron, and

wired both together. 36" deep

AFF. dau. T
3/15/71
CRS

78

H-10

H-10

Southwest 1/16 Cor. Sec. 9

G.L.O. Resurvey notes of 1918

Iron post 3' long 1" diam. with brass cap marked

Found iron cap in place SW 1/16 S9

in good condition 1918

8' above ground.

Raise a mound of stone, 2' base, 1 1/2' high, W
of cor. 3' dist.

Found pile of stones 3' West of corner

To perpetuate this corner I scribed
(3) three new bearing trees as follows.

8" Oak S48°W 14.3ft. scribed SW 1/16 S9 Blt

6" Elm S40°E 37.3ft. scribed SW 1/16 S9 Blt

4" Oak S85°E 52.4ft. scribed SW 1/16 S9 Blt

72" steel sign post due East 3.0' with F.S.
signs 54-2 & 54-4 attached.

72" steel sign post due South 3.5' with F.S.
sign 54-2 attached.

9-28-70

Charles R. Krause

RE-FOUND
7/15/71
CB

7976