

CORNER RESTORATION T14N R30W

CORNER

RESTORATION

T14N R30W

Book #2



FIELD BOOK

820012





1  
Corners of Sections 5-6-31-32

Notes of GLO Resurvey 1920

Restored from original evidence

Found old wooden post - showing scribe marks.

Found 3 original bearing trees with scribe showing at bry.  $\frac{1}{3}$  dist. as recorded in orig. notes

Set iron post 2" Dia. x 36" long  
with brass cap marked

T144N R30W

531 | 532

56 | 55

T143N R30W

1920

From which

Spruce 8 N31E 30 ks. = 19.8'

Cedar 10 S67 $\frac{1}{2}$ E 16 ks. = 10.6'

Spruce 9 S11W 23 ks. = 15.2' orig BT

Cedar 10 N41 $\frac{1}{2}$ W 33 ks. = 21.8'



2 South 1/16 Bet. Sec's. 31-32

Notes of GLO Resurvey of 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked

S 1/16

S31|S32

1930

From which

Tam. 10 S24 1/2 E 10 lks. = 6.6'

Cedar 10 S63 W 7 lks. = 4.6'



3 X-5  
Quarter Corner Bet. Sec's. 31-32

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked

$\frac{1}{4}$   
S31 S32  
1930

From which

Birch 6 N40½E 121ks. = 7.9'

Poplar 12 S68W 641ks. = 42.2'

5680-11 By MARTINSON, 1968

3-4-81 G. BRAMA

Fd I.P. IN PLACE UP 6" AND WITNESSED WITH

GLO BIRCH 12" N41°E 7.9 FT TO NAIL MKD: BT

NEW R. OAK 11" N65°E 49.79 FT MKD: 4.532 BT

Elm 12" S60°W 114.30 FT MKD: 4.531 BT

W. OAK 15" N89°W 173.22 FT MKD: 4.531 BT

8 FT STEEL SIGN POST NORTH 4.0 FT SOUTH 3.9 FT  
FSLP ON BIRCH 8" N53E 4.0 FT



4 W-5

North 1/16 Bet. Sec's. 31-32

Notes of GLO Resurvey 1930

Proportionate Distance.

Set iron post 1" Dia. X 36" long

with brass cap marked.

N 1/16  
S31 | S32  
1930

From which

Poplar 8 S16E 481ks. = 31.7'

Birch 12 S73W 361ks. = 23.8'

5680-11 By MARTINSON, 1968

3-4-81 GBRAMA

Fd IRON PIPE IN PLACE 6" ABOVE GROUND. Woods

TRAIL 450 FT WEST OF CORNER ALSO 4" X 4" X 7' Wood POST

WITH FSLP 867 FT NORTH OF CORNER. WITNESSED BY

GLO ASPEN 16" S16°E 31.7 FT

NEW W. OAK S68E 85.56 FT

R. OAK 9" S8W 153.15 FT

MAPLE 3" N20E 34.97 FT MKD° X BT

8 FT STEEL SIGN POSTS NORTH 4.9' SOUTH 2.7' WEST 4.8

EAST 2.8



5 V-5 Affidavit 8/30/78  
Corner to Sections 29-30-31-32

Notes of GLO Resurvey 1930

Restored from original evidence

Found W. Pine stump 24" N54W 631ks. = 41.6'

with scribe marks W S30 BT visible

Found rotted stump at brq  $\frac{1}{2}$  dist.

Set iron post 2" Dia. x 36" long

with brass cap marked T144N R30W

Found 2" iron with cap - in place <sup>3-4-75</sup> S30 S29

in good condition - 4" above ground S31 S32

approx. 400' south of woods trail - blazed and painted N-S  
1930

From which

Elm 12 N48½E 291ks. = 19.1'

Now 15" Elm at brq  $\frac{1}{2}$  dist. scribe <sup>cracked & hollow</sup> overgrown

Poplar 4 S15E 231ks. = 15.2'

found rotted stump at brq  $\frac{1}{2}$  dist.

Birch 6 S17W 451ks. = 29.7'

Now 10" Birch at brq  $\frac{1}{2}$  dist. scribe <sup>tree nearly dead</sup> overgrown

Elm 10 N68W 761ks. = 50.2'

Now 15" Elm at brq  $\frac{1}{2}$  dist. scribe <sup>cracked & hollow</sup> overgrown

To perpetuate this corner I scribed 4 new bearing trees as follows

W. Pine 10" N2°E - 111.2' - mkd. T144N R30W S29 BT

W. Pine 9" N27°W - 143.9' mkd. T144N R30W S30 BT

Elm 12" S40°W 48.8' mkd. T144N R30W S31 BT

W. Pine 25" S10°E 140.2' mkd. T144N R30W S32 BT

Set 8' steel sign post south 3.9' with F.S. signs  
54-2 & 54-4 attached.

Set 8' steel sign post north 3.5' with FS sign  
54-2 attached

OK  
2/29/80  
MCS

3-12-75

Clinton R. Krause



6 21-5

South 1/16 Bet. Sec's. 29-30

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked S 1/16

Found iron  $\frac{3}{4}$ " cap - in place S30|S29

in good condition 4" above ground 1930

Put FSLP on 4" Maple S48W 14.5'

From which

R. Oak 6 N4E 82 lks. = 54.1'

Now 11" R. Oak at brq  $\frac{2}{3}$  dist. scribe overgrown

Poplar 6 N44 $\frac{1}{2}$ W 62 lks. = 40.9'

Now 18" Poplar at brq  $\frac{2}{3}$  dist. scribe overgrown

Corner is 60' west of wood road running  
N-S blazed and painted line runs N-S  
of iron - fd. tags by Diamond Match on east  
side of road and at corner



7 T-5

Quarter Corner Bet. Sec's. 29-30

Notes of GLO Resurvey 1930

Restored from original evidence

Found Dead W. Pine 24" N83W 541ks = 35.6'

with scribe marks BT visible other marks

burned away Found rotted  $\frac{1}{2}$  burned pine stump

at brq  $\frac{1}{2}$  dist - in bad shape no marks visible

Set iron post 1" Dia. x 36" long

with brass cap marked  $\frac{1}{4}$

Found iron and cap in place 530 | 529

in good condition 5" above ground 1930

230' west of woods road N-S

From which 3-4-75 CK JG

Burr Oak 14 562E 2831ks. =

Now 19" Oak at brq  $\frac{1}{2}$  dist. scribe overgrown

Oak 16 524 $\frac{1}{2}$ W 1741ks. =

Now 19" Oak at brq  $\frac{1}{2}$  dist. scribe overgrown

fd. FSLP on 11" Aspen 6' SE of iron

blazed line runs N-S of iron also painted

blue - timber sale now in progress to N-NE-E

of iron



8 S-5

North 1/16 Bet. Sec's. 29-30

Notes of GLO Resurvey of 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked N'116

Found iron with cap - in place <sup>3-4-75</sup> S30 | S29

in good condition 8" above ground 1930

blazed line south-north also painted blue

From which

Maple 10 N38 1/2 E 24 lks. = 15.8'

Now 15" Maple at brq 1/3 dist. with scribe visible

Maple 8 N71 1/2 W 55 lks. = 36.3'

Now 12" Maple at brq 1/3 dist. with scribe visible

To perpetuate this corner I scribed 3 new  
bearing trees as follows

Basswood 7" N28 E 36.4' mkd. N'116 S29 BT

W. Spruce 15" S78 W 67.4' mkd. N'116 S30 BT

Basswood 12" N75 W 11.5' mkd. N'116 S30 BT

Set 8' steel sign post S4° E 3.6' with FS 54-2 1/3 54-4

Set 8' steel sign post West 3.2' with FS 54-2

3-14-75

Clinton R. Krause

Corner is 100' south of woods road running E-W  
with yellow tag on east side of 11" Maple  
north side of trail - tag by Diamond match



9 R-3

Quarter Corner Bet. Sec's. 19-30  
Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long  
with brass cap marked

$\frac{1}{4} \frac{519}{530}$   
1930

From which

Ash 8 S50½E 8 lks. = 5.3'

Ash 6 N47W 121 lks. = 79.9'

10 S-3

Center North 1/16 Sec's. 30

Notes of GHO Resurvey of 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked

N 1/16

5 | 30

C

1930

From which

Ash 16 N 18 1/2 E 90 lks. = 59.4'

W. Pine 6 S 1 E 114 lks. = 75.2'

5680-11 By SCHLUTER, 1970



11

Center Quarter of Sec's. 30

Notes of GLO Resurvey of 1930

Set iron post 1" Dia. x 36" long

with brass cap marked C/A 530

1930

From which

Tam. 14 N78 $\frac{1}{2}$ E 701ks. = 46.2'

Tam. 10 S23 $\frac{1}{2}$ W 881ks. = 58.1'

12

Center South  $\frac{1}{16}$  Sec's. 30

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post  $\cdot 1''$  Dia.  $\times 36''$  long

with brass cap marked

S  $\frac{1}{16}$ 

1930

From which

Ash 6 N  $17\frac{1}{2}$ E 32 ks. = 21.1'W. Oak 18 N  $18\frac{1}{2}$ W 54 ks. = 35.6'



13

Quarter Corner Bet. Sec's. 30-31

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked

$\frac{1}{4}$   $\frac{530}{531}$   
1930

From which

Elm 8 N15E 25 lks. = 16.5'

Poplar 8 S32E 56 lks. = 37.0'

14 W-3

Center North  $\frac{1}{16}$  Sec. 31

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post, 1" Dia. 36" long

with brass cap marked

N $\frac{1}{16}$

531

C

1930

From which

Birch 8 N48E 80 lks. = 52.8'

Birch 6 N81W 11 lks. = 7.3'

5680-11 By MARTINSON, 1968



15

Center Quarter Sec. 31  
Notes of GLO Resurvey 1930  
Set iron post 1" Dia. x 36' long  
with brass cap marked C'4 S31  
1930

From which

Birch 12 N61 $\frac{1}{2}$ E 25 lks. = 16.5'

W. Pine 12 S50 $\frac{1}{2}$ W 16 lks. = 10.6'

16

Center South  $\frac{1}{16}$  Sec. 31  
Notes of GHD Resurvey 1930  
Proportionate Distance

Set iron post, 1" Dia. X 36" long  
with brass cap marked

S  $\frac{1}{16}$   
C  
S 31  
C  
1930

From which

Elm 6 N50E 12 ks. = 7.9'

Maple 6 SITE 16 ks. = 10.6'



17

Quarter Corner Bet. Sec's. 6-31  
Notes of GLO Resurvey 1920

Restored from original evidence

Found pine stump 16 N30W 751ks. = 49.5'  
showing base of old blaze

Found Birch stump uprooted N18E 331ks. = 21.8'

Set iron post 1" Dia. X 36" long  
with brass cap marked  $\frac{1}{4}$   $\frac{531}{56}$

From which

Poplar 12 N27 $\frac{1}{2}$ W 251ks. = 16.5'

Poplar 8 S61W 1391ks. = 91.7'

18

East  $\frac{1}{16}$  Bet. Sec's. 6-31

Notes of GLO Resurvey 1920

Set iron post 1" Dia. x 36" long

with brass cap marked E  $\frac{1}{16}$   $\frac{531}{56}$

1920

From which

Poplar 16 S74W 74 lks. = 48.8'

Poplar 14 N74W 111 lks. = 73.3'

Corner falls in small slough extending west 30 lks.  
east 75 lks and south 250 lks.



19

Angle Point 3 Bet. Sec's. 31-6  
 Notes of GLO Resurvey 1920  
 Set iron post 1" Dia. x 36" long  
 with brass cap marked

S31 | TR 391  
 | AP3  
 S6  
 1920

No bearing trees

9-25-01 R. MAIN P. MOBERG

Fd GLO IRON IN PLACE. CORNER FALLS IN  
 CEDAR ASH SWAMP. Fd TAG ON 14" CEDAR  
 11/1/55 BY HEGLAND AND GAMACHE FROM  
 WHICH CORNER BEAR EAST  $\pm$  10 FT

CEDAR 14" S41°W 9.70 FT TO SPK NOT MKD

ASH 12" N33°W 16.19 FT TO SPK NOT MKD

DIFF CORRECTED GPS  
 47°14'08.38066  
 94°31'46.49168

20

Angle Point 5 Sec. 31

Notes of GLO Resurvey 1930

Corner of lots 8-9-10-11 sec. 31

and is also SE corner of Indian

Allotment 204

Set iron post 1" Dia. x 36" long

with brass cap marked

TR
204
AP 5

531

1930

No bearing trees



21

Angle Point 6 Sec 31

Corner of lots 4-5-8-9

also angle point 6 of Indian allotment 204

Set iron post 1" Dia. x 36" long

with brass cap marked

AP 6  
TR  
204

S31

1930

No Bearing trees

22

Angle Point 1 Sec. 31

Notes of GLO Resurvey 1930

Corner of lots 2-3-4-5 in sec. 31  
and also corner of Indian Allotment #204

Set iron post 1" Dia. x 36" long  
with brass cap marked

S31  
API  
TR  
204  
1930

No bearing trees



23

Angle Point 3 Bet. Sec's 30-31  
Corner of lots 2-3 section 31  
corner of lots 10-11 section 30  
also SW corner of Indian Allotment 242  
Set iron post 1" Dia. x 36" long  
with brass cap marked

S30

TR  
242

AP3

S31

1930

No bearing trees available

24

Angle Point #2 Angle Point #3 Angle Point #4

Corner of lots 8-9-10-11 Sec. 30

and also corner of Indian allotments

418, 794, 242

Notes of GLO Resurvey 1930

Set iron post 1" Dia. x 36" long

with brass cap marked

TR	TR
794	418
AP4	AP3

AR2
TR
242

S30

1930

No bearing trees



25

Angle Point 1 Angle Point 2 Angle Point 3

Angle Point 4

Corner of lots 4-5-8-9 Sec. 30 and 15

also corner of Indian Allotments #388-417

418, 794

Notes of GLO Resurvey 1930

Set iron post 1" Dia. x 36" long

with brass cap marked

TR	TR
417	388
AP4	AP3

AP1	AP2
TR	TR
794	418

No bearing trees

530

1930

26 S-2

Angle Point 2 Angle Point 3

Corner of lots 2-3-4-5 Sec. 30

and also corner of Indian allotments

381, 388 & 417

Notes of GLO Resurvey of 1930

Set iron post 1" Dia. x 36" long

with brass cap marked

	TR
	381
TR	AP3
417	AP2
	TR
	388

No bearing trees

1930

5680-11 By SCHLUTER & CAHACHE, 1965



27 R-2

Angle Point 1  $\frac{1}{3}$  Angle Point 2 Sec. 30

Notes of GLO Resurvey 1930

Corner of lots 2-3 Sec. 30 and ~~lots~~ lots  
10-11 Sec. 19 and ~~is also~~ also corner of  
~~lots~~ Indian Allotments # 381  $\frac{1}{3}$  417

Set iron post 1" Dia. x 36" long  
with brass cap marked

519  
AP1 | AP2  
TR | TR  
417 | 381  
530

From which

1930

Red Oak 12 59E 49 lks. = 32.3'

Basswood 16 589 $\frac{1}{2}$ W 61 lks. = 40.3'

## Corners to Sections 19-24-25 1930

Notes of GLO Resurvey 1930

Corner Restored from original evidence

Found fallen W. Pine 24" S56 $\frac{1}{4}$ W 99 lks. =  
with both blazes plain - scribe burned away

Found fallen poplar 14" N42W 61 lks. =  
with scribe BT on stump and T144N R31W S24  
on tree beside stump

Set concrete ~~block~~ monument 6" Dia.  
26" long with brass cap marked

T144N	
R31W	R30W
S24	S19
S25	S30
1930	

From which

R. Oak 7 N58E 54 lks. = 35.6'

R. Oak 8 S25E 35 lks. = 23.1'

R. Oak 8 S75W 39 lks. = 25.7'

Poplar 6 N5 $\frac{1}{2}$ W 140 lks. = 92.4'



29

North 1/16 Bet. Sec's. 25 1/30

Notes of GHO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. X 36" long  
with brass cap marked

N 1/16	
S25	S30
1930	

From which

Poplar 10 N24E 661ks. = 43.6'

Elm 4 N36 1/2 W 481ks. = 31.7'

30

Quarter Corner Bet. Sec's, 25<sup>3</sup>/<sub>30</sub>

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked

10-3-75 CK. FD. IRON + CAP IN PLACE.

$\frac{1}{4}$

5" ABOVE GROUND - CORNER IN HARDWOODS S25 | S30

WITH ASPEN + BIRCH

1930

From which

Maple 16 N76 $\frac{1}{2}$ E 75 lks. = 49.5'

NOW 19" MAPLE N76E 49.5' SCAR TO CORNER

Maple 12 N75W 73 lks. = 48.2'

NOW 14" MAPLE N75W 48.2' SCAR TO CORNER

PUT FSLP ON 19" BASSWOOD N20E 3.0' FROM IRON



South  $\frac{1}{16}$  Bet. Sec's. 25-30

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked  $\frac{5}{16}$

10-3-75 CK Fd. IRON & CAP IN PLACE 525 | 530

8" ABOVE GROUND - CORNER, IN HARDWOODS

WITH ASPEN & BIRCH 1930

From which

Elm 6 N76E 12 lks. = 7.9'

NOW 9" DOUBLE ELM N76E 7.9' SCAR TO CORNER

Poplar 10 N70W 33 lks. = 21.8'

NOW 17 ASPEN N70W 21.8' SCAR TO CORNER

Corner to sections 25-30-31-36

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 2" Dia. x 36" long

with brass cap marked

10-2-75CK Fd. 2" IRON & CAP IN PLACE

T144N  
R31W R30W

3" ABOVE GROUND - CORNER IN HARDWOODS

525 | 530

WITH BIRCH & ASPEN - 625' N OF WOODS TRAIL

536 | 531

From which

1930

Poplar 5 N12E 18 lks. = 11.9'

Fd. LOG & STUMP AT N12E 11.9' SCAR ON LOG

Poplar 5 S66E 13 lks. = 8.6'

NOW ROTTED STUMP AT S66E 8.6'

Birch 4 S62W 12 lks. = 7.9'

NOW 11" BIRCH S62W 7.9' NO SCAR VISIBLE

Poplar 5 N49½W 33 lks. = 21.8'

NOW ROTTED STUMP N50W 21.8'

MARKED NEW BTs.

R. OAK 16 N75E 51.3' NAIL & TAG

B. WOOD 7 N74W 34.7' " "

R. OAK 9 S51W 20.2' " "

MAPLE 6 S33E 9.2' " "

SET 8' STEEL SIGN POST DUE WEST 2.0' 54.9 ATTACHED

PUT E.S.L.P. ON 3" IRONWOOD ON N SIDE OF FW#29 CORNER IS

625' N OF TAG - 40' NORTH OF FW#29



North  $\frac{1}{16}$  Bet. Sec's. 31-36

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked

10/3/75 CK FD. IRON & CAP IN PLACE

4" ABOVE GROUND - OLD WOODS TRAIL

N4S IS 75' WEST OF CORNER.

N $\frac{1}{16}$

536 | 531

1930

From which

W. Pine 6 N34E 79 lks. = 52.1'

NOW 19" W. PINE, N34E 52.1' SCAR FACING CORNER

Poplar 10 N15 $\frac{1}{2}$ W 25 lks. = 16.5'

NOW ROTTED STUMP N15W 16.5'

PUT FSLP ON 12" W. PINE N25W 6.0' FROM IRON

34 X-1

Quarter Corner Bet. Sec's. 31-36

Notes of GAO Resurvey 1930

Restored from original evidence

Found pine stump 30" S81E 40 lks. = 26.4'

NO scribe marks visible

Found Elm 6 N63W 19 lks. = 12.5'

chopped out original scribe  $\frac{1}{4}$  S36

Set iron post 1" Dia. 36" long

with brass cap marked

$\frac{1}{4}$   
536 | 531

1930

From which

Birch 8 N68E 45 lks. = 29.7'

Elm 6 N53W 28 lks. = 18.5'

5680-11 By JAHNKE, 196?



35

South  $\frac{1}{16}$  Bet. Sec's. 31-36

Notes of GHO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked

 $\frac{5}{16}$ 

536 | 531

1930

From which

Poplar 10 S  $85\frac{1}{2}$ E 24 lks. = 15.8'Birch 4 N  $34\frac{1}{2}$ W 23 lks. = 15.2'

36 Z-1

Corners of Sections 1-6-31-36

Notes of GLO Resurvey 1920

Restored from original evidence

Found wooden stake, badly decayed with scribe marks visible

Found Cedar 14 N3E 518 lks. = 341.9'  
with scribe marks visible

Remark this tree T144N R30W S31 BT

Found Dead Tam. 14 S46E 268 lks. = 176.9'  
scribed T143N R30W S6 BT

Cedar 12 N3W 466 lks. = 307.6'  
scribed T144N R31W S36 BT

Set iron post 3" Dia. x 36" long  
with brass cap marked

	T144N	
R31W	S36   S31	R30W
	S1   S6	
	T143N	

From which

Cedar 4 S30E 25 lks. = 16.5'

Cedar 4 S49W 27 lks. = 17.8'

Cedar 14 N3W 466 lks. 307.6'

5680-11 By JAHNKE, 1963



37

West  $\frac{1}{16}$  Bet. Sec's. 6-31

Notes of GLO Resurvey 1920

Set iron post 1" Dia. X 36" long

with brass cap marked

$$\frac{W\frac{1}{16} \quad 531}{56}$$

1920

From which

N. Pine 6 N3W 48 lks. = 31.7'

Spruce 4 S42 $\frac{1}{2}$ W 13 lks. = 8.6'

9-25-01 R. MAEN P. MOBERG

CORNER POSITION FALLS IN WEST DITCH OF

SQUAW POINT ROAD NO EVIDENCE

38

Quarter Corner Bet. Sec.'s. 32 &amp; 33

Notes of GLO Resurvey 1930

Restored from original evidence

Found fallen cedar 12" N 70 E 71ks. = 4.6'  
with old blaze plain - but scribe burned away

Found fallen cedar 14" S 34 W 241ks. = 15.8'  
with old blaze plain - but scribe burned away

Set iron post 1" Dia. x 36" long  
with brass cap marked  $\frac{1}{4}$

S32	S33
-----	-----

1930

From which

Birch 5 S 70 E 311ks. = 20.5'

Birch 4 N 69 1/2 W 301ks. = 19.8'



Quarter Corner Bet. Sec's. 28<sup>1</sup>/<sub>3</sub> 33

Notes of G+O Resurvey 1930

Restored from original evidence

Found Dead Tam. 16" N42E 16 lks. = 10.6'

with scribe 1/4 S BT

Set iron post 1" Dia. x 36" long

with brass cap marked

1/4 S28  
S33  
1930

From which

Cedar 6 S87<sup>1</sup>/<sub>2</sub>W 17 lks. = 11.2'

Cedar 6 N32<sup>1</sup>/<sub>2</sub>W 22 lks. = 14.5'

49 V-15

Quarter Corner Bet. Sec's. 27-34

Notes of GLO Resurvey 1930

Restored from original evidence

Found Cedar 10 S88E 2151ks. = 141.9'

with scribe  $\frac{1}{4}$  S BT visible

Set iron post 1" Dia. x 36" long

with brass cap marked

$\frac{1}{4}$   $\frac{527}{534}$   
1930

From which

Cedar 12 S59W 171ks. = 11.2'

Cedar 8 NTW 171ks. = 11.2'

5680-11 By MARTINSON & BRUNS, 1968



50 V-16

East 1/16 Bet. Sec's. 27-34

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. X 36" long

with brass cap marked

E 1/16  $\frac{527}{534}$

From which

Birch 14 N9E 25 lks. = 16.5'

Ash 7 S79W 39 lks. = 25.7'

5680-11 By MARTINSON & BRANS, 1968

51

V-17

CORNER TO SECTIONS 26, 27, 34 & 35

5680-11 By MARTINSON & BRUNS, 1968

Also 874

12



52 21-16

Southeast  $\frac{1}{16}$  of section 27

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" dia. x 36" long

with brass cap marked

SE  $\frac{1}{16}$

S27

1930

From which

Elm 16 N65 $\frac{1}{2}$ E 65 lks. = 42.9'

Maple 10 S30W 24 lks. = 15.8'

5680-11 By MARTINSON & BRUNS, 1968

53

X-17

QUARTER CORNER BET. SEC. 34 + 35

5680-11 By MARTINSON & BRUNS, 1968

52



58

Center Quarter Sec. 26

Notes of GLO Resurvey 1930

Set iron post 1" Dia. x 36" long

with brass cap marked

C/A 526

1930

From which

Dead Cedar 6 N60½E 35 lks. = 23.1'

Birch 4 S4W 6 lks. = 4.0'

92

Chained east on road 1455' to 10" W. Birch

59

Special meandor Corner on East-west  
center line through section 26

Notes of GLO Resurvey 1930

Set iron post 1" Dia. X 36" long

with brass cap marked

$$C \frac{S}{26} | C \frac{S}{26}$$

1930

From which

Poplar 4 S 36 W 29 lks. = 19.1'

Elm 9 N 31 W 191 lks. = 126.1'

62



60

Center north  $\frac{1}{16}$  of Section 26

Notes of GLO Resurvey 1930

Proportionate Distance

Set iron post 1" Dia. x 36" long

with brass cap marked

$$\begin{array}{c} C \\ | \\ N\frac{1}{16} \mid S26 \\ | \\ C \end{array}$$

From which

1930

No trees available for marking

Set Squared Cedar post 5" x 5" x 10' long

36" in ground - cedar post set beside iron

30

61

Quarter Corner Bet. Sec's. 23-26

Notes of GLO Resurvey 1930

Record Distance

Set concrete monument 6" Dia. x 26" long  
with brass cap marked
$$\frac{1}{4} \frac{523}{526}$$

1930

From which

Ash 5 S79½W 791ks. = 52.1'

Ash 9 N79½W 2431ks. = 160.4'

id

Corner falls at SE end of ridge which extends  
N15°W



62 21-15

Center south  $1/16$  of section 27

Notes of GLO Resurvey 1930

Proportionate Distance.

Set iron post 1" Dia. x 36" long  
with brass cap marked

C  
S  $1/16$  | S 27  
C  
1930

From which

Birch C S  $33\frac{1}{2}$  E 42 lks. = 27.7'

Cedar C S  $45\frac{1}{2}$  W 37 lks. = 24.4'

5680-11 By MARTINSON & BRUNS, 1968

REFER TO Bk #1 Pg 13

63 A-25 Affidavit 8/29/78

Section Corner Closing Corner to Sects. 1-6

Notes of GLO Resurvey of 1930

Proportional distance

Set 6" Dia. X 24" long concrete cylinder with  
brass cap marked

Found concrete cyl. in place

in good condition

4" above ground

T145N R29W

S31

S1 | S6

R30W R29W

T144N

CC

1930

From which

Elm 24"

at brg.  $\frac{1}{3}$  dist.

Now rotted stump and log lying on ground

Oak 23"

Now oak stub pushed south of brg.  $\frac{1}{3}$  dist - scribe rotted

To perpetuate this corner I scribed new  
bearing trees as follows

W. Oak 13 S70E 55.85 T144N R29W S6 CC 8<sup>ft</sup>  
17" <sup>mkd.</sup>

Elm 10 S72W 38.4 T144N R30W S1 CC 8<sup>ft</sup>  
WINDFALL <sup>mkd.</sup>

on  
m. c. s.

Set 8' steel sign post S24E 4.3' w/ 54-2  $\frac{1}{3}$  54-4

Set 8' steel sign post due west 4.9' w/ 54-2  $\frac{1}{3}$  54-4

8-29-75 Curtis R. Hance

Corner is approx. 75' north of FR#2135

Put FSLP on Elm - corner is NO FSLP

6-27-00 R. MAIN

Fd MONUMENT IN PLACE, CLEAR CUT AROUND

CORNER 1975 ELM NOW A WINDFALL, 1975 OAK

NOW 17" PLACED A SAIKE ABOVE HEAD OF PREVIOUS

NAILO. NO FSLP @ FR 2135 PAINT OAK AND SIGN

POSTS RED AND GPS. UTM NAD 83 N=17198650.03 FT

E=1290619.705 FT



64 N-19

Quarter Corner Bet. Sec's 14-23

Notes of G.H.O. Resurvey of 1930

Proportionate Distance

Set 6" Dia. 24" long concrete monument  
with brass cap mkd.

Found 6" Concrete monument  $\frac{1}{4}$   $\frac{514}{523}$   
in good condition, and in place  
4" above ground 1930

From which

Elm 10" S49°W 321ks. = 21.1'

Now 17" Elm at brq  $\frac{1}{3}$  dist. - scar facing monument

Tam. 12 N50 $\frac{1}{2}$ W 211ks. = 13.9'

Now 20" W. Spruce at brq  $\frac{1}{3}$  dist. scar facing monument

Found old FSLP on W. Spruce BT dated 1934  
Put new FSLP on 7" Elm N34°E 14.5' from  
concrete monument

Corner in hardwoods with scattered birch -  
balsam and large Pine stand NW of corner  
low drainage 50' north of corner runs NE-SW

12-10-75

Curtis R. Krause



65 B-24 See page 15 Book #1

North east  $\frac{1}{16}$  in Section 1

Notes of GLO Resurvey 1930

Set iron post 1" Dia. X 36" long

with brass cap marked NE  $\frac{1}{16}$  S1

Iron & brass cap have been welded 1930

onto 8' steel sign post - set at true location

48" above ground at present time - very dry 9-15-76

From which

Tam. 11 S50E 71 lks. = 48.9'

Found Tam stp. 29" high with scribe visible - at brq  $\frac{3}{4}$  dist.

Tam 15 S65W 141 lks. = 93.1'

Found Tam. stp. 36" high with scribe visible - at brq  $\frac{3}{4}$  dist.

To perpetuate this corner we set steel sign posts to witness corner location.

There aren't any bearing trees - alive - within 600'-800' of corner

8' steel post dbl. S45W 20.80' w/FS sign 54-4

8' steel post dbl. N47W 55.45' w/FS sign 54-4

8' steel post dbl. N45E 56.70' w/FS sign 54-4

Set 8' steel <sup>dbl.</sup> post S15E 9.8' with FS signs 54-2 & 54-4

Set 8' steel <sup>dbl.</sup> post due east 3.0' with FS signs 54-2 & 54-4

9-15-76 Curtis R. Krause

sign post w/ brass cap - sets in low drainage area - through pipeline fill - when normal rainfall and impoundment is full, this corner maybe standing in 36" to 48" of water the old creek bottom is very soft and bottomless even now when it is dry - so caution should be used when approaching this corner at any time hereafter - the old creek bottom is approximately 6' to 10' east of corner monument south of corner the creek runs SW and north of corner the creek runs N-NE there are logs under silt in creek now - but they may rot away soon as they are aspen & birch



66 C-22

CW 1/16 cor. Sec. 1

## NOTES OF GLO RESURVEY OF 1930

SET IRON POST 1" DIA X 36" long w/ brass cap

9/27/03 project line south from NW 1/4  
and fd iron & brass cap in good  
condition. Left as found.

W 1/16 Cap is  
C — C 1' above grd.  
51

From WHICH:

1930

ASH 6" N 5° E 12 lks (7.92')

9/27/03 found 11" twin Ash w/ scribe inside westerly trunk at N 5° E  
7.9'. Tree was cut off 9/27/03 at 3' above grd. as leaning over line

CEDAR 10" S 14 1/2° E 20 lks (13.20')

9/27/03 found 10" cedar tip-up at S 14° E 13'. Scar visible.

9/27/03 Krause, Hayes, Brame, Allison

To perpetuate corner the following ties were made:

W. OAK 11" N 27° E 85.02 to 50d nail, single piece  
& scribed

Ash 6" N 22° W 67.97 to 50d nail, single piece  
& scribed

W. OAK 7" N 9° W 86.70 to 50d nail, single piece  
& scribed

ASH 7" S 30° E 35.29 to 50d nail, single piece  
& scribed

ASH 6" S 21° W 14.70 to 50d nail, single piece  
& scribed

8' long Steel Sign Post North 4.2' w/ signs 54-2 & 54-9

8' long Steel Sign Post West 4.45' w/ signs 54-2 & 54-9

9/27/03 Found FSLP on East twice of Ash BT (GLO) by  
MS & LM, 3/29/08 from which cor is S 5° W 11 lks.

Also N. BT tags on both GLO trees by MS & LM same  
date. Corner falls about ~~45'~~<sup>45'</sup> South of north edge  
of ASH-CEDAR SWAMP. At 550'± North of cor.  
old road bears N 60° W.

M. Hayes



67 A, B-22

SMC West Sixteenth Line Sec 1 S. Shore Sucker Lake

NOTES OF 1930 G.L.O. Resurvey

Corner is a 12" dia. Elm with scribing

SMC on north face and S1 on south face.

9/19/83 Position falls in lake. No evidence found

FROM WHICH:

ASH 13" S27°E 139 lks (91.7')

9/19/83 Decayed Ash roots S27°E 92'

Elm 10" S045°E 153 lks (101.0')

9/19/83 Elm 5" 13" (Easterly of twin elm) S1°E 101.0'

scribe sm visible on cut stump.

9/19/83 Krause, Allison, Branna

Also found the 1930 G.L.O. Resurvey Work line tree at 527.3' south of SMC position established from G.L.O. BT remains. This distance is the same as called for by G.L.O. (7.99 chs).


The scars from the two notches were visible on the north and south faces of the line tree.

A FSLP is on the tree. The distance from the reestablished SMC position (in lake) to the NW 1/4 sec. 1 was also measured (with EDM) and found to be 1040.76'. The G.L.O. record distance is 15.77 chs (1040.82').

68

9/27/83 Krause, Allison, Branna &amp; Hayes

To perpetuate this corner position which falls in the lake, a Witness Corner was set on line btwn. the SMC position and the line tree (and the NW 1/4 cor), a distance of 9.26' south of the SMC position. The monument is a 36" x 2 1/2" OD iron pipe, <sup>so varnished</sup> concrete-filled, w/ brass tablet stamped:

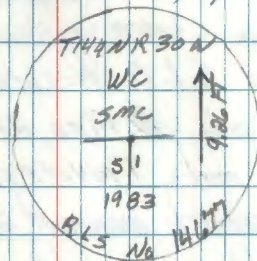

Iron is up 0.3' above ground and is 6' ± south of lake shore.


From which the following bear:

ASH 5" S85°E 30.62' to 50d nail, single blazed and scribed W.C. SMC S1 BT.

ASH 5" S163°E 69.43' to 50d nail, single blazed and scribed W.C. SMC S1 BT.

ASH 6" S28°E 93.05' to 50d nail, single blazed and scribed W.C. SMC S1 BT.

B'long Steel Sign Post North 2.55' w/sign 542' 54.9'

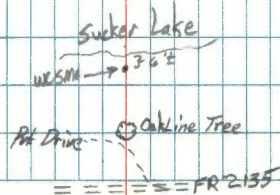

W.C. SMC is 660' ± north of FR 2135



68

E-21

CORNER TO SECTIONS 1-2-11-12

Notes of the original govt. survey by B.C. Baldwin  
in July-Aug., 1875:

Set post for corner.

Jack Pine 9" S78°W 148 lks

Jack Pine 14" S47°E 71 lks

Jack Pine 10" N37°E 56 lks

Jack Pine 6" N87°W —

Notes of the G.L.O. Resurvey in 1930:

Fd. an. orig. N. Pine, 22" N37°E, 56 lks  
with marks T144 R30W S1 visible (added a  
new BT)Set a concrete monument 26" long, 6" dia, 22" in  
grd., w/ brass cap mkd:

T144	R30W
S2	S1
S11	S12
1930	

from which new bearing trees:

Oak 5" S 64<sup>1</sup>/<sub>4</sub>°E 174 lks (scribed)NOW TWIN N. OAKS 9<sup>1</sup>/<sub>4</sub>" S 64°E - 114.84 SCAR ON FACE -  
BEAVER HAVE CHEWED + PORCUPINE CHEWED ON POINT OF ISLANDMaple 9" S 66<sup>3</sup>/<sub>4</sub>°W 137 lks (scribed)J. Pine 14" N 68<sup>1</sup>/<sub>4</sub>°W 97 lks (scribed)FAIRLY SOLID AT N 68W - 64.02'  
NOW DEAD J. PINE STUB 18" X 35' HIGH SCRIBE VISIBLE

3-10-94 RMYCK

FD. CONCRETE MONUMENT - IN PLACE - 4" ABOVE GROUND  
IN HEAVY BRUSH - SCATTERED ASPEN + BIRCH - AT SE  
END OF ISLAND

ORIG N. PINE 26" N37°E - 36.71' - RE-SCRIBED BT

N. OAK 12" S3°E 46.55ft to Spk Mkd: S12 BT  
8' STEEL SIGN POSTS NORTH 3.80' + SOUTH 4.35'



QUARTER CORNER TO SECS. 1-12  
 NOTES OF THE ORIGINAL SURVEY BY B.G. BAUDWIN  
 IN JULY-AUG., 1875:

SET POST FOR  $\frac{1}{4}$  CORNER.

CEDAR 6" N 13° W 10 lbs

CEDAR 6" S 36° W 18 lbs

NOTES OF THE 1930 G.L.O. RESURVEY:

Fd. CEDAR 8" S 30° W 18 lbs w/scribe  $\frac{1}{4}$  BT

CEDAR 10" N 5° W 10 lbs w/scribe marks

Set an iron post 3' long, 1" dia., 30" in ground, w/brass  
 cap mkd:

$\frac{1}{4}$  51  
 512  
 1930

from which a new BT:

" CEDAR 8" N 42° W 34 lbs scribed  $\frac{1}{4}$  51 BT



SOUTH  $\frac{1}{4}$  corner to Secs. 1-2

Notes of the 1930 G.L.O. Resurvey.

True point for  $\frac{5}{16}$  cor. secs. 1-2

falls in creek. At  $N 2^{\circ} 33' E$ , 26 lks,  
which is on the sec. line, set an iron post,  
3' long, 1" diam., 30" in grd. w/ brass cap mtd  
for a Witness Corner:

WC

$\frac{5}{16}$

52 | 51

1930

No trees available for marking. Along side  
post set a cedar stake, 5" x 5" top, 10'  
long, 3" in grd. On bank of creek - right bank.

3-14-94 RMYCK

Fd. IRON & CAP - IN PLACE - IN MARSH GRASS  
PLACED 8' STEEL SIGN POST ALONG SIDE IRON  
4" ABOVE ICE IN MARSH  
8' STEEL SIGN POST SOUTH 20.0'  
75' EAST OF IRON TO CREEK BANK  
58' SOUTH OF IRON TO CREEK BANK

WEST  $\frac{1}{16}$  COR. SECS. 1-12

Notes of the 1930 G.L.O. Resurvey:

Set an iron post, 3' long, 1" diam., 30" in ground  
w/ brass cap mkd:

w/No	51
	512
	1930

From which bears:

CEDAR 9" S15°W 24 lbs scribed  
w/No 512 BT

CEDAR 6" N24°W 14 lbs scribed w/No 51 BT

Notes from USFS form 874-9 by Harold Henries,  
dated 12-4-36, Fd. capped metal pipe 6"  
above grd. Fd. scribed Cedar BT S15°W 25 lbs.



SOUTH WEST  $\frac{1}{16}$  COR. SEC. 1

Notes from the 1930 G.L.O. Resurvey:

Set an iron post 3' long, 1" diam, 30 in. grad,  
w/ brass cap mtd:

SW  $\frac{1}{16}$   
51  
1930

From which bears:

Birch 8"  $S 32^{\circ} 14' E$  46 lbs mtd SW  $\frac{1}{16}$  51 BT

Cedar 10"  $N 8^{\circ} 2' W$  35 lbs mtd SW  $\frac{1}{16}$  51 BT

Notes from USFS form 874-9 by Lloyd Folsom dated  
Dec. 2 1936. Fd. metal pipe in good condition,  
4" above grad. Fd. scribbled Cedar 10"  $N 9^{\circ} E$  35.5 lbs  
and a Birch 8"  $S 35^{\circ} E$  45.5 lbs.

Notes from U.S.F.S. form R9-7150-4 by Larry Martinson  
dated 1969. Fd. brass cap and Cedar stump  
 $N 8^{\circ} W$  35 lbs.



73

QUARTER CORNER BETWEEN SECTIONS 1 &amp; 2

NOTES OF ORIG. GOV'T. SURVEY: 1875

SET WOOD POST

W. PINE 36 S85W 570 LKS. = 376.2'

W. PINE 24 N16½E 750 LKS. = 495.0'

GLO RESURVEY 1930

RESTORED CORNER FROM ORIGINAL BEARING TREES

WHITE PINE STUMP 26" N17½E 750 LKS.

STUMP BURNED AND ROTTED - NO MARKS VISIBLE

WHITE PINE STUMP 36" S86°39'W 590 LKS.

STUMP BURNED - NO MARKS VISIBLE

SET 1" X 36" LONG IRON POST WITH BRASS

CAP MARKED 10/24/85 CK-68-JA  
10/24/85 CK-68-JA  
IRON & CAP IN PLACE ¼

IN GRASS SWAMP 12" ABOVE SWP. 52 | 51

NO BT'S, SEARCH FOR AT THIS TIME 1930

N. PINE 16 N40E 751 LKS. = 495.7'

BIRCH 12 S86°36'W 545 LKS. = 359.7'

CC DONE CK

10/24/85

RAN LINE AT N88E FROM CE 1/16 OUR LINE FELL

30' SOUTH OF IRON - LINE SHOULD BE RUN AT N87E

PUT FSLP ON 13" WHITE OAK (TWIN) CORNER IS 589E

98.5' FROM TAG

OLD BLAZED LINE RUNS BETWEEN ¼ COR &amp; CE 1/16

3-14-94 RM + CK

FD, IRON &amp; CAP IN PLACE - 4" ABOVE ICE - IN MARSH GRASS

35' SW OF SUCKER CREEK E &amp; N

100'± EAST OF HIGHLAND RIDGE N &amp; S

WITNESSED BY

W. OAK 11" N48W - 167.40 MKD ¼ 52 BT

TRIPLE - E STEM  
W. OAK 14" N88W - 99.80 MKD ¼ 52 BT

8' STEEL SIGN POSTS SOUTH 4.0 &amp; EAST 4.3'



74

MEANDER CORNER BETWEEN SECTIONS 142

NOTES OF ORIG. GOV'T. SURVEY 1875

SET WOOD POST

BLK. ASH 8 S61E 40 LKS. = 26.4'

ELM 12 S13W 33 LKS. = 21.8'

NOTES OF G.L.O. RESURVEY 1930

RESTORED FROM ORIGINAL BEARING TREES

ASH STUMP 9 S59E 40 LKS. STUMP BURNED

NO MARKS VISIBLE

ELM STUMP 24 S13W 33 LKS. STUMP BURNED

NO MARKS VISIBLE

AT A POINT 27 LKS. SOUTH SET WITNESS CORNER

SET 1" X 36" LONG IRON POST WITH BRASS CAP

MARKED Fd. IRON &amp; CAP IN PLACE

LEANING SOUTH AGAINST BANK

30" HIGH - BASE IS IN PLACE - BASE

IS IN LAKE SAND - SHOULD BE STABILIZED

ASH 8 S35E 199 LKS. = 131.3'

NOW ASH WINDFALL ROTTED WITH BASE WINDOW VISIBLE

OAK 5 S70W 48 LKS. = 31.7'

NOW LIVE 8" W. OAK HAS BEEN CHOPPED INTO AND FOUND

NEGATIVE SCRIBE - SCRIBE AREA IS ROTTEN

CC DONECK

10/24/85

Fd. IRON WITH BASE IN LAKE SAND - BANK HAS

ERRODED BADLY IRON IS LEANING SOUTH ON BANK

GARY STEVENSON HAS A REFERENCE MONUMENT

2" X 2" WITH ALUM. CAP 3.0' SOUTH OF GLO MONUMENT

STRENGTHEN GLO MONUMENT AND MAKE TEMP TIES

ASH 10 S82W 42.95' MMD WCMC S2 BT

ASH 13 N75E 9.25' " BT

ELM 6 S37E 31.95' " BT

OLD FENCE LINE RUN SOUTH FROM MC WIRE &amp; POSTS

DOWN UNTIL HIGH GROUND THEN WIRE AND POSTS

ARE VISIBLE

CHAINED AT S1W 547' AND FOUND USE BENCH MARK

IRON &amp; CAP IN PLACE 4" ABOVE GROUND 4' WEST OF FENCE

LINE - FENCE END JUST SOUTH OF THIS AREA APPROX. 20'

WILL COME BACK WITH SIGN POST &amp; SIGN LATER

MC
52   51
T144N   R30W
WC
1930



75.

SPECIAL MEANDER CORNER ON EAST  $1/16$  LINE

AT SUCKER LAKE IN SECTION 2

NOTES OF GLO RESURVEY 1930

SET 1" X 36" IRON POST WITH BRASS CAP MID.

10/24/85 CK-GB-JA

FD. IRON CAP - IN PLACE - IN SAND

SHORE LINE - CAP IS 30" HIGH AND

MONUMENT WAS LEANING SOUTH AGAINST

BANK - STRAIGHTEN UP AND CHECKED TIES

CEDAR 8 S52 $1/2$ E 50 LKS. 33.0'

NOW QUAD CEDAR 11" S58E 33.0' SCRIBE VISIBLE

CEDAR 12 S64 $1/2$ W 50 LKS. 33.0'

NOW TWIN CEDAR 14" S61W 33.65' SCRIBE VISIBLE

CC DONECK

NEED TO STABILIZE WITH 8' STEEL POST SOMETIME

SOON AS BANK IS ERODING BADLY

MID NEW TIES

CEDAR 8 S21E 66.45' MID SMC S2 BT

ASH 7 S60E 18.20' " BT

CHAINED SW AND RT 661'  $1/4$  OF FR 2135

WILL PLACE TAG LATER

6/9/86 GB, JA

Placed a F.G. sign post 4.1' south of corner. Reset GLO mon. to 6" above ground and braced with a 6' sign post on north side. Line to standard goes south.



76

## CENTER EAST 1/16 SECTION 2

NOTES OF GLO RESURVEY 1930

SET 1" X 3/16" IRON POST WITH BRASS CAP MKD.

10/24/85 CK-JA-GB

FDL IRON &amp; CAP IN PLACE

10" ABOVE GROUND AT BASE OF 8" ASH

CEDAR: 10 N79E 16 LKS, 10.6'

NOW 18" CEDAR, N79E 10.6' SCRIBE VISIBLE

CEDAR: 20 S21 1/2 E 46 LKS, 30.4'

NOW LARGE CEDAR WINDFALL S21 E 30.4' SCRIBE VISIBLE

CC BONICK

CORNER FALLS IN ASH &amp; BALSAM AREA

CHAINED FROM SMC TO NORTH TO CE 1/16 1744'

GROSS FR #2135 AT 661' SOUTH OF SMC

MARKED NEW TIES

ASH 7 N34W 29.73' MKD. CE 1/16 S2 BT

ASH 7 S58E 33.50' " CE 1/16 S2 BT

PUT FSLP ON ASH 8" SOUTH 0.9' SPIKE

6/9/86 JA, GB

MKD. NEW BT W. Oak 7' N60E 32.55'

Scribed CE 1/16 S2 BT

8' F.G. sign posts north 3.70' + west

4.1' with signs. Line to std. goes

west and north from corner.

77

CENTER QUARTER TO SECTION 2

NOTES OF GLO RESURVEY 1930

SET 1" X 36" IRON POST WITH BRASS CAP MKD

3/18/81 GB-CK

C/4 S2

FD. IRON CAP IN PLACE 12" ABOVE GRD. 1930

W. PINE 12 N74E 22 LKS. 14.5'

NOW 17" W. PINE, N74E 14.5' SCRIBE VISIBLE - ROTTING INSIDE  
RESCRIBED BT

W. PINE 14 N24W 8 LKS. 5.3'

NOW 19" W. PINE, N24W 5.3' SCRIBE OVERGROWN  
RESCRIBED BT

MKD NEW BT'S.

N. PINE 23 SSE 132.68' MKD C/4 S2 BT

N. PINE 19 N50E 102.58' " C/4 S2 BT

8' STEEL SIGN POSTS NORTH 3.7' & EAST 4.5' <sup>BOTH</sup> SIGNS

CC

WOODS TRAIL N4S 15 WEST OF COR. 125'

6/9/86 Line to std. goes east from corner.



78

## CENTER QUARTER CORNER OF SECTION 1

## NOTES OF GLO RESURVEY 1930

SET 1" X 3/16" IRON POST WITH BRASS CAP MARKED

9/4/87 CK

FD. IRON &amp; CAP IN PLACE - IN GOOD COND. C 1/4 S 1

8" ABOVE GROUND - 170' WEST OF NEW ROAD 1930

#2135Z STA. 20+70 SMALL WET SLOUGH 50' SW OF CORNER

N. PINE 12 S 18 3/4 E 82 LKS. = 54.12'

NOW 24" N. PINE AT S 19 E 54.12' SCRIBE OVER GROUND

N. PINE 16 S 18 3/4 W 170 LKS. = 112.20'

NOW PINE STUMP ROTTED S 19 W 112.2'

## MARKED NEW BTs.

N. PINE 12 N 84 E 99.75' MKO C 1/4 S 1 BT

W. OAK 10 N 11 E 47.50' C 1/4 S 1 BT

W. OAK 5 S 52 E 55.00' X BT

8' FG. SIGN POST DUE NORTH 3.4' WARNING STICKER

8' STEEL SIGN POST DUE SOUTH 3.7' WARNING SIGN

CC DONE

CORNER IS ON SLIGHT PINE RIDGE - SMALL GRASS SLOUGH

50' SW OF IRON - NEWLY CONSTRUCTED ACCESS ROAD

N+S FR #2135Z IS 170' EAST OF CORNER

PUT FSLP ON 11" <sup>BIRCH</sup> ON WEST SIDE OF N+S ROAD - CORNER  
IS 58' W 154'