


CORNER RESTORATION

BETWEEN SECTIONS 1 & 2, T.142N, AND SECTIONS 35 & 36, T143N, R25W, 5th P.M.
CASS COUNTY, MINNESOTA

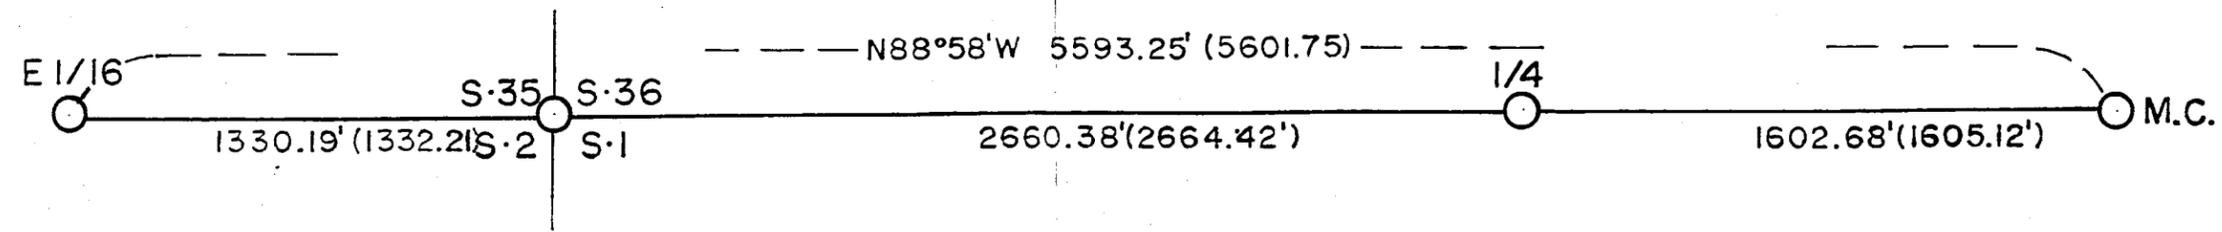


E 1/16 to Sections 35/2, T143 & 142N, R25W, 5th P.M.
Established by BLM, 1976: Set a 2½" x 28" aluminum post, 24" in ground/2 BTs:
10" Tamarack, N88°E, 30 lks. (19.80')
8" Ash, N14°W, 44 lks. (20.04')
1/17/2000 - I found the BLM monument and BTs in excellent condition.

Section Corner to Sections 1 & 2, T143N, R25W, 5th P.M.
This corner was established by Walker, Allen & Putman in 1871.
1976 - BLM searched for this corner and declared it to be lost. No monument was placed.
4/10/2000 - I ran an EDM, T-2 traverse from the M.C. on the West shore of Willow Lake to the East 1/16 Corner between Sections 35/2. At the proportional distance I restored this corner on line. The M.C. bears South 88° - 58' East, 4263.06 feet and the East 1/16 bears North 88° - 58' West, 1330.19 feet. I set a 2" x 30" iron pipe with four BTs:
10" Black Ash, S85°E, 24.53'
10" Sugar Maple, S05°W, 35.26'
10" Basswood, S70°W, 25.68'
3" Sugar Maple, N27°W, 33.80'
A very old location poster bears S45°W, 63' on a 10" Basswood.

1/4 Corner to Section 36/1, T143 & 142N, R25W, 5th P.M.
This corner was established by Walker, Allen & Putman in 1871.
1976 - BLM searched for this corner and declared it to be lost. Position falls in a 25' deep road cut in the construction of State Hwy. #6. No monument was placed.
4/10/2000 - I ran an EDM, T-2 traverse from the M.C. on the West shore of Willow Lake to the East 1/16 between Sections 35 & 2. At the proportional distance I restored this corner on line. The M.C. bears South 88° - 58' East, 1602.68 feet and the East 1/16 bears North 88° - 58' West, 3990.57 feet.
I set a 2" x 30" iron pipe in cairn of stone with two BTs:
6" White Birch, N42°W, 11.27'
5" White Birch, N16°W, 5.60'

Meander Corner to Section 36/1, T143 & 142N, R25W, 5th P.M.
This corner was established by Walker, Allen & Putman in 1871.
1966 - RLS #6807 perpetuated from original evidence. Set a 2½" x 60" iron post/brass tablet and two BTs:
10" Birch, N66°W, 125 lks (82.50')
7" Elm, N25°W, 87 lks (57.42')
1976 - BLM found iron post and BTs in good condition.
1/17/2000 - I found iron post tipped over and nearly horizontal. Both BTs are rotted stumps. Also, found scribed cedar post lying under water - with base near iron post. I reset the iron post from 1966 BTs and made three new BTs:
7" Red Maple, N62°E, 41.82'
6" Black Ash, S83°W, 40.78'
8" Red Oak, S71°W, 59.20'

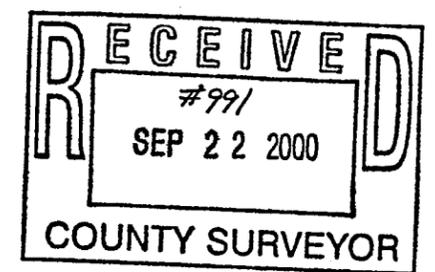

7/28/2000