

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 17, Township 141, Range 29, 5th P.M.

STATE OF MINNESOTA, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 6-17-81 placed a 2" x 24" concrete filled galvanized iron pipe
DATE
with marked brass cap down 1 foot.

SKETCH OF REFERENCE TIES

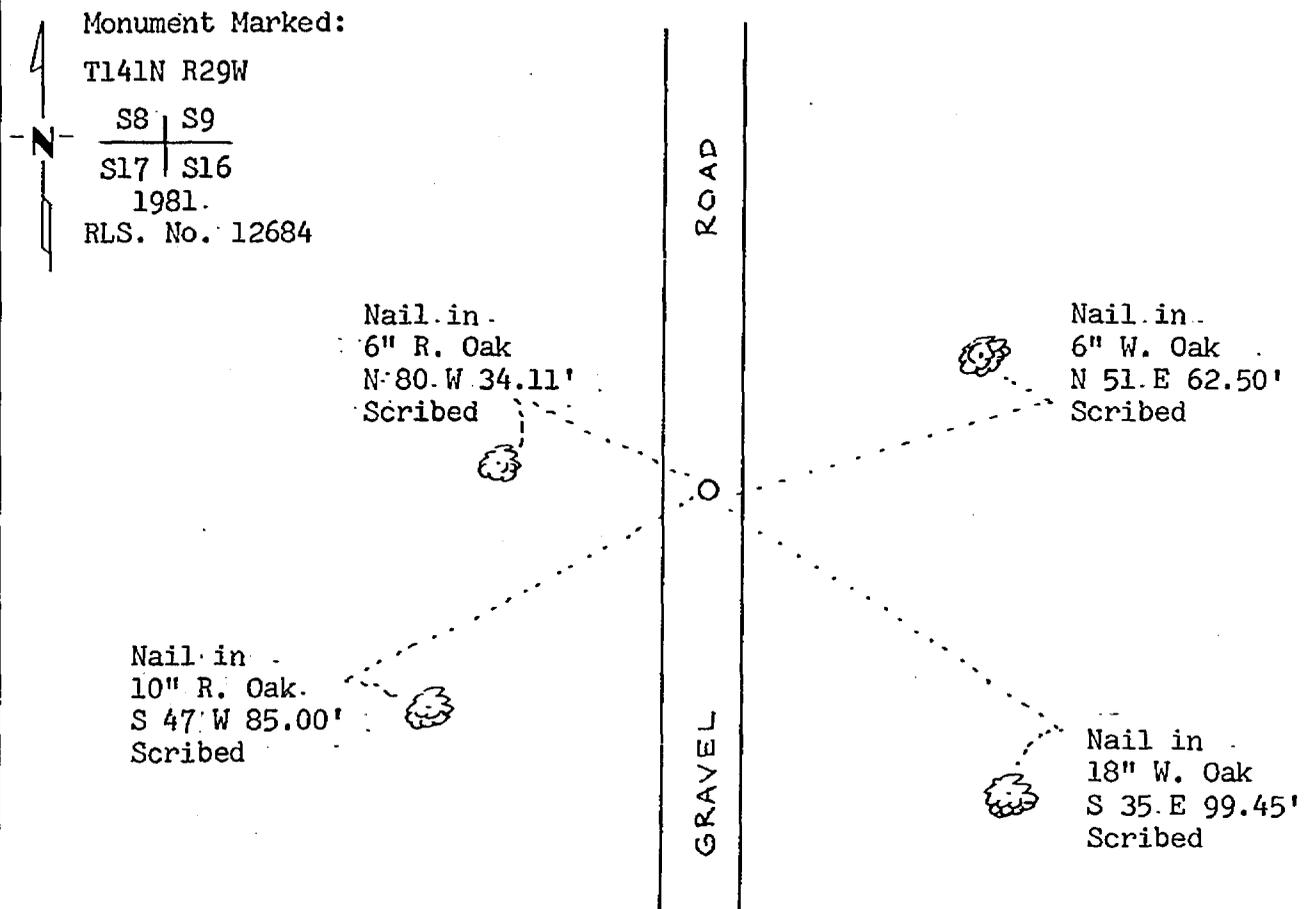

BEARINGS ARE APPROXIMATE

Statement of evidence relative to this corner location is on back of page.

260988

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Amy H. Stevenson
SIGNATURE

12-23-81
DATE

Registration No. 12684

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of Cass

I hereby certify that this document was filed in the Co. Recorders office at 9:22 A.M. on the 31 day of Dec. A.D., 1981

County Recorder Beverly Hardin

By MS, Deputy

DOCUMENT NO. 260988

Statement of Evidence:

- 1873 U.S. General Land Office survey set wood post for this corner and marked the following bearing trees: 7" Oak N 73 E 18 links, 24" Oak N 74 W 22 links, 24" Oak S 62 W 26 links, and 6" Maple S 51 E 6 links.
- 1918 U.S. General Land Office dependent resurvey found the corner marked by the remains of a decayed wooden stake and evidence of the 4 original bearing trees as follows: 12" Oak stump N 73 E 18 links marked BT, 10" decayed Maple stump S 51 E 6 links, 24" Oak, down, S 62 W 26 links, and 24" Oak, down, N 74 W 22 links, blaze marks. An iron pipe with a marked brass cap was set to mark the corner. The following bearing trees were marked: 16" Oak N 70-45 E 105 links, 8" Poplar S 24-45 E 58 links, 10" Maple S 64 W 69 links, and 10" Poplar N 40-30 W 73 links.
- 1981 USFS technician C. Krause found no evidence of the GLO monument or bearing trees.

Under my supervision, a traverse was run by C. Krause to known corners east, west, south, and north. The following corners were tied into the traverse: North $\frac{1}{4}$ of Sec. 17, East $\frac{1}{16}$ of Sec. 8 & 17, East $\frac{1}{4}$ of Sec. 8, West $\frac{1}{16}$ of Sec. 9 & 16, North $\frac{1}{4}$ of Sec. 16, and SE of Sec. 17. Also searched for but not found was the $\frac{1}{4}$, $\frac{1}{16}$, and angle point corners along the east line of Sec. 17 and the South $\frac{1}{16}$ corner between Sec. 8 & 9. After analysis of the traverse information, I determined the position of this corner by double proportion methods. At this position, a 2" x 24" concrete filled galvanized iron pipe with a marked brass cap was set. Four bearing trees were marked and are shown on this certificate. Traverse information is on file in the office of Gary Stevenson & Associates, Inc. in Walker. All distances to known corners fit within $\frac{1}{2}$ foot of the record 1918 GLO survey distances. Corner falls in center of north-south road.

- 1981 County Surveyor's Records in the Recorder's Office were checked and no resurvey information was found on this corner.