



8 0 0 9 9 0 4

Tx: 4007001

A000561975

**OFFICE OF COUNTY RECORDER
CASS COUNTY MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON
07/20/2010 12:31:07 PM
AS DOC #: A000561975
PAGES: 2 REC FEES: 0.00
KATHRYN M. NORBY
COUNTY RECORDER**


Index No. A-25

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 1, Township 140 N, Range 31 W
5TH Principal Meridian, State of Minnesota, County of CASS

At the corner location shown on the sketch:

- On _____ found a _____
DATE _____
- left monument as found, lowered monument, removed monument (explain)
- On 3/2006 Computed a POSITION FOR THE CORNER AND SET NOTHING
DATE _____

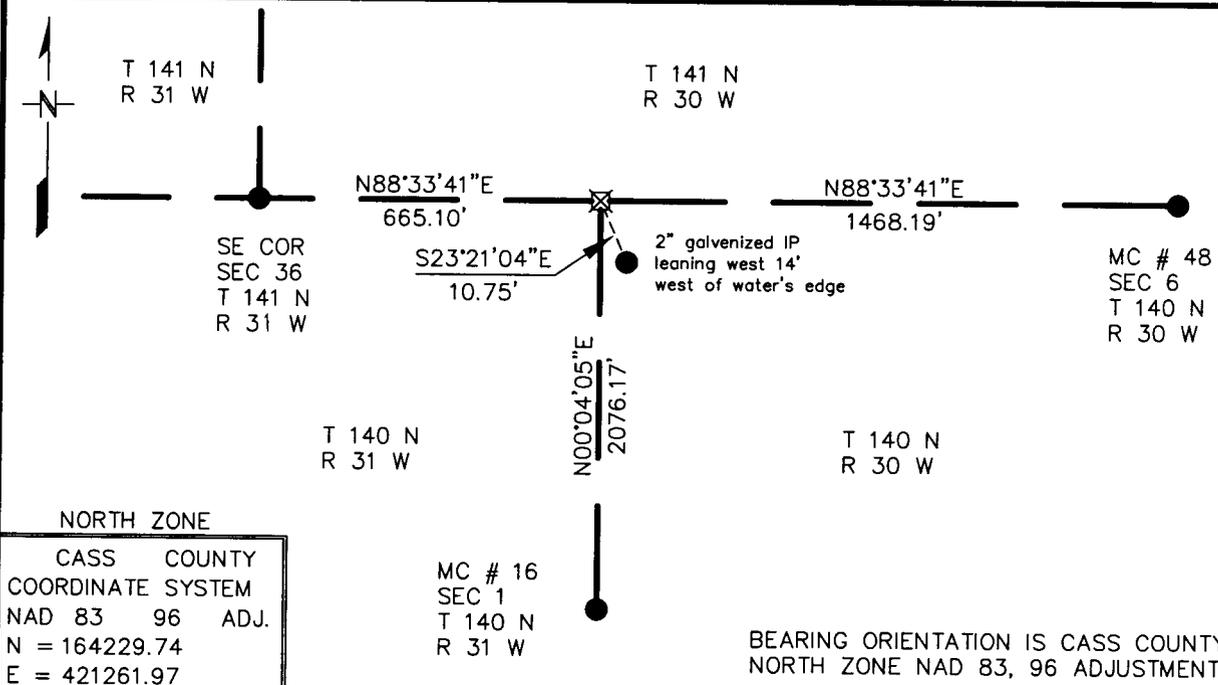

Statement of evidence for this corner location is on back of this page.

SEPTEMBER 2006
AMA00119

I certify that this document was researched and prepared by me or under my direct supervision.

SIGNATURE *John D. Walker* DATE 9/11/06 License Number 16098

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Northeast Corner Section 1, Township 140 North, Range 31 West

The Department of Natural Resources, Division of Lands and Minerals, contacted the following offices for information regarding this corner:

MN Secretary of State
 Minnesota Department of Transportation
 Cass County Surveyor's Office
 Landecker & Associates, Inc.
 Northern Lights Surveying and Mapping
 Cass County Recorder's Office

- 1865 The US General Land Office field notes, on file in the Secretary of State's Office, show this corner to be a computed position as it fell in the lake. GLO ran the east line of Section 1 and set a post for Meander Corner # 18 at 35.77 chains (2360.82') north of the east quarter corner. Then ran N 4 1/2° W 1.86 chains (122.76') to intersect the Standard Parallel 9.80 chains (646.8') east of the southeast corner of T141N R31W. to Meander Corner # 19. The calculated northeast corner of Section 1 is 9.94 (656.04') chains east of the southeast corner of T141N R31W and 37.63 chains (2483.58') north of the east quarter corner.
- 1915 A resurvey of Section 36 T141N R31W, by County Surveyor, John Curo, shows a distance of 646.93' from the southeast corner of Section 36 to MC # 19 and 2137.03' to MC # 48.
- 1923 A resurvey of Section 6 T140N R30W, by County Surveyor John M. Greene, shows a 2" x 48" iron monument for the corner and is shown as the closing corner. A distance of 656.1' is shown to the southeast corner of T141N R31W, 1469' to MC # 48, and 2077.2' to MC # 16.
- 1957 Harold Curo's field notes show a distance of 735.59' from the southeast corner of T141N R31W to this corner.
- 1982 MNDOT section subdivision of Section 6 T140N R30W, lists the corner to be in the lake. A distance of 2486.06' is listed to the west quarter corner of Section 6 and 2461.52' to MC # 50.
- 1991 Northern Lights Surveying and Mapping for a survey of Federal lands in T141N R30W, measured a distance of 2123.06' from the southeast corner of T141N R31W to MC # 48 on the south line of Section 31. No mention of anything found for this corner.
- 2005 In September through December, the DNR survey crew for a survey in Section 1 T140N R31W, located the southeast corner of T141N R31W, MC # 48 and MC # 50 of T140N R30W, the east quarter corner, MC # 16, and a 2" galvanized capped iron pipe, leaning to the west in the swampy area near the lake shore in the vicinity of the northeast corner of Section 1. The distance measured from the found pipe to MC # 16 is 2066.3'; 2475' to the east quarter corner of Section 1; 660.19' to the southeast corner of T141N R31W; and 1464.2' to MC # 48. The iron monument is in the vicinity of the corner but it doesn't fit the other monuments in the area and seems to have been moved or set wrong. Therefore a position was calculated using the 1923 distance of 656.1' from the southeast corner of T141N R31W, and online between the southeast corner of the township and MC # 48. Nothing was set as the ground is unstable.
- Southeast Corner T141N R31W bears S 88°33'41" W 656.10'
 MC # 48 bears N88°33'41"E 1468.19'
 MC # 16 bears S00°04'05"W 2076.17'
 East Quarter Corner Section 1 bears S00°25'50"W 2485.83'
 Found 2" galvanized capped iron pipe bears S23°21'04"E 10.75'

For more information on our survey in this area, please contact MN DNR, Division of Lands and Minerals, Survey Section, 1601 Minnesota Drive, Brainerd, MN 56401