



A000608283

OFFICE OF THE COUNTY RECORDER
CASS COUNTY, MINNESOTA
CERTIFIED, FILED, AND/OR
RECORDED ON

12/18/2014 10:49:07 AM

AS DOC #: A000608283

PAGES: 2

REC FEES: 0.00

KATHRYN M. NORBY
CASS COUNTY RECORDER

BY SR _____ Dep

Twp 142 Rge 27 Index No. A.0-03.0

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


North Quarter Corner of Section 6, Township 142 N., Range 27 W., 5th P.M.
State of Minnesota, County of Cass

At the corner location shown on the sketch:

On 19 June 2009 found USFS Brass cap in concrete cylinder, down 1.8 feet,
on centerline of Boy Lake Drive.

left monument as found lowered monument removed monument (explain)

On 5 Dec 2014 placed a Magnetic nail, 1'± South of the new centerline of
Boy Lake Drive.

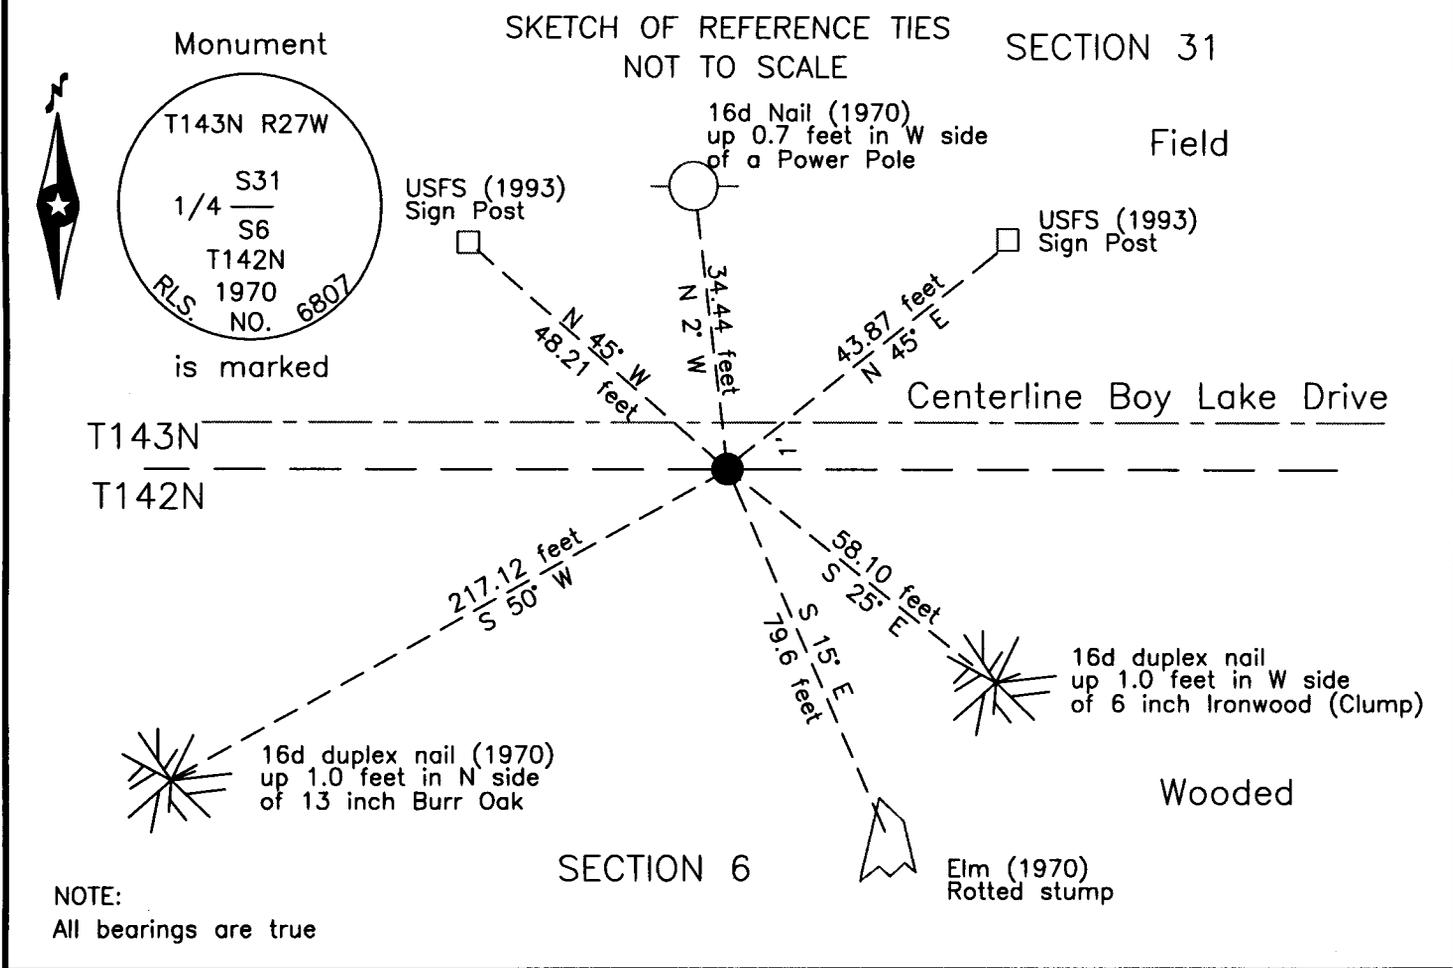

Statement of evidence relative to this corner location is on the back of this page.

I hereby certify that this survey, plan or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the State of Minnesota.

Terry L. Freeman, Cass County Surveyor
Date 12/17/14 MN License No. 21367



**Index No. A.0-03.0**Statement of Evidence**North Quarter corner Section 6, Township 142 North, Range 27 West, 5th Principal Meridian.**

- July, 1873 P.H. Conger, GLO Deputy Surveyors, in the notes of the Township line between Townships 142 and 143, set a post for the original corner and referenced it as follows:
5" Sugar Maple N 61 1/2° W 13 links (8.58 feet) 6" Birch S 45° E 5 links (3.30 feet)
- Sept, 1873 W.P. Allen, GLO Deputy Surveyors, in the notes of the subdivision of Township 143 North, Range 27 West, reran the south line of said Township and notes "The line bet Secs. 6 & 31 remains unchanged." The above record is on file with the Minnesota Historical Society in St. Paul, Minnesota, copies are filed with the Cass County Highway Department, Surveyor's Office (CCHD/SO).
- Circa 1903 H. Dunaway, Surveyor, United States Army, Corps of Engineers (COE), Leech Lake Reservoir Map, on file with the United States Department of Agriculture, Forest Service (USFS) offices in Cass Lake, MN, by symbol indicates this to be a known corner.
- 1920 E.G. Harrington, U.S. Cadastral Engineer, assisted by D.B. Clement, U.S. Surveyor, GLO, Reestablishment of a portion of the Exteriors and Subdivisional Lines Township 142 North, Range 27 West, on file with the Minnesota Historical Society in St. Paul, Minnesota, copies are filed with the CCHD/SO, states "The true point for the ¼ sec. cor., which is reestablished from the original bearing trees. Set an iron post, 3 ft. long, 1 ins. diam., 26 ins. in the ground, for the ¼ sec. cor. with brass cap". Lists the following original witnesses:
15" Maple stump N 61 1/2° W 13 links (8.58 feet) mkd. B T.
Birch stump decayed S 45° E 5 links (3.30 feet) no marks
The following new witnesses are listed: 10" Ash S 34 1/4° E 143 links (94.38 feet)
- Aug. 1921 Survey Record Book C, Record No. 462, page 434, on file in the CCHD/SO, pictorial indicates I.M. set by U.S.G.L.O. Survey.
- June 1970 C. Krause, technician, United States Department of Agriculture Forest Service (USFS), T 143N R 27 W Book 2, page 27, on file in the USFS Cass Lake Office, states "Found iron post, cap broken off in road." Also remains of bearing trees. And further states "To perpetuate this corner I set a 6" dia. 24" long cylindrical concrete monument 8" below surface of road with a 3" dia. Brass tablet" and witnessed as follows:
9" Elm S 15° E 79.6 feet 8" Power Pole N 2° W 34.4 feet
6" Oak S 50° W 217.3 feet 4" Cedar Post North 30.5 feet
- Sept 1975 W.H. Okerman, LS 6807, USFS, states "Found 32" of Iron post with cap broke off in CL of County Road 5# ____ Fence line runs south of corner. FSLP on 6" cedar post 23' south of CL." A Certificate of Location of Government Corner was filed in the Cass County Recorders Office (CCRO) as Document Number 222940.
- March 1993 C. Krause and R. Main, technicians, USFS, T143N R27 W Book 2, page 27, on file in the USFS Cass Lake Office, states "Found accessories in good condition except Elm S15°E 79.6 ft is now a stub +/- 8 ft high", also "Fd concrete cylinder 1.4 ft below Road Surface...placed magnet on East side of monument 2 ft below road surface" and added the following:
8' Steel Sign Post N 45° E 43.87 feet 8' Steel Sign Post N 45° W 48.21 feet
- June 2009 B. Hippen, technician, records of the CCHD/SO, found USFS brass cap in concrete cylinder, down 1.8 feet, on centerline of Boy Lake Drive, a 90d spike found during excavation was reset over monument and added witnesses as follows:
13" Oak S 50° W 217.12 feet (1970) 6" Ironwood Clump S 25° E 58.10 feet
- Dec. 2014 B. Hippen, technician, records of the CCHD/SO, set a mag nail over brass cap, 1 foot, more or less, South of the new centerline of Boy Lake Drive, the 2009 witnesses are all good.
The monument, recovered and established references for the position are shown on the face of this document.

Analysis of the recovered record data, field evidence and survey measurements, indicates that the monument recovered by CCHD/SO in 2009 is the correct perpetuation of this corner.

County Coordinates (Cass County North)

Northing 227562.48

Easting 517221.63