


T. 135 R. 32 M. 5TH Coordinates: X _____ Y _____
NE 15 Corner common to sections 10, 11, 14, 15

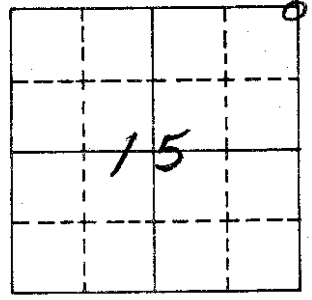

EXISTING SURVEYS

Original Government Survey
 Year surveyed 1866
 Original monument Post

Species	Bearing	Tree	Distance
<u>Y. Pine</u>	<u>Y. Pine</u>	<u>Y. Pine</u>	<u>Y. Pine</u>
<u>20"</u>	<u>16"</u>	<u>22"</u>	<u>14"</u>
<u>S30E</u>	<u>N33E</u>	<u>S87E</u>	<u>N15 1/2 W</u>
<u>25 LKS</u>	<u>67 LKS</u>	<u>77 LKS</u>	<u>91 LKS.</u>

Original Evidence Found
 Year of search _____ By _____
 Monument found _____

Original Bearing Trees Found
 Species _____
 Diameter _____
 Bearing _____
 Distance _____

Subsequent Corner Restoration
 Year surveyed 1915 By E.B. HOUST
 Location filed COUNTY BOOK "C" P. 47
 Monument FIND IRON PIPE & ROOTS OF COTT. BT: 16" Y. PINE N33E 67 LKS SET 1 1/2 X 40" I.M. 1915, BRYANT, BOOK "C" P. 72 SET CORNER. also on microfilm - roll 115 BK 71 P. 87, 88

Species	Bearing	Tree	Distance
<u>SW. COR. SCHOOL</u>	<u>NE CORNER</u>	<u>N.W. COR.</u>	
<u>HOUSE PORCH</u>	<u>ELVIS STORE</u>	<u>CHURCH</u>	
<u>N32.45E</u>	<u>S54.25W</u>	<u>S53E</u>	
<u>183.3'</u>	<u>52.7'</u>	<u>72.9'</u>	

Evidence of Subsequent Corner Restoration
 Year of search _____ By _____
1915 - also on microfilm - roll 115 BK 71 P. 120
This corner set by Hallet or Whiteley - does not check with Bryants corner P. 127-128 set I.P. & take new bearings

Bearing Trees, Reference Objects

Subsequent Corner Restoration
 Year surveyed 1985 ~~8/26~~ By Terry Freeman
 Location filed _____
 Monument Find 1 1/2" I.P. down 0.1' in intersection rds N-S & W also find 1915 ties! SW cor. of bottom step school (town hall now) N32°E 183.3', rock foundation - NW cor church S53E 72.9' NEW P.P. SE 50.6' top, center, tele, junct box NW 43.5'

6/2002 CCSSO found c.m. flush on E CR # 156, 3' ± W. of E CR # 106. Lower monument to 1.2' below surface. Witness as follows:

Tel Ped post N60°W 43.93' to 20d nail SW cor bottom step Byron Twp hall N33°E 183.3'
P. Pole S42°E 50.67' to dbl hd nail
S. Pole S77°W 166.05' to 20d nail

Evidence of Subsequent Corner Restoration Found
 Year of search _____ By _____
Certificate - Walt Cava - 1985
Doc # 286243
accept find I.P. and (2) 1915 ties
replace I.P. w/ cast iron monument
tele. junct box guard post N60W 43.93'
lower pole S77W 166.05'
lower pole S47E 50.73'
stone foundation (1915) S53E 72.9'
SW corner step (1915) N33E 183.3'