


T. 140 R. 26 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
E114 10 Corner common to sections 10, 11

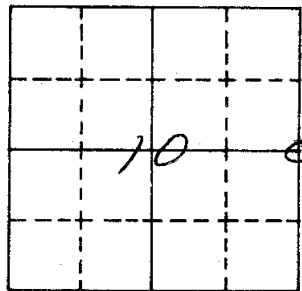

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

Species	Bearing	Trees
<u>BIRCH</u>	<u>8"</u>	<u>TAM.</u>
<u>8"</u>	<u>8"</u>	
<u>562W</u>	<u>N17E</u>	
<u>16 LKS</u>	<u>19 LKS.</u>	

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed ? By Geo. A. RALPH  
Location filed COUNTY SURVEY RECORD BOOK "B" P. 88-89  
Monument SURVEY OF STATE RURAL HWY # 83 TIES- SEE BOOK "B" P. 88-89  
1917 Book "B" P. 377-383 JOHN CURED TWO RALPH'S TIES: OAK S.W. 64.50', MAPLE N.W. 91.50'

Evidence of Subsequent Corner Restoration

Year of search 1917 By Alejs Nowak  
microfilm - Roll 105 BK 55 P. 81-82  
Same as 1917 - Book "B" P. 377-383  
also on microfilm - roll 115 BK 82 P. 27

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Bearing Trees, Reference Objects

Species	Diameter	Bearing	Distance
<u>Oak</u>	<u>old B.T.</u>	<u>SW</u>	<u>64.5</u>
<u>Maple</u>	<u>1</u>	<u>NW</u>	<u>91.5</u>
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1965 By R.F. Schneider  
Location filed \_\_\_\_\_  
Monument Set 1" iron pipe from old ties.  
Ties: 20" W. Oak S38W 64.5  
Book "D" / 2" I. Pipe S65 1/2 W 37.4  
P455 / P.P. N61W 41.5  
maple stump N53 1/2 W 91.5  
in E N-S road  
14.8' North of E road east

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
1989 Cert. Filed by David Landecker  
Doc. # 317223  
Found 4" County cast iron monument 9" below road surface. Set 3/8" x 1/2" rerod over found monument. Ties: 12" Red Oak N46W 102.42'; 27" White Pine N30 E 182.39'; Power pole S34E 165.03'; 10" Red Oak S56W 160.76'; 1 1/2" I.P. S69W 37.58' (1965 witness).

April 2005 J. Bankowske #24606  
Cert. of Survey shows monument found

1990 - W. Buckler - Certificate of Survey indicates iron monument found.

June 1928, J.H. Flynn  
Typed order shows corner

1999 - Levelling #16089 - Certificate indicates found iron pipe

corner GPS ccsa 8/14/02  
ccsa fd c/m down 0.1, 2' ± E of co. Rd. #161, 18' ± N. of E Krussow Dr.

Remonumentation certificate prepared \_\_\_\_\_  
Filed at \_\_\_\_\_

By \_\_\_\_\_  
Date \_\_\_\_\_

G-17