


T. 142 R. 31 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
N 1/4 28 Corner common to sections 21, 28

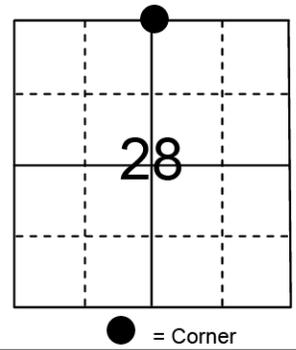

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873  
Original monument Post

Original Evidence Found

Year of search 1915 by Curo  
Monument found \_\_\_\_\_  
Curo Book 60, page 17

Bearing Trees

| Species  | <u>White Pine</u> | <u>White Pine</u> |
|----------|-------------------|-------------------|
| Diameter | <u>36"</u>        | <u>30"</u>        |
| Bearing  | <u>N 86° E</u>    | <u>S 88° W</u>    |
| Distance | <u>82 links</u>   | <u>126 links</u>  |

Original Bearing Trees Found

| Species  | <u>Pine stump</u> | <u>Pine stump</u> |
|----------|-------------------|-------------------|
| Diameter | <u>36"</u>        | <u>30"</u>        |
| Bearing  | <u>N 86° W</u>    | <u>S 88° W</u>    |
| Distance | <u>82 links</u>   | <u>126 links</u>  |

Subsequent Corner Restoration

Year surveyed 8/1915 By H.F. Baldwin, Deputy Co. Surv.  
Location filed: Survey Record #476, Bk C, pg 512, 515 and Curo Monument: Iron Track spike from Gov't B.T.s Curo Book 60, pages 16, 17, 58 and 79. states true 1/4 established by Curo sets 51' S. Standard I.M. is driven 36" in ground.

Evidence of Subsequent Corner Restoration

Year of search 8/1915 By P.M. Scott  
Location filed: Curo Book 78, pages 25, 38  
Monument: I.M. for corner  
Find true 1/4 sets 8.65' east the road 9' west. Baldwin, Scott & Horst set I.M. for No. 1/4 cor. sec 28.

Bearing Trees, Reference Objects

| Species  | <u>Pit</u>         | <u>Pit</u>         |
|----------|--------------------|--------------------|
| Diameter | <u>30"x30"x12"</u> | <u>30"x30"x12"</u> |
| Bearing  | <u>W</u>           | <u>E</u>           |
| Distance | <u>6'</u>          | <u>6'</u>          |

Bearing Trees, Reference Objects

| Species  | _____ | _____ |
|----------|-------|-------|
| Diameter | _____ | _____ |
| Bearing  | _____ | _____ |
| Distance | _____ | _____ |

Subsequent Corner Restoration

Year surveyed 10/1915 By J.W. Curo, LS 1428  
Location filed: Curo's Contract #11, Survey of Section 28  
Monument: Indicates known corner set from old bearing trees.

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Location filed: \_\_\_\_\_  
Monument: \_\_\_\_\_

7/1978, W.E. Curo, LS 11395  
Curo Book 297, page 91  
Indicates corner in survey for Andrews.

1981, G.H. Stevenson, LS 13684  
Certificate of Location  
Found iron monument.

2/1998, R. Main, USFS  
USFS Field Book 3, page 48  
Found monument on the E. shoulder of Co. Rd. #19, witness.  
21" Red Pine, N 52° E, 115.55' spike  
8" White Oak, S 3° W, 67.08' spike  
Steel Sign Post, West, 2.65'

4/2004, T.L. Freeman, LS 21367  
Certificate of Location  
Found 2.5" iron pipe with plumber cap, up 1' at edge of road.  
12" White Oak, S 3° W, 67.08' (1998)  
10" Birch, N 74° E, 30.78'  
Power Pole, N 32° E, 31.07'  
Steel Sign Post, West, 2.65' (1998)

