


T. 144 R. 26 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 24 Corner common to sections 13,24 and 18, 19/144/25

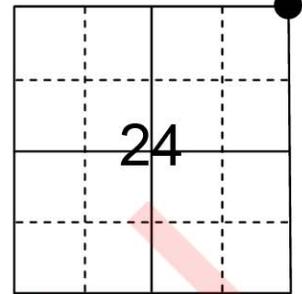

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873  
Original monument Post

Original Evidence Found

Year of search 1912 by Todd  
Monument found \_\_\_\_\_  
Survey Rec #211, Bk A, pg 517

Bearing Trees

Species	Cedar	Birch	Cedar	Cedar
Diameter	6"	6"	7"	5"
Bearing	S 55° W	N 84° E	N 80° W	S 80° E
Distance	14 links	16 links	15 links	18 links

Original Bearing Trees Found

Species	Cedar	Cedar
Diameter	6"	7"
Bearing	S 55° W	N 80° W
Distance	14 links	15 links

Subsequent Corner Restoration

Year surveyed 2/1903 By O.C. Gilbert  
Location filed: Road Calendar A, page 44  
Monument:  
Zuzu-Bear River Road, indicates corner at road corner.  
This information also in Road Calendar B, page 30.

Evidence of Subsequent Corner Restoration

Year of search 2/1912 By H.S. Todd  
Location filed: Survey Record #211, Book A, page 517 and Curo  
Monument: Set corner from witness trees  
Curo Book 98, page 80, two trees standing and plainly marked,  
the NE and SE trees have been grubbed out for a logging road.

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 12/1913 By J.W. Curo, LS 1428  
Location filed: Survey Record #322, Book B, page 413 and Curo  
Monument: Flag stake  
Curo Book 98, page 111  
  
7/1919, J.H. Flynn  
Survey Record #415, Book C, page 178  
Establish corner from road survey running S, and E. from corner.  
  
5/1931, H.A. Brills  
USFS 874-9  
Found Square stake, in fair condition, 4' high and witnesses  
12" J. Pine, N 32° W, 22 links  
14" N. Pine, N 67° E, 61 links  
8" J. Pine, S 49° W, F.S.L.P.  
  
3/1935, USFS  
Certificate of Location  
Found Tamarack post in good condition at centerline intersection of roads.  
  
1936, Hanson, USFS  
Certificate of Location  
Found a scribed post.

Evidence of Subsequent Corner Restoration Found

Year of search 12/1983 By J.R. Worcester, CCHD  
Location filed: S.P. 11-603-05  
Monument:  
Corner assumed at PI Station 74+65.4 and witnessed  
P. Pole, NW, 54.7'  
4" Balsam, SW, 89.7'  
  
4/1985, J.H. Parker, LS 9235  
Certificate of Location  
Excavated 8'x 8' hole, 5' deep at centerline intersection, no evidence of corner.  
  
10/1985, J.H. Parker, LS 9235  
Certificate of Location  
Set 5/8"x 36" aluminum rod monument with cap,  
7" Spruce, N 65° W, 108.89'  
11" Ash, N 55° E, 100.52'  
7" Ash, S 23° E, 88.82'  
12" Cedar, S 40° W, 126.05'  
  
7/2011, CCHD/SO  
#2011.015  
Set P.K. from 1985 witnesses, found 60d spike, down 0.7'  
probably PI by CCHD and add the following:  
P. Pole, N 44° W, 54.40'(CCHD)

Subsequent Corner Restoration

Evidence of Subsequent Corner Restoration Found


Year surveyed 8/2011 By CCHD/SO  
 Location filed: #2011.015  
 Monument: Set Mag nail  
 from witnesses after construction, 2.0'+,-, west of new  
 centerline CSAH #3.  
  
 7/2019, CCHD/SO  
 #2011.015  
 Found Conc. nail, 2.0', W. of centerline CSAH #3. 1984 and  
 2011 witnesses are good.

Year of search \_\_\_\_\_ By \_\_\_\_\_  
 Location filed: \_\_\_\_\_  
 Monument: \_\_\_\_\_

Index No. N 25

CASS COUNTY LAND CORNER RECORD

T. 144 R. R6 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NER4 Corner common to sections 13, 14 AND 18-19-144-25

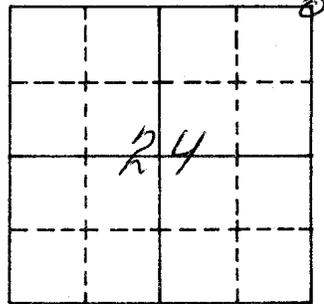

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873  
Original monument bst

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

		Bearing Trees	
Species	<u>Cedar</u>	<u>Birch</u>	<u>Cedar</u>
Diameter	<u>6"</u>	<u>6"</u>	<u>7"</u>
Bearing	<u>S55W</u>	<u>N84E</u>	<u>N80W</u>
Distance	<u>14LKS</u>	<u>16LKS</u>	<u>15LKS</u>

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

O = Corner

Subsequent Corner Restoration

Year surveyed 1912 By HARRY S. TODD  
Location filed COUNTY SURVEY RECORD BOOK "A" P 516-518  
Monument FIND OLD GOUT B.T.S: 7" CEDAR N80W 15LKS  
6" CEDAR S55W 14LKS  
1919 - JAMES FLYNN BOOK "C" P. 178 ESTABLISHED  
CORNER FROM PREVIOUS SURVEY.

Evidence of Subsequent Corner Restoration

Year of search \_\_\_\_\_ By \_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

Bearing Trees, Reference Objects

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Bearing Trees, Reference Objects

_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration N 25

Year surveyed \_\_\_\_\_ By \_\_\_\_\_  
Location filed \_\_\_\_\_  
Monument \_\_\_\_\_

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Certificate - Jim Parker - 1985  
Set obliterated 3/8" x 36" aluminum rod w/cap  
11" Ash N55E 100.52'  
7" Ash S23E 88.82'  
12" Cedar S40W 126.05'  
7" Spruce N65W 108.89'  
Doc. # 281801

Remonumentation certificate prepared \_\_\_\_\_ By \_\_\_\_\_  
Filed at \_\_\_\_\_ Date \_\_\_\_\_