


T. 144 R. 30 M. 5th Coordinates: X _____ Y _____
NE 1 Corner common to sections 1 and 6-144-29 and 31-145-29

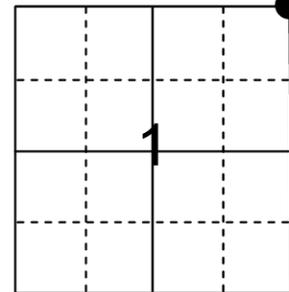

● = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument C.C. Post

Original Evidence Found

Year of search 1900 by COE
Monument found _____

Leech Lake Reservoir Map

Bearing Trees

Species Soft Maple Aspen
Diameter 4" 25"
Bearing S 29° E S 61° W
Distance 11 links 31 links

Original Bearing Trees Found

Species _____
Diameter _____
Bearing _____
Distance _____

Subsequent Corner Restoration

Year surveyed 1900 By H. Dunaway, COE
Location filed: Leech Lake Reservoir Map
Monument:
Map indicates a known corner.

Evidence of Subsequent Corner Restoration

Year of search 6/1930 By H.D. Craig, US Surveyor
Location filed: MN Hist. Soc. Resurvey Notes, pg. 5 T145N R29W
Monument: Set 6"x26" concrete mon. with brass cap S 31
up 4", at proportionate distance, which fits the S1/S6
original position, according to statements by R30W R29W
2 US Forest Service employees as to position T144N
and original trees destroyed by road construction CC
Bearing Trees, Reference Objects 1930

Bearing Trees, Reference Objects

Species _____
Diameter _____
Bearing _____
Distance _____

Species Elm Oak
Diameter 24" 23"
Bearing S 39° E S 38 1/2° W
Distance 37 links 76 links

Subsequent Corner Restoration

Year surveyed 8/1975 By C.R. Krause, USFS
Location filed: USFS Book 2, page 63
Monument: Found concrete mon. with brass cap
up 4" in good condition, 75' N. of FR #2135 and witnesses.
Elm stump, S 39° E, 37 links(24.42') (1930) rotted
Oak, S 39° W, 76 links(50.16') (1930) scribe rotted
13" White Oak, S 70° E, 55.85' marked T144N R29W S6 CC
10" Elm, S 72° W, 38.4' marked T144N R30W S1 CC
Steel Sign Post, S 24° E, 4.3' 54-2 and 54-4 signs
Steel Sign Post, West, 4.9' 54-2 and 54-4 signs
Elm, South, 75' Metal location poster

Evidence of Subsequent Corner Restoration Found


Year of search 5/2011 By T.L. Freeman, LS 21367
Location filed: Certificate of Location, A000578292
Monument: Found 6" GLO concrete with brass cap
up 6", mounded dirt around monument, 70' N. of Ketchum Rd.
and witnesses as follows.
16" White Oak, S 70° E, 55.85'(1975) spike in SW side
10" Balsam, N 52° W, 29.14' nail in NE side
9" Balsam, North, 35.33' nail in E. side
8" Maple, S 78° W, 57.65' nail in N. side
Steel Sign Post, S 24° E, 4.40'(1975)
Steel Sign Post, West, 4.80'(1975)

6/2000, R. Main, USFS
USFS Book 2, page 63
Found GLO concrete with brass cap, in clearcut, located with
GPS and notes witnesses as follow.
Elm, S 72° W, 38.4' windfall
17" White Oak, S 70° E, 55.85'(1975) add spike
Steel Sign Post, S 24° E, 4.3'(1975)
Steel Sign Post, West, 4.9'(1975)

Index No. A 25

CASS COUNTY LAND CORNER RECORD

T. 144 R. 30 M. 5TH Coordinates: X _____ Y _____
NE 1 Corner common to sections 1 AND 6-144-29

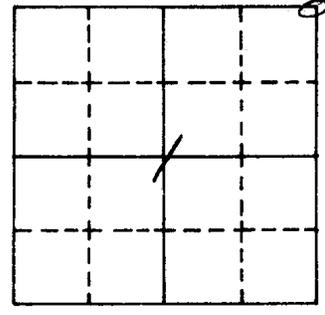

O = Corner

EXISTING SURVEYS

Original Government Survey

Year surveyed 1873
Original monument C.C. Post

Original Evidence Found

Year of search _____ By _____
Monument found _____

	Bearing Trees	
Species	<u>Soft Maple</u>	<u>Aspen</u>
Diameter	<u>4"</u>	<u>25"</u>
Bearing	<u>S 29 E</u>	<u>S 61 W</u>
Distance	<u>114ks</u>	<u>311ks</u>

Original Bearing Trees Found

Species	_____	_____	_____
Diameter	_____	_____	_____
Bearing	_____	_____	_____
Distance	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1930 By GLO
Location filed Sec. of State

Monument Set concrete mani proportionately 26" long
6" dia. w/brass cap T145N R29W
Set from testimony of Forest Service 531
employees who saw orig B.T.S. 51 | 56

	Bearing Trees, Reference Objects		
Species	<u>Elm</u>	<u>Oak</u>	<u>CC</u>
Diameter	<u>24"</u>	<u>23'</u>	<u>1930</u>
Bearing	<u>S 39 E</u>	<u>S 38 1/2 W</u>	
Distance	<u>374ks</u>	<u>764ks</u>	

Evidence of Subsequent Corner Restoration

Year of search _____ By _____

Bearing Trees, Reference Objects

_____	_____	_____	_____
_____	_____	_____	_____
_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed _____ By _____
Location filed _____
Monument _____

Evidence of Subsequent Corner Restoration Found

Year of search _____ By _____
CERTIFICATE - MILO STEFAN - 1975 - FILED IN 1980
Doc. # 258603
Found GLO monument in good condition
13" W. OAK S 70 E 55.85'
10" Elm S 72 W 38.40'

Remonumentation certificate prepared _____ By _____
Filed at _____ Date _____