


T. 144 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 7 Corner common to sections 5, 6, 7, 8

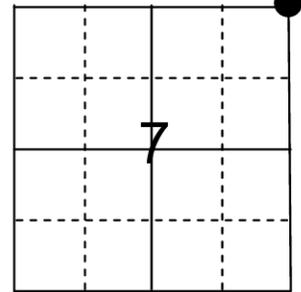

● = Corner

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed <u>1875</u>		Year of search <u>1930</u> by <u>Craig</u>	
Original monument <u>Post</u>		Monument found _____	
		Minn. Hist. Society, notes 146	

Bearing Trees				
Species	<u>Ironwood</u>	<u>Ironwood</u>	<u>Sugar</u>	<u>Lynnden</u>
Diameter	<u>4"</u>	<u>4"</u>	<u>4"</u>	<u>8"</u>
Bearing	<u>S 25° E</u>	<u>S 44° W</u>	<u>N 14° W</u>	<u>N 34° E</u>
Distance	<u>25 links</u>	<u>32 links</u>	<u>20 links</u>	<u>40 links</u>

Original Bearing Trees Found				
Species	<u>Basswood</u>	<u>Ironwood</u>	<u>Ironwood</u>	<u>Maple</u>
Diameter	<u>stump</u>	<u>8" snag</u>	<u>6" fallen</u>	<u>rotted stump</u>
Bearing	<u>N 35 1/2° E</u>	<u>S 5° E</u>	<u>S 44° W</u>	<u>N 12° W</u>
Distance	<u>40 links</u>	<u>25 links</u>	<u>32 links</u>	<u>20 links</u>

Subsequent Corner Restoration	
Year surveyed <u>8/1930</u> By <u>H.D. Craig, US Surveyor</u>	
Location filed: <u>Minn. Hist. Society, notes pg. 146 T144N R30W</u>	
Monument: <u>Set 2"x36" iron pipe with brass cap from remains of original witness trees and marked new witnesses as follows.</u>	<u>S6   S5</u> <u>S7   S8</u> <u>1930</u>

Evidence of Subsequent Corner Restoration	
Year of search <u>8/1934</u> By <u>J.A. Gjelhaug, Eng. CCC</u>	
Location filed: <u>Form 874-9</u>	
Monument: <u>Found brass capped pipe up 7" in good condition and witnesses as follow.</u>	

Bearing Trees, Reference Objects				
Species	<u>Red Oak</u>	<u>Red Oak</u>	<u>Maple</u>	<u>Birch</u>
Diameter	<u>5"</u>	<u>16"</u>	<u>5"</u>	<u>6"</u>
Bearing	<u>N 34 1/2° E</u>	<u>S 6 1/2° E</u>	<u>S 67 1/2° E</u>	<u>N 15 1/2° E</u>
Distance	<u>20 links</u>	<u>62 links</u>	<u>35 links</u>	<u>20 links</u>

Bearing Trees, Reference Objects				
Species	<u>Birch</u>	<u>Red Oak</u>	<u>White Oak</u>	<u>Maple</u>
Diameter	<u>6"(1930)</u>	<u>5"(1930)</u>	<u>16"(1930)</u>	<u>6"(1930)</u>
Bearing	<u>N 15° W</u>	<u>N 34°30' E</u>	<u>S 7° E</u>	<u>S 67°30' W</u>
Distance	<u>19 1/2 links</u>	<u>19 3/4 links</u>	<u>61 1/2 links</u>	<u>34 3/4 links</u>


Subsequent Corner Restoration	
Year surveyed <u>5/1970</u> By <u>D. Bergman, USFS</u>	
Location filed: <u>USFS Book 1, page 17</u>	
Monument: <u>Found GLO brass capped pipe run over by Cat, set up right, up 6" and witnesses as follow.</u>	
	<u>9" Maple, S 68° W, 23.10'(1930) scribe visible</u>
	<u>14" Red Oak, S 32° E, 82.8' scribed</u>
	<u>12" Basswood, S 70° E, 62.4' scribed</u>
	<u>13" Red Oak, S 30° W, 56.9' scribed</u>
	<u>4" Cedar Post, South, 1.7' 54-4 sign</u>

Evidence of Subsequent Corner Restoration Found	
Year of search _____ By _____	
Location filed: _____	
Monument: _____	

Index No. ES

CASS COUNTY LAND CORNER RECORD

T. 144 R. 30 M. 5TH Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 7 Corner common to sections 5, 6, 7, 8

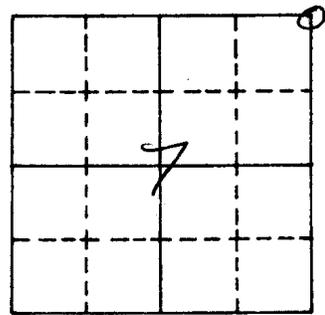

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875  
Original monument Post

Original Evidence Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
Monument found \_\_\_\_\_

	Bearing Trees			
Species	<u>Ironwood</u>	<u>Ironwood</u>	<u>Sugar</u>	<u>Lynn</u>
Diameter	<u>4"</u>	<u>4"</u>	<u>4"</u>	<u>8"</u>
Bearing	<u>S25E</u>	<u>S44W</u>	<u>N14W</u>	<u>N34E</u>
Distance	<u>25 LKS</u>	<u>32 LKS</u>	<u>20 LKS</u>	<u>40 LKS</u>

Original Bearing Trees Found				
Species	_____	_____	_____	_____
Diameter	_____	_____	_____	_____
Bearing	_____	_____	_____	_____
Distance	_____	_____	_____	_____

Subsequent Corner Restoration

Year surveyed 1930 By GLO  
Location filed Sec. of State  
Monument Find remains of all 4 BITS set 2x36"  
1/2" W / brass cap T144N R30W  
56 / 55  
57 / 58

Evidence of Subsequent Corner Restoration

Year of search 1970 By William Okerman  
Found GLO monument in good condition

	Bearing Trees, Reference Objects 1930			
Species	<u>R. Oak</u>	<u>R. Oak</u>	<u>Maple</u>	<u>Birch</u>
Diameter	<u>5"</u>	<u>16"</u>	<u>5"</u>	<u>6"</u>
Bearing	<u>N34 1/2 E</u>	<u>S6 1/2 E</u>	<u>S67 1/2 W</u>	<u>N15 1/2 W</u>
Distance	<u>20 LKS</u>	<u>62 LKS</u>	<u>35 LKS</u>	<u>20 LKS</u>

	Bearing Trees, Reference Objects			
	<u>R. Oak</u>	<u>Basswood</u>	<u>R. Oak</u>	<u>Cedar Post</u>
Diameter	<u>14"</u>	<u>12"</u>	<u>13"</u>	<u>4x4x72"</u>
Bearing	<u>S32E</u>	<u>S70E</u>	<u>S35W</u>	<u>South</u>
Distance	<u>82.80'</u>	<u>62.40'</u>	<u>56.90'</u>	<u>1.70'</u>

Subsequent Corner Restoration

Year surveyed \_\_\_\_\_ By \_\_\_\_\_  
Location filed \_\_\_\_\_  
Monument \_\_\_\_\_

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
CERTIFICATE - BILL OKERMAN - 1970

Remonumentation certificate prepared \_\_\_\_\_  
Filed at \_\_\_\_\_

By \_\_\_\_\_  
Date \_\_\_\_\_