


T. 144 R. 30 M. 5th Coordinates: X \_\_\_\_\_ Y \_\_\_\_\_  
NE 8 Corner common to sections 4, 5, 8, 9

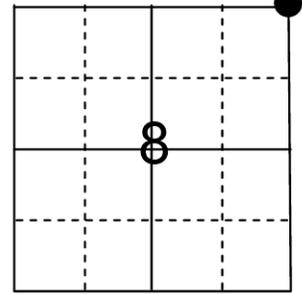

EXISTING SURVEYS

Original Government Survey

Year surveyed 1875  
 Original monument Post

Original Evidence Found

Year of search 1930 by Craig  
 Monument found \_\_\_\_\_  
 Minn. Hist. Society, notes 123

Bearing Trees

| Species  | Cedar   | Cedar    | Ash      | Ash      |
|----------|---------|----------|----------|----------|
| Diameter | 10"     | 12"      | 8"       | 8"       |
| Bearing  | N 46° E | S 80° E  | N 76° W  | S 62° W  |
| Distance | 4 links | 12 links | 13 links | 21 links |

Original Bearing Trees Found

| Species  | Cedar      | Cedar      | Black Ash | Black Ash |
|----------|------------|------------|-----------|-----------|
| Diameter | 16" fallen | 20" fallen | 16"       | 16"       |
| Bearing  | N 46° E    | S 82° E    | S 62° W   | N 80° W   |
| Distance | 4 links    | 12 links   | 21 links  | 13 links  |

Subsequent Corner Restoration

Year surveyed 7/1930 By H.D. Craig, US Surveyor  
 Location filed: Minn. Hist. Society, notes pg. 123 T144N R30W  
 Monument: Set 6"x26" concrete with brass cap  
 up 6", from remains of original witness trees  
 and marked new witnesses as follows.

S5 | S4  
S8 | S9  
 1930

Bearing Trees, Reference Objects

| Species  | Cedar       | Birch    |  |  |
|----------|-------------|----------|--|--|
| Diameter | 8"          | 10"      |  |  |
| Bearing  | N 30 3/4° E | S 60° E  |  |  |
| Distance | 59 links    | 80 links |  |  |

Evidence of Subsequent Corner Restoration

Year of search 10/1934 By J.A. Gjelhaug, Eng. CCC  
 Location filed: Form 874-9  
 Monument: Found brass capped cement  
 up 3" in good condition, W. of Cuba Hill Rd., placed a metal  
 location poster on the NW BT and notes witnesses as follow.

Bearing Trees, Reference Objects

| Species  | Ash        | Cedar    | Birch       | Ash          |
|----------|------------|----------|-------------|--------------|
| Diameter | 16"(1875)  | 7"(1930) | 7"(1930)    | 14"(1875)    |
| Bearing  | N 80°30' W | N 30° E  | S 60 1/4° E | S 62°15' W   |
| Distance | 12 links   | 58 links | 79 links    | 20 1/2 links |

Subsequent Corner Restoration

Year surveyed 10/1974 By C.R. Krause, USFS  
 Location filed: USFS Book 1, page 18  
 Monument: Found GLO brass capped concrete monument  
 up 4" in good condition, 130' N. of FR 3901, 325' W. of  
 FR 2133 and witnesses as follow.  
 Cedar stump, N 46° E, 2.6'(1875) and log  
 Cedar stump, S 80° E, 7.9'(1875) and log  
 20" Black Ash, N 80° W, 8.6'(1875) scribe rotted out  
 24" Black Ash, S 62° W, 13.9'(1875) scribe rotted out  
 10" Cedar, N 29° E, 38.9'(1930) scribe visible  
 12" Birch, S 63° E, 52.8'(1930) scribe visible  
 4" Cedar Post, North, 0.6' 54-4 sign

9/1978, M.E. Stefan, LS 12261, USFS  
 USFS Book 1, page 18  
 Found corner and marked new witnesses as follow.  
 10" Cedar, N 28° E, 85.62'  
 6" Black Ash, S 30° W, 37.01'  
 6" Black Ash, N 68° W, 41.59'

Evidence of Subsequent Corner Restoration Found

Year of search \_\_\_\_\_ By \_\_\_\_\_  
 Location filed: \_\_\_\_\_  
 Monument: \_\_\_\_\_

